

# PRIORITY DEVELOPMENT PROJECT (PDP) STORM WATER QUALITY MANAGEMENT PLAN (SWQMP) FOR

#### 2072 Via Casa Alta

Insert Permit Application Numbers
Drawing Number (If Applicable) & Internal Order Number (If Applicable)

#### **ENGINEER OF WORK:**

Faledal

Frank Larocca PE C75121 Provide Wet Signature and Stamp Above Line



#### PREPARED FOR:

Jade LJ, LLC 2072 Via Casa Alta La Jolla, 92037 Insert Telephone Number

#### PREPARED BY:



Labib Funk & Associates 319 Main St. El Segundo, CA, 90245 (213)239-3922

#### DATE:

January 13, 2025

Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



#### TABLE OF CONTENTS

- Acronyms
- Certification Page
- Submittal Record
- Project Vicinity Map
- FORM DS-560: Storm Water Applicability Checklist
- FORM I-1: Applicability of Permanent, Post-Construction Storm Water BMP Requirements
- FORM I-3B: Site Information Checklist for PDPs
- FORM I-4: Source Control BMP Checklist for All Development Projects
- FORM I-5: Site Design BMP Checklist for All Development Projects
- FORM I-6: Summary of PDP Structural BMPs
- FORM DS-563: Permanent BMP Construction, Self Certification Form
- Attachment 1: Backup for PDP Pollutant Control BMPs
  - o Attachment 1a: DMA Exhibit
  - o Attachment 1b: Tabular Summary of DMAs and Design Capture Volume Calculations
  - o Attachment 1c: Harvest and Use Feasibility Screening (when applicable)
  - o Attachment 1d: Categorization of Infiltration Feasibility Condition (when applicable)
  - o Attachment 1e: Pollutant Control BMP Design Worksheets / Calculations
- Attachment 2: Backup for PDP Hydromodification Control Measures
  - o Attachment 2a: Hydromodification Management Exhibit
  - o Attachment 2b: Management of Critical Coarse Sediment Yield Areas
  - o Attachment 2c: Geomorphic Assessment of Receiving Channels
  - o Attachment 2d: Flow Control Facility Design
- Attachment 3: Structural BMP Maintenance Plan
  - o Attachment 3a: Structural BMP Maintenance Thresholds and Actions
  - o Attachment 3b: Draft Maintenance Agreement (when applicable)
- Attachment 4: Copy of Plan Sheets Showing Permanent Storm Water BMPs
- Attachment 5: Project's Drainage Report
- Attachment 6: Project's Geotechnical and Groundwater Investigation Report



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



#### **ACRONYMS**

APN Assessor's Parcel Number

ASBS Area of Special Biological Significance

BMP Best Management Practice

CEQA California Environmental Quality Act

CGP Construction General Permit
DCV Design Capture Volume
DMA Drainage Management Areas
ESA Environmentally Sensitive Area
GLU Geomorphic Landscape Unit

GW Ground Water

HMP Hydromodification Management Plan

HSG Hydrologic Soil Group

HU Harvest and Use

INF Infiltration

LID Low Impact Development

LUP Linear Underground/Overhead Projects
MS4 Municipal Separate Storm Sewer System

N/A Not Applicable

NPDES National Pollutant Discharge Elimination System

NRCS Natural Resources Conservation Service

PDP Priority Development Project

PE Professional Engineer
POC Pollutant of Concern
SC Source Control
SD Site Design

SDRWQCB San Diego Regional Water Quality Control Board

SIC Standard Industrial Classification
SWPPP Stormwater Pollutant Protection Plan
SWQMP Storm Water Quality Management Plan

TMDL Total Maximum Daily Load

WMAA Watershed Management Area Analysis
WPCP Water Pollution Control Program
WQIP Water Quality Improvement Plan



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



#### **CERTIFICATION PAGE**

**Project Name:** 2072 Via Casa Alta

Permit Application Number: Insert Permit Application Number

I hereby declare that I am the Engineer in Responsible Charge of design of storm water BMPs for this project, and that I have exercised responsible charge over the design of the project as defined in Section 6703 of the Business and Professions Code, and that the design is consistent with the requirements of the Storm Water Standards, which is based on the requirements of SDRWQCB Order No. R9-2013-0001 as amended by R9-2015-0001 and R9-2015-0100 (MS4 Permit).

I have read and understand that the City Engineer has adopted minimum requirements for managing urban runoff, including storm water, from land development activities, as described in the Storm Water Standards. I certify that this PDP SWQMP has been completed to the best of my ability and accurately reflects the project being proposed and the applicable source control and site design BMPs proposed to minimize the potentially negative impacts of this project's land development activities on water quality. I understand and acknowledge that the plan check review of this PDP SWQMP by the City Engineer is confined to a review and does not relieve me, as the Engineer in Responsible Charge of design of storm water BMPs for this project, of my responsibilities for project design.

7

Foldal

Engineer of Work's Signature, PE Number & Expiration Date

Frank LaRocca


Print Name

Labib Funk & Associates

Company

November 20, 2024

Date

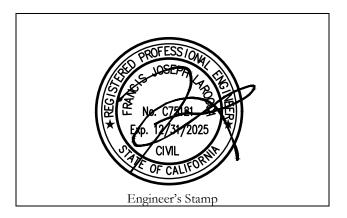



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



#### SUBMITTAL RECORD

Use this Table to keep a record of submittals of this PDP SWQMP. Each time the PDP SWQMP is re-submitted, provide the date and status of the project. In last column indicate changes that have been made or indicate if response to plancheck comments is included. When applicable, insert response to plancheck comments.

| Submittal<br>Number | Date          | Project Status                                    | Changes                   |
|---------------------|---------------|---|---------------------------|
| 1                   | 11/3/23       | ☑ Preliminary Design/Planning/CEQA ☑ Final Design | Initial Submittal         |
| 2                   | Enter a date. | ☐ Preliminary Design/Planning/CEQA ☐ Final Design | Click here to enter text. |
| 3                   | Enter a date. | ☐ Preliminary Design/Planning/CEQA ☐ Final Design | Click here to enter text. |
| 4                   | Enter a date. | ☐ Preliminary Design/Planning/CEQA ☐ Final Design | Click here to enter text. |




Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING




# PROJECT VICINITY MAP

**Project Name:** 2072 Via Casa Alta

**Permit Application Number:** Insert Application Number.

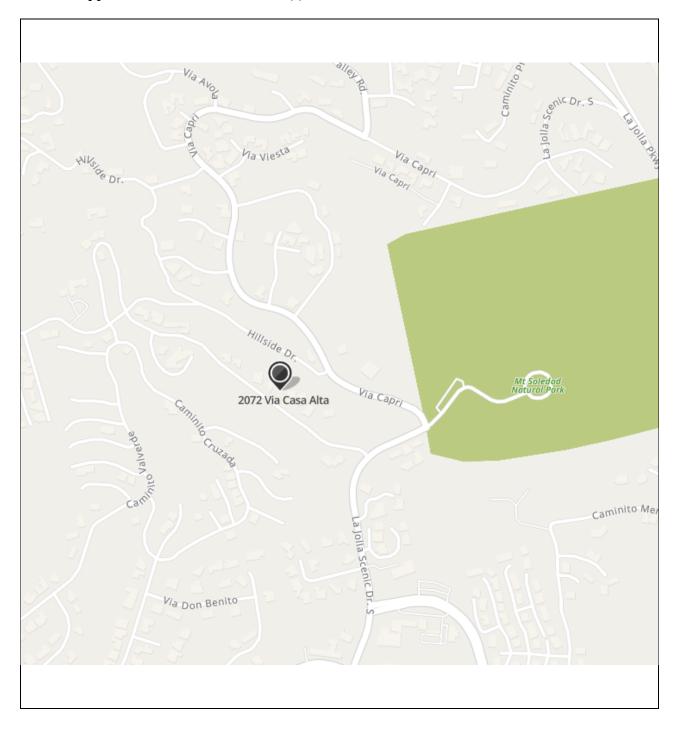





Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING





City of San Diego **Development Services** 1222 First Ave., MD-302 San Diego, CA 92101 (619) 446-5000

# **Storm Water Requirements Applicability Checklist**

**FORM DS-560** February 2016

| Project Address:                   |
|------------------------------------|
| 2072 Via Casa Alta, La Jolla 92037 |

Project Number (for the City Use Only): Click here to enter project number

#### **SECTION 1. Construction Storm Water BMP Requirements:**

All construction sites are required to implement construction BMPs in accordance with the performance standards in the Storm Water Standards Manual. Some sites are additionally required to obtain coverage under the State Construction General Permit (CGP)<sup>1</sup>, which is administrated by the State Water Resources Control Board.

For all projects complete PART A: If project is required to submit a SWPPP or WPCP

|     | ntinue to PART B.  |
|-----|--|
| PA  | ART A: Determine Construction Phase Storm Water Requirements.  |
| 1.  | Is the project subject to California's statewide General NPDES permit for Storm Water Discharges Associated with construction activities, also known as the State Construction General Permit (CGP)? (Typically projects with land disturbance greater than or equal to 1 acre.)   |
|     | Yes; SWPPP required, skip questions 2-4 • No; next question  |
| 2.  | Does the project propose construction or demolition activity, including but not limited to, clearing, grading, grubbing, excavation, or any other activity that results in ground disturbance and contact with storm water runoff?   |
|     | Yes; WPCP required, skip questions 3-4 No; next question   |
| 3.  | Does the project propose routine maintenance to maintain original line and grade, hydraulic capacity, or original purpose of the facility? (projects such as pipeline/utility replacement)   |
|     | Yes; WPCP required, skip questions 4  No; next question  |
| 4.  | <ul> <li>Does the project only include the following Permit types listed below?</li> <li>Electrical Permit, Fire Alarm Permit, Fire Sprinkler Permit, Plumbing Permit, Sign Permit, Mechanical Permit, Spa Permit.</li> <li>Individual Right of Way Permits that exclusively include one of the following activities and associated curb/sidewalk repair: water services, sewer lateral, storm drain lateral, or dry utility service.</li> <li>Right of Way Permits with a project footprint less than 150 linear feet that exclusively include only ONE of the following activities: curb ramp, sidewalk and driveway apron replacement, curb and gutter replacement, and retaining wall encroachments.</li> <li>Yes; no document required</li> </ul> |
| Che | eck one of the boxes to the right, and continue to PART B:    If you checked "Yes" for question 1,  a SWPPP is REQUIRED. Continue to PART B  |
|     | X If you checked "No" for question 1, and checked "Yes" for question 2 or 3, a <b>WPCP</b> is <b>REQUIRED</b> . If the project processes less than 5,000 square feet of ground disturbance AND has less than a 5-foot elevation change over the entire project area, a Minor WPCP may be required instead. <b>Continue to PART B.</b>  |
|     | ☐ If you checked "No" for all question 1-3, and checked "Yes" for question 4 PART B does not apply and no document is required. Continue to Section 2.   |
|     | More information on the City's construction BMP requirements as well as CGP requirements can be found at: <a href="https://www.sandiego.gov/stormwater/regulations/swguide/constructing.shtml">www.sandiego.gov/stormwater/regulations/swguide/constructing.shtml</a>  |





| Pag  | ge 2 of 4 City of San Diego • Development Services Department • Storm Water Requirements App  | plicability Checklist  |
|------|---|--|
|      |   |  |
| T c: | PART B: Determine Construction Site Priority. This prioritization must be completed within this form, noted on the plans, and included in the Stative reserves the right to adjust the priority of projects both before and after construction. Consisting an inspection frequency based on if the project has a "high threat to water quality." The ocal definition of "high threat to water quality" to the risk. Determination approach of the State of Permit (CGP). The CGP determines risk level based on project specific sediment risk and Additional inspection is required for projects within the Areas of Special Biological Significant NOTE: The construction priority does NOT change construction BMP requirements that apply determines the frequency of inspections that will be conducted by city staff. | astruction projects are<br>the City has aligned the<br>Construction General<br>receiving water risk.<br>ce (ASBS) watershed. |
| _    | mplete PART B and continued to Section 2  |  |
| 1.   | □ ASBS a. Projects located in the ASBS watershed. A map of the ASBS watershed can be found here https://www.waterboards.ca.gov/water_issues/programs/ocean/asbs_map.sh  | ntml   |
| 2.   | ☐ High Priority  a. Projects 1 acre or more determined to be Risk Level 2 or Risk Level 3 per the Construction on to located in the ASBS watershed.  b. Projects 1 acre or more determined to be LUP Type 2 or LUP Type 3 per the Construction not located in the ASBS watershed.   |  |
| 3.   | ☐ Medium Priority  a. Projects 1 acre or more but not subject to an ASBS or high priority designation.  b. Projects determined to be Risk Level 1 or LUP Type 1 per the Construction General Permit the ASBS watershed.   | t and not located in   |
| 4.   | <ul> <li>✓ Low Priority</li> <li>a. Projects not subject to ASBS, high or medium priority designation.</li> </ul>   |  |
| SE   | CTION 2. Permanent Storm Water BMP Requirements.  |  |
| Ado  | ditional information for determining the requirements is found in the Storm Water Standards M.  | anual.   |
| Pro  | RT C: Determine if Not Subject to Permanent Storm Water Requirements. pjects that are considered maintenance, or otherwise not categorized as "new development project development projects" according to the <a href="Storm Water Standards Manual">Storm Water Standards Manual</a> are not subject to Perma IPs.   |  |
| Per  | 'yes" is checked for any number in Part C, proceed to Part F and check "Not Subject to rmanent Storm Water BMP Requirements".   |  |
|      | 'no" is checked for all of the numbers in Part C continue to Part D.  |  |
| 1.   | Does the project only include interior remodels and/or is the project entirely within an existing enclosed structure and does not have the potential to contact storm water?  | Yes No   |
| 2.   | Does the project only include the construction of overhead or underground utilities without creating new impervious surfaces?   | Yes No   |
| 3.   | Does the project fall under routine maintenance? Examples include, but are not limited to: roof or exterior structure surface replacement, resurfacing or reconfiguring surface parking lots or existing roadways without expanding the impervious footprint, and routine replacement of damaged pavement (grinding, overlay, and pothole repair).  | Yes No   |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



| City of San Diego • Development Services Department • Storm Water Requirements Applicability Check  | klist Page 3 of 4 |  |  |  |  |
|---|-------------------|--|--|--|--|
| PART D: PDP Exempt Requirements.  |                   |  |  |  |  |
| PDP Exempt projects are required to implement site design and source control BMPs.  |                   |  |  |  |  |
| If "yes" was checked for any questions in Part D, continue to Part F and check the box label Exempt."  If "no" was checked for all questions in Part D, continue to Part E.   | ed "PDP           |  |  |  |  |
| Does the project ONLY include new or retrofit sidewalks, bicycle lanes, or trails that:   |                   |  |  |  |  |
| <ul> <li>Are designed and constructed to direct storm water runoff to adjacent vegetated areas, or other permeable areas? Or;</li> <li>Are designed and constructed to be hydraulically disconnected from paved streets and roads? Or</li> <li>Are designed and constructed with permeable pavements or surfaces in accordance with the Grand guidance in the City's Storm Water Standards manual?</li> </ul>   | Or;               |  |  |  |  |
| Yes; PDP exempt requirements apply  No; next question   |                   |  |  |  |  |
| <ol> <li>Does the project ONLY include retrofitting or redeveloping existing paved alleys, streets or roads designed and constructed in accordance with the Green Streets guidance in the <u>City's Storm Water Standards Manual?</u></li> <li>Yes; PDP exempt requirements apply</li> <li>No; PDP not exempt. PDP requirements apply.</li> </ol>   |                   |  |  |  |  |
| PART E: Determine if Project is a Priority Development Project (PDP). Projects that match one of the definitions below are subject to additional requirements including preparation of a Storm Water Quality Management Plan (SWQMP). If "yes" is checked for any number in PART E, continue to PART F and check the box labeled "Priority Development Project".  If "no" is checked for every number in PART E, continue to PART F and check the box labeled "Standard Project". |                   |  |  |  |  |
| 1. New Development that creates 10,000 square feet or more of impervious surfaces collectively over the project site. This includes commercial, industrial, residential, mixeduse, and public development projects on public or private land.   | • Yes • No        |  |  |  |  |
| 2. Redevelopment project that creates and/or replaces 5,000 square feet or more of impervious surfaces on an existing site of 10,000 square feet or more of impervious surfaces. This includes commercial, industrial, residential, mixed-use, and public development projects on public or private land.   | Yes No            |  |  |  |  |
| 3. New development or redevelopment of a restaurant. Facilities that sell prepared foods and drinks for consumption, including stationary lunch counters and refreshment stands selling prepared foods and drinks for immediate consumption (SIC 5812), and where the land development creates and/or replace 5,000 square feet or more of impervious surface.  | Yes No            |  |  |  |  |
| 4. New development or redevelopment on a hillside. The project creates and/or replaces 5,000 square feet or more of impervious surface (collectively over the project site) and where the development will grade on any natural slope that is twenty-five percent or greater.   | Yes No            |  |  |  |  |



| Pag  | e 4 of 4 City of San Diego • Development Services Department • Storm Water Requirem   | ents Applicability Checklist |
|------|---|------------------------------|
| 5.   | New development or redevelopment of a parking lot that creates and/or replace 5,000 square feet or more of impervious surface (collectively over the project sit  |                              |
| 6.   | New development or redevelopment of streets, roads, highways, freeways, and driveways. The project creates and/or replaces 5,000 square feet or more of impervious surface (collectively over the project site).  |                              |
| 7.   | New development or redevelopment discharging directly to an Environmentall Sensitive Area. The project creates and/or replaces 2,500 square feet of impervious surface (collectively over project site), and discharges directly to an Environmentally Sensitive Area (ESA). "Discharging- directly to" includes flow that is conveyed overladistance of 200 feet or less from the project to the ESA, or conveyed in a pipe or open channel any distance as an isolated flow from the project to the ESA (i.e. not comming with flows from adjacent lands).  | nd a Yes No                  |
| 8.   | New development or redevelopment projects of a retail gasoline outlet that crea and/or replaces 5,000 square feet of impervious surface. The development project meets the following criteria: (a) 5,000 square feet or more or (b) has a projected Avera Daily Traffic of 100 or more vehicles per day.  | t Dyes DNo                   |
| 9.   | New development or redevelopment projects of an automotive repair shops that creates and/or replaces 5,000 square feet or more of impervious surfaces.  Development projects categorized in any one of Standard Industrial Classification (SIG codes 5013, 5014, 5541, 7532-7534, or 7536-7539.   | Vac O No                     |
| 10.  | Other Pollutant Generating Project. The project is not covered in the categories ab results in the disturbance of one or more acres of land and is expected to generate pollutants post construction, such as fertilizers and pesticides. This does not include projects creating less than 5,000 sf of impervious surface and where added landscaping does not require regular use of pesticides and fertilizers, such as slope stabilization usin native plants. Calculation of the square footage of impervious surface need not include linear pathways that are for infrequent vehicle use, such as emergency maintenance acro bicycle pedestrian use, if they are built with pervious surfaces of if they sheet flow the surrounding pervious surfaces. | g<br>ng Yes No<br>e<br>cess  |
| PA   | RT F: Select the appropriate category based on the outcomes of PART C throug  | h PART E.                    |
| 1.   | The project is <b>NOT SUBJECT TO STORM WATER REQUIREMENTS</b> .   |                              |
| 2.   | The project is a <b>STANDARD PROJECT</b> . Site design and source control BMP requiapply. See the Storm Water Standards Manual for guidance.  | rements                      |
| 3.   | The project is <b>PDP EXEMPT</b> . Site design and source control BMP requirements appethe Storm Water Standards Manual for guidance.   | ply. See                     |
| 4.   | The project is a <b>PRIORITY DEVELOPMENT PROJECT</b> . Site design, source constructural pollutant control BMP requirements apply. See the <u>Storm Water Standards</u> for guidance on determining if project requires hydromodification management.   |                              |
|      | me of Owner or Agent (Please Print):  | , , , , , , , , , 1          |
|      |   | ere to enter title           |
| Sigi | nature: Date: No  | ovember 3, 2023              |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



# Applicability of Permanent, Post-Construction Storm Water BMP Requirements (Storm Water Intake Form for all Development Permit Applications)

Form I-1

Project Identification

Project Name: 2072 Via Casa Alta

Permit Application Number: Insert Application Number. Date: 11/3/23

#### Determination of Requirements

The purpose of this form is to identify permanent, post-construction requirements that apply to the project. This form serves as a short summary of applicable requirements, in some cases referencing separate forms that will serve as the backup for the determination of requirements.

Answer each step below, starting with Step 1 and progressing through each step until reaching "Stop". Refer to Part 1 of Storm Water Standards sections and/or separate forms referenced in each step below.

| Step   | Answer | Progression   |
|--|--------|---|
| Step 1: Is the project a "development project"? See Section 1.3 of the BMP Design Manual (Part | • Yes  | Go to Step 2.   |
| 1 of Storm Water Standards) for guidance.  | ■ No   | Stop. Permanent BMP requirements do not apply. No SWQMP will be required. Provide discussion below. |

Discussion / justification if the project is <u>not</u> a "development project" (e.g., the project includes <u>only</u> interior remodels within an existing building):

Click or tap here to enter text.

| Step 2: Is the project a Standard Project,<br>Priority Development Project (PDP), or<br>exception to PDP definitions?             | Standard<br>Project | Stop. Standard Project requirements apply.  |
|---|---------------------|---|
| To answer this item, see Section 1.4 of the BMP Design Manual (Part 1 of Storm Water Standards) in its entirety for guidance, AND | PDP                 | PDP requirements apply, including PDP SWQMP. Go to Step 3.  |
| complete Storm Water Requirements Applicability Checklist.  | PDP<br>Exempt       | Stop. Standard Project requirements apply. Provide discussion and list any additional requirements below. |

PDP SWQMP Template Date: January, 2016

PDP SWQMP Submittal Date: September 24, 2024 17



| Discussion /   | justification,  | and | additional | requirements | for | exceptions | to | PDP | definitions, | if |
|----------------|-----------------|-----|------------|--------------|-----|------------|----|-----|--------------|----|
| applicable:    |                 |     |            |              |     |            |    |     |              |    |
| Click or tap h | ere to enter te | xt. |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |
|                |                 |     |            |              |     |            |    |     |              |    |



| Form I.  | -1 Page 2       |  |
|--|-----------------|--|
| Step   | Answer          | Progression  |
| Step 3. Is the project subject to earlier PDP requirements due to a prior lawful approval? See Section 1.10 of the BMP Design Manual (Part 1 of Storm Water Standards) for guidance. | • Yes           | Consult the City Engineer to determine requirements. Provide discussion and identify requirements below. Go to Step 4.                               |
|  | • No            | BMP Design Manual PDP requirements apply. Go to Step 4.  |
| Discussion / justification of prior lawful approva lawful approval does not apply): Click or tap here to enter text.   | i, and identify | requirements ( <u>not required it prior</u>  |
| Step 4. Do hydromodification control requirements apply? See Section 1.6 of the BMP Design Manual (Part 1 of Storm Water Standards) for guidance.                                    | • Yes           | PDP structural BMPs required for pollutant control (Chapter 5) and hydromodification control (Chapter 6). Go to Step 5.                              |
|  | ■ No            | Stop. PDP structural BMPs required for pollutant control (Chapter 5) only. Provide brief discussion of exemption to hydromodification control below. |
| Discussion / justification if hydromodification co<br>Click or tap here to enter text  | ontrol require  | ments do <u>not</u> apply:   |
| Step 5. Does protection of critical coarse sediment yield areas apply? See Section 6.2 of the BMP Design Manual (Part 1 of Storm Water Standards) for guidance.                      | • Yes           | Management measures required for protection of critical coarse sediment yield areas (Chapter 6.2). Stop.   |
|  | <b>O</b> No     | Management measures not required for protection of critical coarse sediment yield areas. Provide brief discussion below. Stop.                       |

19

PDP SWQMP Template Date: January, 2016

PDP SWQMP Submittal Date: September 24, 2024



Discussion / justification if protection of critical coarse sediment yield areas does <u>not</u> apply: There are no CCYSAs onsite or upstream and draining through the proposed project site. Therefore, protection of CCSYAs does not apply.



| Site Information Checklist For PDPs Project Summary Information Form I-3B  |   |  |  |  |  |  |
|--|---|--|--|--|--|--|
| Project Sum  | imary Information   |  |  |  |  |  |
| Project Name   | 2072 Via Casa Alta  |  |  |  |  |  |
| Project Address  | 2072 Via Casa Alta, La Jolla 92037  |  |  |  |  |  |
| Assessor's Parcel Number(s) (APN(s))   | 352-750-15-00   |  |  |  |  |  |
| Permit Application Number  | Click here to enter text.   |  |  |  |  |  |
| Project Watershed  | Select One:  San Dieguito River  Penasquitos  Mission Bay San Diego River San Diego Bay Tijuana River |  |  |  |  |  |
| Hydrologic subarea name with Numeric Identifier up to two decimal paces (9XX.XX)   | 906.30  |  |  |  |  |  |
| Project Area (total area of Assessor's Parcel(s) associated with the project or total area of the right-of-              | 0.76 Acres ([SQFT] Square Feet)   |  |  |  |  |  |
| Area to be disturbed by the project (Project Footprint)  | 0.38 Acres (16,416 Square Feet)   |  |  |  |  |  |
| Project Proposed Impervious Area (subset of Project Footprint)   | 0.31 Acres (13,870 Square Feet)   |  |  |  |  |  |
| Project Proposed Pervious Area (subset of Project Footprint)   | .45 Acres (19,479 Square Feet)  |  |  |  |  |  |
| Note: Proposed Impervious Area + Proposed I<br>This may be less than the Project Area.                                   | Pervious Area = Area to be Disturbed by the Project.  |  |  |  |  |  |
| The proposed increase or decrease in impervious area in the proposed condition as compared to the pre-project condition. | Increase 100.0 %  |  |  |  |  |  |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024





| Form I-3B Page 2 of 11  |
|---|
| Description of Existing Site Condition and Drainage Patterns              |
| Current Status of the Site (select all that apply):                       |
| ☐ Existing development  |
| ☐ Previously graded but not built out                                     |
| ☐ Agricultural or other non-impervious use                                |
| ✓ Vacant, undeveloped/natural   |
| Description / Additional Information:                                     |
| Click or tap here to enter text.  |
|   |
|   |
| Existing Land Cover Includes (select all that apply):                     |
| ✓ Vegetative Cover  |
| □ Non-Vegetated Pervious Areas  |
| ☐ Impervious Areas  |
| Description / Additional Information:                                     |
| Click or tap here to enter text.  |
|   |
|   |
|   |
| Underlying Soil belongs to Hydrologic Soil Group (select all that apply): |
| □ NRCS Type A   |
| □ NRCS Type B   |
| □ NRCS Type C   |
| ✓ NRCS Type D   |
| Approximate Depth to Groundwater (GW):                                    |
| ☐ GW Depth < 5 feet   |
| 5 feet < GW Depth < 10 feet   |
| 10 feet < GW Depth < 20 feet  |
| ☑ GW Depth > 20 feet  |
| Existing Natural Hydrologic Features (select all that apply):             |
| □ Watercourses  |
|   |
|   |
| □ Wetlands  |
| ✓ None  |
| Description / Additional Information:                                     |
| Click or tap here to enter text.  |
|   |
|   |
|   |
|   |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



## Form I-3B Page 3 of 11

#### Description of Existing Site Topography and Drainage:

How is storm water runoff conveyed from the site? At a minimum, this description should answer:

- 1. Whether existing drainage conveyance is natural or urban;
- 2. If runoff from offsite is conveyed through the site? If yes, quantification of all offsite drainage areas, design flows, and locations where offsite flows enter the project site and summarize how such flows are conveyed through the site;
- 3. Provide details regarding existing project site drainage conveyance network, including storm drains, concrete channels, swales, detention facilities, storm water treatment facilities, and natural and constructed channels;
- 4. Identify all discharge locations from the existing project along with a summary of the conveyance system size and capacity for each of the discharge locations. Provide summary of the pre-project drainage areas and design flows to each of the existing runoff discharge locations.

Description / Additional Information:



| Water from the project site conveyance is natual. No runoff from offsite is conveyed through the site.  |
|---|
| The existing site a natural undeveloped lot. Water sheet flows from South to North and into an existing |
| The existing site a natural undeveloped lot. Water sheet flows from south to North and into an existing |
| concrete swale along Hillside Drive.  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |

## Form I-3B Page 4 of 11

# Description of Proposed Site Development and Drainage Patterns

Project Description / Proposed Land Use and/or Activities:

The proposed site includes a new 2-story single family residence, basement and detaached ADU, miscellaneous landscape, pool, and hardscape.

List/describe proposed impervious features of the project (e.g., buildings, roadways, parking lots, courtyards, athletic courts, other impervious features):

Roof, building, pavement

List/describe proposed pervious features of the project (e.g., landscape areas):

Does the project include grading and changes to site topography?

Landscape planters at various roof decks and ground level.

Yes

No

Description / Additional Information:

The vacant lot will be graded involving cut & fill for the proposed single family residence.





# Form I-3B Page 5 of 11 Does the project include changes to site drainage (e.g., installation of new storm water conveyance systems)? Yes No If yes, provide details regarding the proposed project site drainage conveyance network, including storm drains, concrete channels, swales, detention facilities, storm water treatment facilities, natural and constructed channels, and the method for conveying offsite flows through or around the proposed project site. Identify all discharge locations from the proposed project site along with a summary of the conveyance system size and capacity for each of the discharge locations. Provide a summary of pre and post-project drainage areas and design flows to each of the runoff discharge locations. Reference the drainage study for detailed calculations. Description / Additional Information: The proposed residuece will capture all runoff from impervious areas by area drains, trench drains, and downspout and convey the storm water to a modular wetland biofiltration system with upstream detention. The 100-YR storm volume will be retained on-site. Any overflow be conveyed to an energy dissipation device and sheet flow to the hillside



| Form I-3B Page 6 of 11  |
|---|
| Identify whether any of the following features, activities, and/or pollutant source areas will be present |
| (select all that apply):  |
| ✓ On-site storm drain inlets  |
| ✓ Interior floor drains and elevator shaft sump pumps   |
| ☐ Interior parking garages  |
| ☐ Need for future indoor & structural pest control  |
| ☐ Landscape/Outdoor Pesticide Use  ✓ Pools, spas, ponds, decorative fountains, and other water features   |
| Food service  |
| ☐ Refuse areas  |
| ☐ Industrial processes  |
| Outdoor storage of equipment or materials   |
| ☐ Vehicle and Equipment Cleaning  |
| ☐ Vehicle/Equipment Repair and Maintenance  |
| ☐ Fuel Dispensing Areas   |
| ☐ Loading Docks   |
| ✓ Fire Sprinkler Test Water   |
| ☐ Miscellaneous Drain or Wash Water   |
| ✓ Plazas, sidewalks, and parking lots   |
| ☐ Large Trash Generating Facilities ☐ Animal Facilities   |
| ☐ Plant Nurseries and Garden Centers  |
| ☐ Automotive-related Uses   |
|   |
|   |
|   |
| Description / Additional Information:   |
| Click or tap here to enter text.  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



## Form I-3B Page 7 of 11

#### Identification and Narrative of Receiving Water

Narrative describing flow path from discharge location(s), through urban storm conveyance system, to receiving creeks, rivers, and lagoons and ultimate discharge location to Pacific Ocean (or bay, lagoon, lake or reservoir, as applicable)

The site discharge from the curb face on Via Casa Alta and flow South towards La Jolla Scenic Dr. and beyond

Provide a summary of all beneficial uses of receiving waters downstream of the project discharge locations.

Click or tap here to enter text.

Identify all ASBS (areas of special biological significance) receiving waters downstream of the project discharge locations.

See map

Provide distance from project outfall location to impaired or sensitive receiving waters.

Sumarize information regarding the proximity of the permanent, post-construction storm water BMPs to the City's Multi-Habitat Planning Area and environmentally sensitive lands

The project is within the Multi-Habitat Planning area and environmentally sensative lands and the storm water BMP will not be within this area and stormwater runoff will be captured and filtered before released.



PDP SWQMP Submittal Date: September 24, 2024



## Form I-3B Page 8 of 11

#### Identification of Receiving Water Pollutants of Concern

List any 303(d) impaired water bodies within the path of storm water from the project site to the Pacific Ocean (or bay, lagoon, lake or reservoir, as applicable), identify the pollutant(s)/stressor(s) causing impairment, and identify any TMDLs and/or Highest Priority Pollutants from the WQIP for the impaired water bodies:

| 303(d) Impaired Water Body       | Pollutant(s)/Stressor(s)         | TMDLs/ WQIP Highest<br>Priority Pollutant |
|----------------------------------|----------------------------------|---|
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
|                                  | Click or tap here to enter text. | Click or tap here to enter text.          |
| Click or tap here to enter text. | Click or tap here to enter text. | Click or tap here to enter text.          |
| Click or tap here to enter text. | Click or tap here to enter text. | Click or tap here to enter text.          |

#### Identification of Project Site Pollutants\*

Identify pollutants anticipated from the project site based on all proposed use(s) of the site (see BMP Design Manual (Part 1 of Storm Water Standards) Appendix B.6):

| Pollutant                      | Not Applicable to the<br>Project Site | Anticipated from the Project Site | Also a Receiving<br>Water Pollutant of<br>Concern |
|--------------------------------|---------------------------------------|-----------------------------------|---|
| Sediment                       | o                                     |                                   | D   |
| Nutrients                      | o                                     |                                   | П   |
| Heavy Metals                   | o                                     |                                   | П   |
| Organic Compounds              | o                                     |                                   |   |
| Trash & Debris                 | o                                     |                                   | D   |
| Oxygen Demanding<br>Substances | o                                     |                                   | П   |
| Oil & Grease                   | o                                     |                                   | П   |
| Bacteria & Viruses             | o                                     |                                   |   |

PDP SWQMP Template Date: January, 2016

PDP SWQMP Submittal Date: September 24, 2024



<sup>\*</sup>Identification of project site pollutants is only required if flow-thru treatment BMPs are implemented onsite in lieu of retention or biofiltration BMPs (note the project must also participate in an alternative compliance program unless prior lawful approval to meet earlier PDP requirements is demonstrated)

| Pesticides | o |  |  |
|------------|---|--|--|
|------------|---|--|--|

| Form I-3B Page 9 of 11  |
|---|
| Hydromodification Management Requirements   |
| <ul> <li>Do hydromodification management requirements apply (see Section 1.6 of the BMP Design Manual)?</li> <li>Yes, hydromodification management flow control structural BMPs required.</li> <li>No, the project will discharge runoff directly to existing underground storm drains discharging directly to water storage reservoirs, lakes, enclosed embayments, or the Pacific Ocean.</li> <li>No, the project will discharge runoff directly to conveyance channels whose bed and bank are concrete-lined all the way from the point of discharge to water storage reservoirs, lakes, enclosed embayments, or the Pacific Ocean.</li> <li>No, the project will discharge runoff directly to an area identified as appropriate for an exemption by the WMAA for the watershed in which the project resides.</li> </ul> |
| Description / Additional Information (to be provided if a 'No' answer has been selected above):   |
|   |
| Critical Coarse Sediment Yield Areas*   |
| *This Section only required if hydromodification management requirements apply  |
| Based on Section 6.2 and Appendix H does CCSYA exist on the project footprint or in the upstream area draining through the project footprint?  Yes No, No critical coarse sediment yield areas to be protected based on WMAA maps   |
| Discussion / Additional Information: Click or tap here to enter text.   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |


PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



# Form I-3B Page 10 of 11

Flow Control for Post-Project Runoff\*

| *This Section only required if hydromodification management requirements apply                    |
|---|
| List and describe point(s) of compliance (POCs) for flow control for hydromodification management |
| (see Section 6.3.1). For each POC, provide a POC identification name or number correlating to the |
| project's HMP Exhibit and a receiving channel identification name or number correlating to the    |
| project's HMP Exhibit.  |
| Click or tap here to enter text.  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
| Has a geomorphic assessment been performed for the receiving channel(s)?                          |
| No, the low flow threshold is 0.1Q2 (default low flow threshold)                                  |
| Yes, the result is the low flow threshold is 0.1Q2  |
| Yes, the result is the low flow threshold is 0.3Q2  |
| Yes, the result is the low flow threshold is 0.5Q2  |
|   |
| If a geomorphic assessment has been performed, provide title, date, and preparer:                 |
| Click or tap here to enter text.  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
| Discussion / Additional Information: (optional)   |
| Click or tap here to enter text.  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |





## Form I-3B Page 11 of 11

## Other Site Requirements and Constraints

When applicable, list other site requirements or constraints that will influence storm water management design, such as zoning requirements including setbacks and open space, or local codes governing minimum street width, sidewalk construction, allowable pavement types, and drainage requirements.

The property is within a MHPA zone and is subject to environmentally sensitive lands...

## Optional Additional Information or Continuation of Previous Sections As Needed

This space provided for additional information or continuation of information from previous sections as needed.

Click or tap here to enter text.







Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



## Source Control BMP Checklist for All Development Projects

Form I-4

#### Source Control BMPs

All development projects must implement source control BMPs SC-1 through SC-6 where applicable and feasible. See Chapter 4 and Appendix E of the BMP Design Manual (Part 1 of the Storm Water Standards) for information to implement source control BMPs shown in this checklist.

Answer each category below pursuant to the following.

- "Yes" means the project will implement the source control BMP as described in Chapter 4 and/or Appendix E of the BMP Design Manual. Discussion / justification is not required.
- "No" means the BMP is applicable to the project but it is not feasible to implement. Discussion / justification must be provided.
- "N/A" means the BMP is not applicable at the project site because the project does not include the feature that is addressed by the BMP (e.g., the project has no outdoor materials storage areas). Discussion / justification may be provided.

| areas). Discussion / justification may be provided.  |          |         |              |
|--|----------|---------|--------------|
| Source Control Requirement   | Applied? |         |              |
| SC-1 Prevention of Illicit Discharges into the MS4   | Yes      | No      | <b>⊙</b> N/A |
| Discussion / justification if SC-1 not implemented:  |          |         |              |
| SC-2 Storm Drain Stenciling or Signage   | Yes      | □<br>No | <b>□</b> N/A |
| Discussion / justification if SC-2 not implemented:  |          |         |              |
| SC-3 Protect Outdoor Materials Storage Areas from Rainfall, Run-On, Runoff, and Wind Dispersal                           | Yes      | No      | <b>⊙</b> N/A |
| Discussion / justification if SC-3 not implemented:  |          |         |              |
| SC-4 Protect Materials Stored in Outdoor Work Areas from Rainfall,<br>Run-On, Runoff, and Wind Dispersal                 | Yes      | No      | <b>□</b> N/A |
| Discussion / justification if SC-4 not implemented:  SC-5 Protect Trash Storage Areas from Rainfall, Run-On, Runoff, and |          |         |              |
| Wind Dispersal   | Yes      | No      | ■N/A         |

PDP SWQMP Template Date: January, 2016

PDP SWQMP Submittal Date: September 24, 2024



Discussion / justification if SC-5 not implemented:

Project Name: 2072 Via Casa Alta

39



| Form I-4 Page 2 of 2   |            |                         |              |
|--|------------|-------------------------|--------------|
| Source Control Requirement   |            | Applied                 | l?           |
| SC-6 Additional BMPs Based on Potential Sources of Runoff Pollutant  | s (must an | swer for e              | each source  |
| listed below)  |            |                         | -            |
| On-site storm drain inlets   | • Yes      | □No                     | □N/A         |
| Interior floor drains and elevator shaft sump pumps  | • Yes      | □No                     | □N/A         |
| Interior parking garages   | Yes        | $\square_{\mathrm{No}}$ | <b>⊙</b> N/A |
| Need for future indoor & structural pest control   | Yes        | □No                     | ■N/A         |
| Landscape/Outdoor Pesticide Use  | Yes        | $\square_{\mathrm{No}}$ | ■N/A         |
| Pools, spas, ponds, decorative fountains, and other water features   | •Yes       | □No                     | □N/A         |
| Food service   | Yes        | □No                     | ■N/A         |
| Refuse areas   | Yes        | □No                     | ■N/A         |
| Industrial processes   | Yes        | □No                     | <b>⊙</b> N/A |
| Outdoor storage of equipment or materials  | Yes        | □No                     | <b>⊙</b> N/A |
| Vehicle/Equipment Repair and Maintenance   | Yes        | □No                     | <b>⊙</b> N/A |
| Fuel Dispensing Areas  | Yes        | DNo                     | ON/A         |
| Loading Docks  | Yes        | □No                     | ■N/A         |
| Fire Sprinkler Test Water  | • Yes      | □No                     | □N/A         |
| Miscellaneous Drain or Wash Water  | Yes        | □No                     | ON/A         |
| Plazas, sidewalks, and parking lots  | •Yes       | □No                     | □N/A         |
| SC-6A: Large Trash Generating Facilities   | Yes        | $\square_{\mathrm{No}}$ | <b>⊙</b> N/A |
| SC-6B: Animal Facilities   | Yes        | $\square_{\mathrm{No}}$ | <b>⊙</b> N/A |
| SC-6C: Plant Nurseries and Garden Centers  | Yes        | □No                     | ■N/A         |
| SC-6D: Automotive-related Uses   | Yes        | No                      | <b>⊙</b> N/A |
| Discussion / justification if SC-6 not implemented. Clearly identify which sources of runoff pollutants are discussed. Justification must be provided for all "No" answers shown above. Click or tap here to enter text. |            |                         |              |
|  |            |                         |              |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



## Site Design BMP Checklist for All Development Projects Form I-5

#### Site Design BMPs

All development projects must implement site design BMPs SD-1 through SD-8 where applicable and feasible. See Chapter 4 and Appendix E of the BMP Design Manual (Part 1 of Storm Water Standards) for information to implement site design BMPs shown in this checklist.

Answer each category below pursuant to the following.

- "Yes" means the project will implement the site design BMP as described in Chapter 4 and/or Appendix E of the BMP Design Manual. Discussion / justification is not required.
- "No" means the BMP is applicable to the project but it is not feasible to implement. Discussion / justification must be provided.
- "N/A" means the BMP is not applicable at the project site because the project does not include the feature that is addressed by the BMP (e.g., the project site has no existing natural areas to conserve). Discussion / justification may be provided.

A site map with implemented site design BMPs must be included at the end of this checklist.

| Site Design Requirement  | Applied?      |                         |                   |
|--|---------------|-------------------------|-------------------|
| SD-1 Maintain Natural Draiange Pathways and Hydrologic Features      | □Yes □No □N/A |                         |                   |
| Discussion / justification if SD-1 not implemented:                  |               |                         |                   |
| Existing site drainage sheet flows to concrete swale on Hillside Dr. |               |                         |                   |
|  |               |                         |                   |
|  |               |                         |                   |
|  |               |                         |                   |
|  |               |                         |                   |
|  |               |                         |                   |
|  |               |                         |                   |
|  |               | Г                       |                   |
| 1- Are existing natural drainage pathways and hydrologic features    | Yes           | $\square_{\mathrm{No}}$ | <b>⊙</b> N/A      |
| 1 mapped on the site map?  |               |                         |                   |
| 1- Are street trees implemented? If yes, are they shown on the       | Yes           | □No                     | <b>⊙</b> N/A      |
| 2 site map?  | - 103         |                         |                   |
| 1- Implemented street trees meet the design criteria in SD-1 Fact    | Yes           | □No                     | <b>□</b> N/A      |
| 3 Sheet (e.g. soil volume, maximum credit, etc.)?                    | 1 CS          | 110                     | ■ 1 <b>\</b> / /1 |
| 1- Is street tree credit volume calculated using Appendix B.2.2.1    | Yes           | □No                     | <b>⊙</b> N/A      |
| 4 and SD-1 Fact Sheet in Appendix E?                                 | - res         | 110                     | 1N/A              |
| SD-2 Have natural areas, soils and vegetation been conserved?        | • Yes         | □No                     | □N/A              |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



| Discussion / justification if SD-2 not implemented: |
|---|
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |

| Form I-5 Page 2 of 4   |              |                         |              |
|--|--------------|-------------------------|--------------|
| Site Design Requirement  |              | Applied?                |              |
| SD-3 Minimize Impervious Area  | Yes          | <b>⊙</b> No             | □N/A         |
| Discussion / justification if SD-3 not implemented: The existing site has no impervious area. The proposed development by 13,870 SF. | t will decre | ase imper               | vious area   |
| SD-4 Minimize Soil Compaction  | Yes          | <b>⊙</b> No             | □N/A         |
| Discussion / justification if SD-4 not implemented: Click or tap here to enter text.   |              |                         |              |
| SD-5 Impervious Area Dispersion  | Yes          | $\square_{\mathrm{No}}$ | <b>⊙</b> N/A |
| Discussion / justification if SD-5 not implemented: Click or tap here to enter text.   |              |                         |              |
| 5- Is the pervious area receiving runon from impervious area identified on the site map?   | Yes          | ŌNo                     |              |
| 5- Does the pervious area satisfy the design criteria in SD-5 Fact 2 Sheet in Appendix E (e.g. maximum slope, minimum length, etc.)  | □Yes         | o No                    |              |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



| 5- | Is impervious area dispersion credit volume calculated using | □Voc | <b>⊡</b> No |  |
|----|--|------|-------------|--|
| 3  | Appendix B.2.1.1 and SD-5 Fact Sheet in Appendix E?          | 1 05 | 110         |  |

| Form I-5 Page 3 of 4   |              |             |              |
|--|--------------|-------------|--------------|
| Site Design Requirement  | Applied?     |             |              |
| SD-6 Runoff Collection   | Yes          | □No         | <b>⊙</b> N/A |
| Discussion / justification if SD-6 not implemented: The majority impervious area of the site is roof only. The rain water flowing through roof down spouts and conveyed to the site BMP. All site hardscape will also be captured by area drains and trench drains and conveyed to the the site BMP. |              |             |              |
| 6a-1 Are green roofs implemented in accordance with design criteria in SD-6A Fact Sheet? If yes, are they shown on the site map?   | □Yes         | <b>□</b> No | □N/A         |
| 6a-2 Is green roof credit volume calculated using Appendix B.2.1.2 and SD-6A Fact Sheet in Appendix E?   | □Yes         | <b>⊙</b> No | □N/A         |
| 6b- Are permeable pavements implemented in accordance with design criteria in SD-6B Fact Sheet? If yes, are they shown on the site map?  | □Yes         | ■No         | □N/A         |
| 6b- Is permeable pavement credit volume calculated using 2 Appendix B.2.1.3 and SD-6B Fact Sheet in Appendix E?  | Yes          | ŌNo         | □N/A         |
| SD-7 Landscaping with Native or Drought Tolerant Species   | <b>⊙</b> Yes | □No         | □N/A         |
| Discussion / justification if SD-7 not implemented: Click or tap here to enter text.   |              |             |              |
| SD-8 Harvesting and Using Precipitation  | Yes          | <b>⊙</b> No | □N/A         |
| Discussion / justification if SD-8 not implemented: Click or tap here to enter text.   |              |             |              |



|   | 1  | Are rain barrels implemented in accordance with design criteria in SD-8 Fact Sheet? If yes, are they shown on the site map? | Yes                     |     |                           |
|---|----|---|-------------------------|-----|---------------------------|
|   | 8- | Is rain barrel credit volume calculated using Appendix B.2.2.2  | $\Pi_{\mathbf{V}_{oc}}$ | ПNo | D NI / Δ                  |
| l | 2  | and SD-8 Fact Sheet in Appendix E?  | 168                     | 110 | $\mathbf{H}^{1}(\Lambda)$ |

| Form I-5 Page 4 of 4                                  |
|---|
| Insert Site Map with all site design BMPs identified: |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
| Insert Site Map Here.                                 |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |

#### Summary of PDP Structural BMPs

Form I-6

#### PDP Structural BMPs

All PDPs must implement structural BMPs for storm water pollutant control (see Chapter 5 of the BMP Design Manual, Part 1 of Storm Water Standards). Selection of PDP structural BMPs for storm water pollutant control must be based on the selection process described in Chapter 5. PDPs subject to hydromodification management requirements must also implement structural BMPs for flow control for hydromodification management (see Chapter 6 of the BMP Design Manual). Both storm water pollutant control and flow control for hydromodification management can be achieved within the same structural BMP(s).

PDP structural BMPs must be verified by the City at the completion of construction. This includes requiring the project owner or project owner's representative to certify construction of the structural BMPs (complete Form DS-563). PDP structural BMPs must be maintained into perpetuity (see Chapter 7 of the BMP Design Manual).

Use this form to provide narrative description of the general strategy for structural BMP implementation at the project site in the box below. Then complete the PDP structural BMP summary information sheet (page 3 of this form) for each structural BMP within the project (copy the BMP summary information page as many times as needed to provide summary information for each individual structural BMP).







Describe the general strategy for structural BMP implementation at the site. This information must describe how the steps for selecting and designing storm water pollutant control BMPs presented in Section 5.1 of the BMP Design Manual were followed, and the results (type of BMPs selected). For projects requiring hydromodification flow control BMPs, indicate whether pollutant control and flow control BMPs are integrated or separate.

A portion of the site in the MHPA will be self mitigating and remain natural and untreated. The portion of the site creating 13,870 SF of new impervious surface will be captured and treated. The project is located in a hillside area with slope greater than 25% and infiltration is not feasible. Table B.3-1 in Attachment 1 shows that harvest and use is not feasible. Table B.6-1 in Attachment 1 provide the documentation for compliance with pollutant control BMP sizing requirements for flow-thru design flows. The proposed treatment system with retention and biofiltration is implemented to meet the flow control requirements for hydromodification. Calculations for flow control and orifice sizing are included in Attachment 2. The 100-YR volume as determined in the Drainage Study is 2,273CF. Calculations for this increase are included in Attachment 5 Drainage Report. The modular wetland biofiltration system has a treament flow of 0.052 CFS. The 100-YR volume will be stored in the upstream storage tank.

(Continue on page 2 as necessary.)



| Form I-6 Page 2 of X   |  |
|--|--|
| (Page reserved for continuation of description of general strategy for structural BMP implementation |  |
| at the site)   |  |
| (Continued from page 1)  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |



| Form I-6 Page 3 of X (Copy as many as needed)  |   |  |  |
|--|---|--|--|
| Structural BMP Su  | mmary Information                                 |  |  |
| Structural BMP ID No. 1  |   |  |  |
| Construction Plan Sheet No. C300,C310 & C311   |   |  |  |
| Type of structural BMP:  |   |  |  |
| Retention by harvest and use (HU-1)  |   |  |  |
| Retention by infiltration basin (INF-1)  |   |  |  |
| Retention by bioretention (INF-2)  |   |  |  |
| Retention by permeable pavement (INF-3)  |   |  |  |
| Partial retention by biofiltration with partial retentio   | n (PR-1)  |  |  |
| ☑ Biofiltration (BF-1)   |   |  |  |
| Flow-thru treatment control with prior lawful appr<br>(BMP type/description in discussion section below  | oval to meet earlier PDP requirements (provide    |  |  |
| Flow-thru treatment control included as pre-treatm  BMP (provide BMP type/description and indicate discussion section below)                   |   |  |  |
| Flow-thru treatment control with alternative compl   | iance (provide BMP type/description in discussion |  |  |
| Detention pond or vault for hydromodification ma   | nnagement   |  |  |
| Other (describe in discussion section below)   |   |  |  |
| Purpose:   |   |  |  |
| Pollutant control only   |   |  |  |
| Hydromodification control only   |   |  |  |
| Combined pollutant control and hydromodification   | n control   |  |  |
| Pre-treatment/forebay for another structural BMP   |   |  |  |
| Other (describe in discussion section below)   |   |  |  |
| Who will certify construction of this BMP? Provide name and contact information for the party responsible to sign BMP verification form DS-563 | Frank LaRocca, PE<br>213-379-9700                 |  |  |
| Who will be the final owner of this BMP?   | Property Owner                                    |  |  |
| Who will maintain this BMP into perpetuity?  | Property Owner                                    |  |  |
| What is the funding mechanism for maintenance?   | Property Mainetenance Expenses                    |  |  |

PDP SWQMP Template Date: January, 2016 PDP SWQMP Submittal Date: September 24, 2024



| Form I-6 Page 4 of X (Copy as many as needed)                |  |  |  |
|--|--|--|--|
| Structural BMP ID No. Click or tap here to enter text.       |  |  |  |
| Construction Plan Sheet No. Click or tap here to enter text. |  |  |  |
| Discussion (as needed):                                      |  |  |  |
| Click or tap here to enter text.                             |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |
|  |  |  |  |







City of San Diego

Development Services

## Permenant BMP

**FORM** 

| 1222 First Ave., MD-302<br>San Diego, CA 92101<br>(619) 446-5000   | Construction Self Certification Form   | DS-563<br>January 2016   |
|--|--|--|
|  |  |  |
| Date Prepared: September 24, 2024  | Project No.: Click here to enter to  | ext.   |
| Project Applicant:   | Phone:   |  |
| Project Address: 2072 Via Casa Alta  | 1  |  |
| Project Engineer: Frank LaRocca  | Phone: 213-239-9700  |  |
| The purpose of this form is to verify that the site is been constructed in conformance with the ap (SWQMP) documents and drawings.   |  |  |
| This form must be completed by the engineer construction permit. Completion and submittal or redevelopment projects in order to comply with Permit Order No. R9-2013-0001 as amended by for occupancy and/or release of grading or public not submitted and approved by the City of San D  | f this form is required for all new do<br>the City's Storm Water ordinance<br>R9-2015-0001 and R9-2015-0100. It<br>improvement bonds may be delayed                              | evelopment and<br>es and NDPES<br>Final inspection                               |
| CERTIFICATION: As the professional in responsible charge for the inspected all constructed Low Impact Developme BMP's required per the approved SWQMP and and that said BMP's have been constructed in conspecifications, permits, ordinances and Order No R9-2015-0100 of the San Diego Regional Water Constructed in the Impact of the Impact Development of the I | ent (LID) site design, source control<br>Construction Permit No. Click her<br>mpliance with the approved plans and<br>D. R9-2013-0001 as amended by R9<br>Quality Control Board. | ol and structural<br>re to enter text.;<br>and all applicable<br>2-2015-0001 and |
| Signature:   | _  |  |
| Date of Signature: _ Insert Date   |  |  |
| Printed Name: _Frank LaRocca   |  |  |
| <b>Title:</b> _PE  |  |  |
| <b>Phone No.</b> 213-239-9700  | Engineer's Star  | <u>np</u>  |

PDP SWQMP Template Date: January, 2016

PDP SWQMP Submittal Date: September 24, 2024



DS-563 (12-15)



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING



## ATTACHMENT 1 BACKUP FOR PDP POLLUTANT CONTROL BMPS

This is the cover sheet for Attachment 1.



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING




#### Indicate which Items are Included:

| Attachment    | Contents   | Checklist  |
|---------------|--|--|
| Sequence      |  |  |
| Attachment 1a | DMA Exhibit (Required)  See DMA Exhibit Checklist.   | ✓ Included   |
| Attachment 1b | Tabular Summary of DMAs Showing DMA ID matching DMA Exhibit, DMA Area, and DMA Type (Required)*  *Provide table in this Attachment OR on DMA Exhibit in Attachment 1a  | ☐ Included on DMA Exhibit in Attachment 1a☐ Included as Attachment 1b, separate from DMA Exhibit             |
| Attachment 1c | Form I-7, Harvest and Use Feasibility Screening Checklist (Required unless the entire project will use infiltration BMPs)  Refer to Appendix B.3-1 of the BMP Design Manual to complete Form I-7.                  | <ul><li>☑ Included</li><li>☑ Not included because the entire project will use infiltration BMPs</li></ul>    |
| Attachment 1d | Form I-8, Categorization of Infiltration Feasibility Condition (Required unless the project will use harvest and use BMPs)  Refer to Appendices C and D of the BMP Design Manual to complete Form I-8.             | <ul><li>☑ Included</li><li>☑ Not included because the entire project will use harvest and use BMPs</li></ul> |
| Attachment 1e | Pollutant Control BMP Design Worksheets / Calculations (Required)  Refer to Appendices B and E of the BMP Design Manual for structural pollutant control BMP design guidelines and site design credit calculations | ✓ Included   |





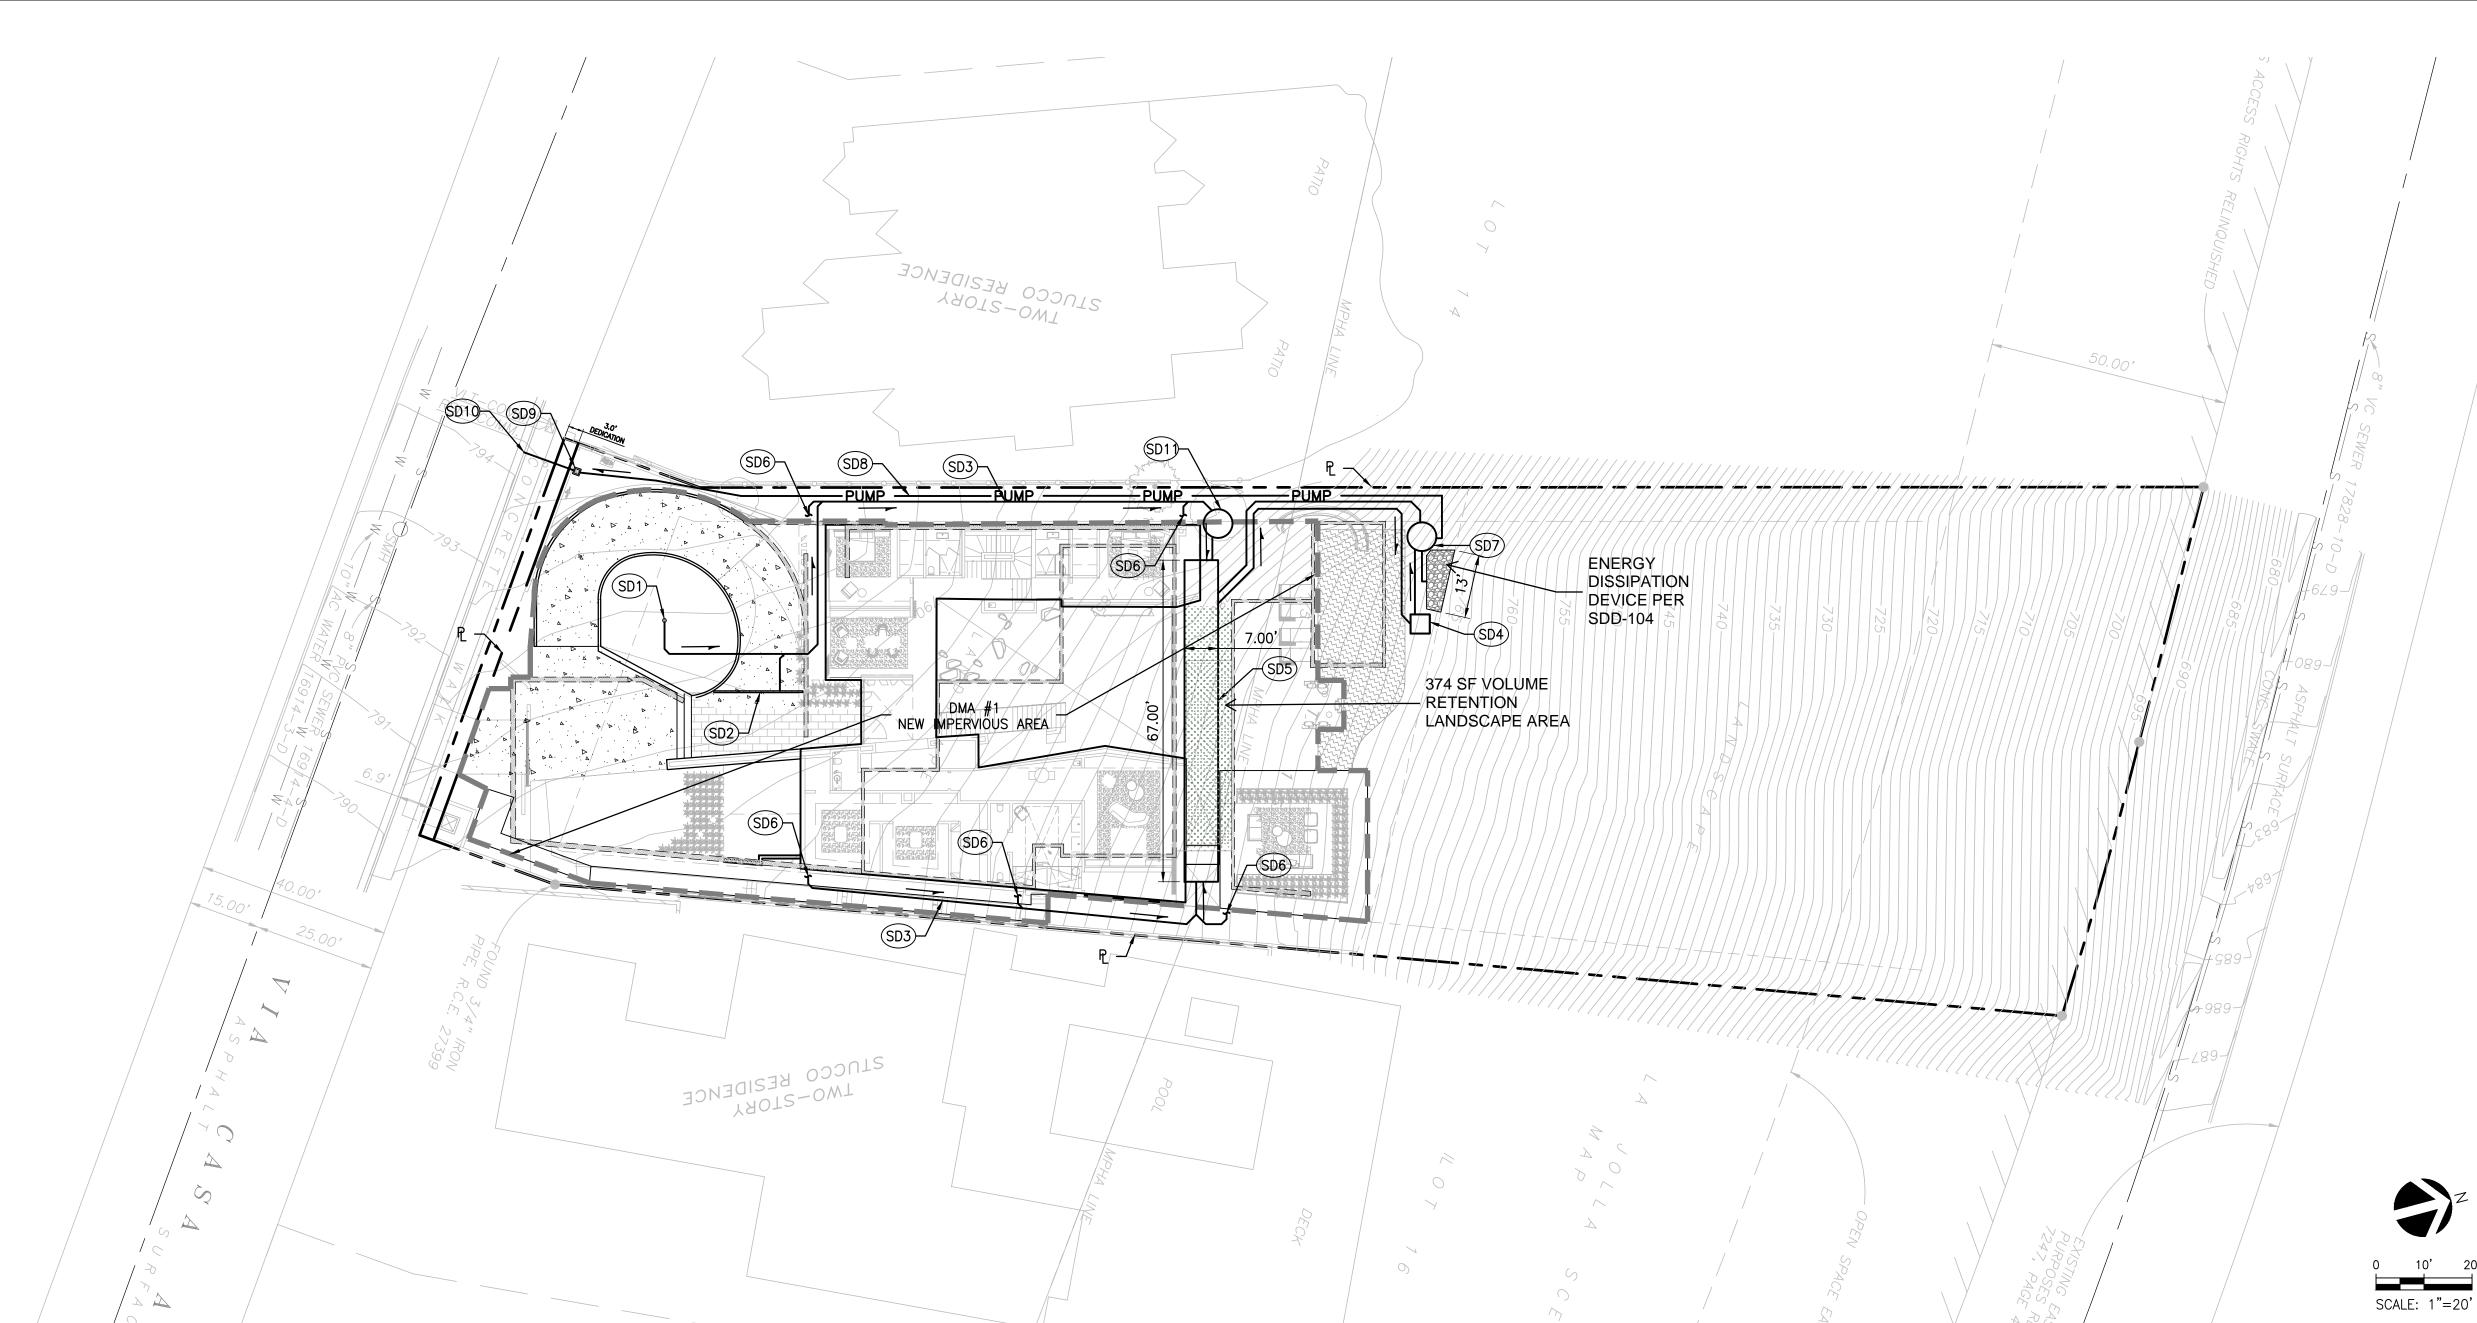

## NOT FOR CONSTRUCTION

319 Main Street El Segundo, California 90245

LFA Job no. 23003

JADE LJ,

t: 213/ 239 9700 f: 213/ 239 9699

ENTITLE MENT REVIEW

COSTAL DEVELOPMENT PERMIT APPROVAL NO. 2590140

SITE DEVELOPMENT PERMIT APPROVAL NO. 2590140

DRAINAGE PLAN

SHEET NUMBER:

## <u>LEGEND</u>

——— PROPERTY LINE CONCRETE PAVING PLANTER AREA BASEMENT BUILDING WALL RETAINING WALL

——SD— STORM DRAIN PIPE ⊕ AREA DRAIN

## **CONSTRUCTION NOTES**

## STORM DRAIN

- (SD1) INSTALL 6" AREA DRAIN BY NDS OR APPROVED EQUIVALENT.
- (SD2) INSTALL TRENCH DRAIN BY ACO OR APPROVED EQUIVALENT.

PROJECT SITE CHARACTERISTICS

TOTAL SITE AREA (S.F.)

IMPERVIOUS %

DCV (C.F.)

EXISTING IMPRERVIOUS AREA (S.F.)

85TH PERCENTILE RAINFALL DEPTH (IN)

HYDROMODIFICATION SIZING (C.F.)

RETENTION STORAGE SIZE (C.F.)

100-YR VOLUME (C.F.)

NEW IMPERVIOUS AREA (S.F.)

QUANTITIES

33,016

0

13,870

42%

0.52

543

1,665

2,542

2,542

(SD1) INSTALL CONTECH CDS PRETREATMENT SYSTEM PER DETAIL 2, SHEET C310.

- SD3) INSTALL 6" STORM DRAIN PIPE. S=1% MIN.
- SD4 INSTALL CONTECH BIOFILTRATION SYSTEM MWS-L-4-4-V PER DETAIL 1, SHEET C310.
- (SD5) INSTALL 2,542 CF CONTECH DETENTION SYSTEM PER DETAIL 1, SHEET C311.
- DOWNSPOUT POINT-OF-CONNECTION. SEE ARCHITECTURAL DRAWINGS FOR CONTINUATION.
- (SD7) INSTALL SUMP PUMP AND VAULT.
- SD8) INSTALL FORCE MAIN.
- (SD9) INSTALL 12"X12" CATCH BASIN BY JENSEN OR APPROVED EQUIVALENT.
- ©D10 INSTALL CURB-O-LET CURB DRAIN.

## Appendix B: Stormwater Pollutant Control Hydrologic Calculations and Sizing Methods

|                          | Tabular Summary of DMAs      |  |             |         |   |                              |            | Worksheet B-1          |                           |                    |
|--------------------------|------------------------------|--|-------------|---------|---|------------------------------|------------|------------------------|---------------------------|--------------------|
| DMA Unique<br>Identifier | Area<br>(acres)              | Impervious<br>Area<br>(acres)          | % Imp       | HSG     | Area<br>Weighted<br>Runoff<br>Coefficient | DCV<br>(cubic<br>feet)       |            | d By (BMP<br>ID)       | Pollutant Control<br>Type | Drains to (POC ID) |
| DMA #1                   | 0.76                         | 0.32                                   | 42%         | D       | .90                                       | 543                          | D۷         | V-1                    | BIOFILTRATION             | POC1               |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          |                              |  |             |         |   |                              |            |                        |                           |                    |
|                          | Cumm                         | ary of DMA l                           | Informati   | on (Muc | it matah nya                              | ost dossvint                 | ion and    | CM/OMD N               | (auvatirza)               |                    |
|                          | Sullill                      |  | IIIOIIIIati | on (mus | st match pro                              | ect descript                 | .1011 allu | 1 SWQMP IN             | arrative)                 |                    |
| No. of DMAs              | Total DMA<br>Area<br>(acres) | Total<br>Impervious<br>Area<br>(acres) | % Imp       |         | Area<br>Weighted<br>Runoff<br>Coefficient | Total DCV<br>(cubic<br>feet) |            | cal Area<br>ed (acres) |                           | No. of<br>POCs     |
| 1                        | 0.76                         | 0.32                                   | 42%         |         | .90                                       | 543                          | .32        | 2                      |                           | 1                  |

Where: DMA = Drainage Management Area; Imp = Imperviousness; HSG = Hydrologic Soil Group; DCV= Design Capture Volume; BMP = Best Management POC = Point of Compliance; ID = identifier; No. = Number

B-3 The City of San Diego | Stormwater Standards | May 2021 Edition Part 1: BMP Design Manual



Worksheet B-1: Tabular Summary of DMAs


| SITE SPECIFIC DATA                 |                 |                  |            |  |  |
|------------------------------------|-----------------|------------------|------------|--|--|
| PROJECT NUMBE                      | TR .            | 800997           |            |  |  |
| PROJECT NAME                       |                 | 2072 VIA         | CASA ALTA  |  |  |
| PROJECT LOCATI                     | ON              | LA JOL           | LA, CA     |  |  |
| STRUCTURE ID                       |                 | MWS-             | -4-6       |  |  |
|                                    | TREATMENT       | REQUIRED         |            |  |  |
| VOLUME BASED (CF) FLOW BASED (CFS) |                 |                  |            |  |  |
| 1,7                                | 09              | N,               | /A         |  |  |
| TREATMENT HGL                      | AVAILABLE (FT)  |                  | N/K        |  |  |
| PEAK BYPASS R                      | EQUIRED (CFS) — | IF APPLICABLE    | N/A        |  |  |
| PIPE DATA                          | I.E.            | MATERIAL         | DIAMETER   |  |  |
| INLET PIPE 1                       | 767.5           | PVC              | 6"         |  |  |
| OUTLET PIPE                        | 766.0           | PVC              | 6"         |  |  |
|                                    | PRETREATMENT    | BIOFILTRATION    | DISCHARGE  |  |  |
| RIM ELEVATION                      | 776.0           | 776.0            | 776.0      |  |  |
| SURFACE LOAD                       | PEDESTRIAN      | N/A              | PEDESTRIAN |  |  |
| FRAME & COVER                      | 24" X 42"       | OPEN PLANTER N/A |            |  |  |
| WETLANDMEDIA V                     | 3.67            |                  |            |  |  |
| ORIFICE SIZE (D                    | IA. INCHES)     |                  | Ø0.61"     |  |  |
| NOTES: PRELIMINA                   | RY NOT FOR CON  | ISTRUCTION.      |            |  |  |


## **INSTALLATION NOTES**


- CONTRACTOR TO PROVIDE ALL LABOR, EQUIPMENT, MATERIALS AND INCIDENTALS REQUIRED TO OFFLOAD AND INSTALL THE SYSTEM AND APPURTENANCES IN ACCORDANCE WITH THIS DRAWING AND THE MANUFACTURER'S SPECIFICATIONS, UNLESS OTHERWISE STATED IN MANUFACTURER'S CONTRACT.
- UNIT MUST BE INSTALLED ON LEVEL BASE. MANUFACTURER RECOMMENDS A MINIMUM 6" LEVEL ROCK BASE UNLESS SPECIFIED BY THE PROJECT ENGINEER. CONTRACTOR IS RESPONSIBLE FOR VERIFYING PROJECT ENGINEER'S RECOMMENDED BASE SPECIFICATIONS.
- CONTRACTOR TO SUPPLY AND INSTALL ALL EXTERNAL CONNECTING PIPES. ALL PIPES MUST BE FLUSH WITH INSIDE SURFACE OF CONCRETE (PIPES CANNOT INTRUDE BEYOND FLUSH). INVERT OF OUTFLOW PIPE MUST BE FLUSH WITH DISCHARGE CHAMBER FLOOR. ALL PIPES SHALL BE SEALED WATERTIGHT PER MANUFACTURER'S STANDARD CONNECTION DETAIL.
- HATCH SHIPPED CAST INTO TOP SLAB. CONTRACTOR TO USE GROUT AND/OR BRICKS TO MATCH TOP SLAB WITH FINISHED SURFACE UNLESS SPÉCIFIED OTHERWISE.
- VEGETATION SUPPLIED AND INSTALLED BY OTHERS. ALL UNITS WITH VEGETATION MUST HAVE DRIP OR SPRAY IRRIGATION SUPPLIED AND INSTALLED BY OTHERS.
- CONTRACTOR RESPONSIBLE FOR CONTACTING CONTECH FOR ACTIVATION OF UNIT. MANUFACTURER'S WARRANTY IS VOID WITHOUT PROPER ACTIVATION BY A CONTECH REPRESENTATIVE.


### **GENERAL NOTES**

MANUFACTURER TO PROVIDE ALL MATERIALS UNLESS OTHERWISE NOTED. ALL DIMENSIONS, ELEVATIONS, SPECIFICATIONS AND CAPACITIES ARE SUBJECT TO CHANGE. FOR PROJECT SPECIFIC DRAWINGS DETAILING EXACT DIMENSIONS, WEIGHTS AND ACCESSORIES PLEASE CONTACT CONTECH.

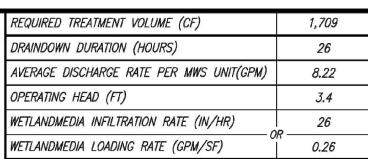

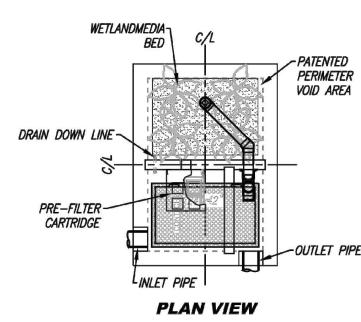

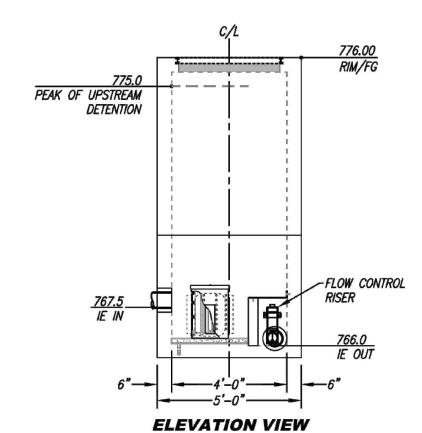

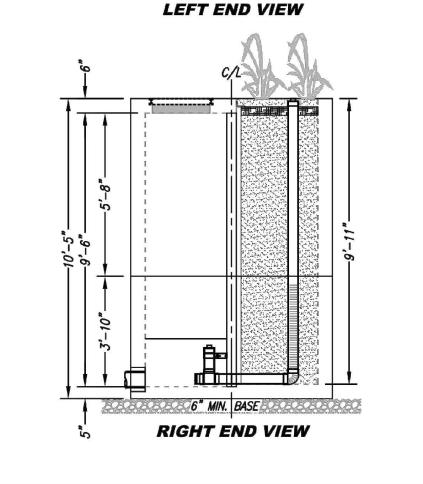

VEGETATION —

**ESTABLISHMENT** 


**ENGINEERED SOLUTIONS LLC** 

www.ContechES.com

ROPRIETARY AND CONFIDENTIAL: FOR PATENT INFORMATION, GO TO WAWW.ContechES.com/IP

*MWS-L-4-6-9'-11"-V* STORMWATER BIOFILTRATION SYSTEM STANDARD DETAIL

## 1 CONTECH MWS BIOFILTRATION SYSTEM DETAIL C300 CONTECH

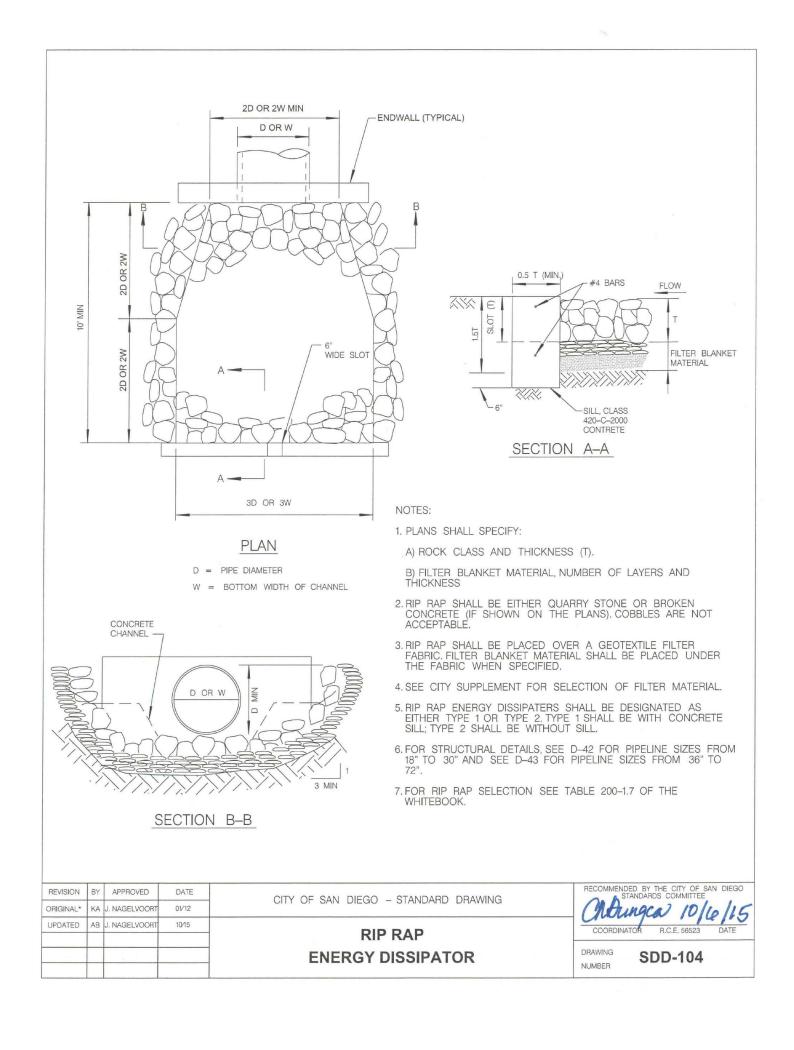




319 Main Street El Segundo, California 90245 t: 213/ 239 9700 f: 213/ 239 9699

LFA Job no. 23003

JADE

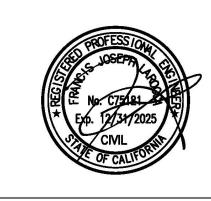

**NOT FOR** CONSTRUCTION

ENTITLE MENT REVIEW

SITE DEVELOPMENT PERMIT APPROVAL NO. 2590140

COSTAL DEVELOPMENT PERMIT APPROVAL NO. 2590140

LOW IMPACT DEVELOPMENT

**DETAILS** 

| Harvest and Use Feasi   | Worksheet B.3-  | -1 : Form I-7   |   |  |
|---|---|---|---|--|
| 1. Is there a demand for harve reliably present during the we Toilet and urinal flushing Landscape irrigation Other:  |   | at apply) at the proje  | ct site that is                                 |  |
| 2. If there is a demand; estimate the anticipated average wet season demand over a period of 36 hours. Guidance for planning level demand calculations for toilet/urinal flushing and landscape irrigation is provided in Section B.3.2.  [Provide a summary of calculations here]  ETWU = 38 |   |   |   |  |
| 3. Calculate the DCV using wo<br>DCV = <sup>543</sup> (cubic<br>[Provide a summary of calcula<br>From Worksheet B-1   | feet)   |   |   |  |
| 3a. Is the 36-hour demand greater than or equal to the DCV?  Yes / No   | 3b. Is the 36-hour der than 0.25DCV but less DCV?  Yes / No   | than the full   | 3c. Is the 36-hour demand less than 0.25DCV?    |  |
| Harvest and use appears to<br>be feasible. Conduct more<br>detailed evaluation and<br>sizing calculations to<br>confirm that DCV can be<br>used at an adequate rate to<br>meet drawdown criteria.   | Harvest and use may more detailed evaluations to determ Harvest and use may used for a portion of to (optionally) the storaguesized to meet long while draining in long | on and sizing hine feasibility. Only be able to be he site, or ge may need to be term capture targets | Harvest and use is considered to be infeasible. |  |
| Is harvest and use feasible by Yes, refer to Appendix E to so No. select alternate BMPs   |   |   |   |  |



## Appendix B: Stormwater Pollutant Control Hydrologic Calculations and Sizing Methods

#### **Worksheet B.5-2: Sizing Method for Volume Retention Criteria**

|      | Sizing Method for Volume Retention Criteria  | Worksheet B.5-2 |         |  |  |
|------|--|-----------------|---------|--|--|
| 1    | Area draining to the BMP   | 13,870          | sq. ft. |  |  |
| 2    | Adjusted runoff factor for drainage area (Refer to Appendix B.1 and B.2)   | 0.9             |         |  |  |
| 3    | 85 <sup>th</sup> percentile 24-hour rainfall depth   | 0.52            | inches  |  |  |
| 4    | Design capture volume [Line 1 x Line 2 x (Line 3/12)]  | 541             | cu. ft. |  |  |
| Volu | /olume Retention Requirement   |                 |         |  |  |
|      | Measured infiltration rate in the DMA  |                 |         |  |  |
|      | Note:  |                 |         |  |  |
| 5    | When mapped hydrologic soil groups are used enter 0.10 for NRCS Type D soils and for NRCS Type C soils enter 0.30  | 0.0             | in/hr.  |  |  |
|      | When in no infiltration condition and the actual measured infiltration rate is unknown enter 0.0 if there are geotechnical and/or groundwater hazards identified in Appendix C or enter 0.05 |                 |         |  |  |
| 6    | Factor of safety   | 2               |         |  |  |
| 7    | Reliable infiltration rate, for biofiltration BMP sizing [Line 5/ Line 6]  | .00             | in/hr.  |  |  |
|      | Average annual volume reduction target (Figure B.5-2)  |                 |         |  |  |
| 8    | When Line 7 > 0.01 in/hr. = Minimum (40, 166.9 x Line 7 +6.62)   | 3.5             | %       |  |  |
|      | When Line 7 ≤ 0.01 in/hr. = 3.5%   |                 |         |  |  |
|      | Fraction of DCV to be retained (Figure B.5-3)  |                 |         |  |  |
| 9    | When Line 8 > 8% = 0.0000013 x Line 8 <sup>3</sup> - 0.000057 x Line 8 <sup>2</sup> + 0.0086 x Line 8 - 0.014  | 0.023           |         |  |  |
|      | When Line $8 \le 8\% = 0.023$  |                 |         |  |  |
| 10   | Target volume retention [Line 9 x Line 4]  | 12.4            | cu. ft. |  |  |



## Appendix B: Stormwater Pollutant Control Hydrologic Calculations and Sizing Methods

Worksheet B.5-6: Volume Retention for No Infiltration Condition

|      | Volume Retention for No Infiltration Condition Work  |  |            |            |      |        | sheet B.5-6 |  |
|------|--|--|------------|------------|------|--------|-------------|--|
| 1    | 1 Area draining to the biofiltration BMP   |  |            |            |      |        | sq. ft.     |  |
| 2    | Adjusted runoff  | factor for drainage area (Refer t                      | o Appendi  | x B.1 and  | B.2) | 0.9    |             |  |
| 3    | 3 Effective impervious area draining to the BMP [Line 1 x Line 2]  |  |            |            |      |        | sq. ft.     |  |
| 4    |  |  |            |            |      |        | sq. ft.     |  |
| 5    | 5 Biofiltration BMP Footprint  |  |            |            |      |        | sq. ft.     |  |
|      | andscape Area (must be identified on DS-3247)  |  |            |            |      |        |             |  |
|      |  | Identification   | Α          | В          | С    | D      | E           |  |
| 6    | Landscape area that meet the requirements in SD-B and SD-F Fact Sheet (sq. ft.)  400   |  |            |            |      |        |             |  |
| 7    | 7 Impervious area draining to the landscape area (sq. ft.) 600   |  |            |            |      |        |             |  |
| 8    | [Line 7/Line 6]  |  |            |            |      |        |             |  |
| 9    | Effective Credit Area If Line 8 >1.5, use Line 6; if not use Line 7/1.5  384   |  |            |            |      |        |             |  |
| 10   |  | 384  | sq. ft.    |            |      |        |             |  |
| 11   | 1 2 , , , 3  |  |            |            |      |        | sq. ft.     |  |
| Volu | Volume Retention Performance Standard  |  |            |            |      |        |             |  |
| 12   | Is Line 11 ≥ Line 4?  If yes, then volume retention performance standard for no infiltration condition is met. If no, proceed to Line 13   |  |            |            |      | 💢 Yes  | □ No        |  |
| 13   |  | performance standard met throu<br>ing [Line 11/Line 4] | igh the BN | IP footpri | nt   | NA     |             |  |
| 14   |  | Retention [Line 10 from Worksh                         |            |            |      | NA     | cu. ft.     |  |
| 15   | [(1-Line 13) x Li  | n required from other site desig<br>ne 14]             | n BMPs     |            |      | NA     | cu. ft.     |  |
| Site | Design BMP   |  |            |            |      | 1      |             |  |
|      | Identification   | Site Desig   | gn Type    |            |      | Credit |             |  |
|      | A  |  |            |            |      |        | cu. ft.     |  |
|      | B<br>C   |  |            |            |      |        | cu. ft.     |  |
|      | D  |  |            |            |      |        | cu. ft.     |  |
| 16   | E  |  |            |            |      |        | cu. ft.     |  |
|      | Sum of volume retention benefits from other site design BMPs (e.g. trees; rain barrels etc.). [sum of Lines 16A-16E] Provide documentation of how the site design credit is calculated in the PDP SWQMP. |  |            |            |      |        | cu. ft.     |  |
| 17   | Is Line 16 ≥ Line 15?  |  |            |            |      | □ Yes  | □ No        |  |



## Appendix B: Stormwater Pollutant Control Hydrologic Calculations and Sizing Methods

Worksheet B.6-1: Flow-Thru Design Flows

|   | Flow-thru Design Flows                                     | Worksheet B.6-1                       |       |            |  |
|---|--|---------------------------------------|-------|------------|--|
| 1 | DCV  | DCV                                   | 543   | cubic-feet |  |
| 2 | DCV retained   | $\mathrm{DCV}_{\mathrm{retained}}$    |       | cubic-feet |  |
| 3 | DCV biofiltered  | $\mathrm{DCV}_{\mathrm{biofiltered}}$ |       | cubic-feet |  |
| 4 | DCV requiring flow-thru<br>(Line 1 – Line 2 – 0.67*Line 3) | DCV <sub>flow-thru</sub>              | 543   | cubic-feet |  |
| 5 | Adjustment factor (Line 4 / Line 1)                        | AF=                                   | 1     | unitless   |  |
| 6 | Design rainfall intensity                                  | i=                                    | 0.20  | in/hr.     |  |
| 7 | Area tributary to BMP (s)                                  | A=                                    | 0.32  | acres      |  |
| 8 | Area-weighted runoff factor (estimate using Appendix B.2)  | C=                                    | 0.90  | unitless   |  |
| 9 | Calculate Flow Rate = AF x (C x i x A)                     | Q=                                    | 0.058 | cfs        |  |

- 1. Adjustment factor shall be estimated considering only retention and biofiltration BMPs located upstream of flow-thru BMPs. That is, if the flow-thru BMP is upstream of the project's retention and biofiltration BMPs then the flow-thru BMP shall be sized using an adjustment factor of 1.
- 2. Volume based (e.g., dry extended detention basin) flow-thru treatment control BMPs shall be sized to the volume in Line 4 and flow based (e.g., vegetated swales) shall be sized to flow rate in Line 9. Sand filter and media filter can be designed either by volume in Line 4 or flow rate in Line 9.
- 3. Proprietary BMPs, if used, shall provide certified treatment capacity equal to or greater than the calculated flow rate in Line 9; certified treatment capacity per unit shall be consistent with third party certifications.



# ATTACHMENT 2 BACKUP FOR PDP HYDROMODIFICATION CONTROL MEASURES

This is the cover sheet for Attachment 2.


✓ Mark this box if this attachment is empty because the project is exempt from PDP hydromodification management requirements.



Project Name: 2072 Via Casa Alta THIS PAGE INTENTIONALLY LEFT BLANK FOR DOUBLE-SIDED PRINTING

#### Indicate which Items are Included:

| Attachment    | Contents   | Checklist   |
|---------------|--|---|
| Sequence      |  | ☐ Included  |
| Attachment 2a | Hydromodification Management<br>Exhibit (Required)   | See Hydromodification Management Exhibit Checklist.   |
| Attachment 2b | Management of Critical Coarse<br>Sediment Yield Areas (WMAA<br>Exhibit is required, additional<br>analyses are optional)<br>See Section 6.2 of the BMP Design<br>Manual.                 | <ul> <li>□ Exhibit showing project drainage boundaries marked on WMAA Critical Coarse Sediment Yield Area Map (Required)</li> <li>○ Optional analyses for Critical Coarse Sediment Yield Area Determination</li> <li>□ 6.2.1 Verification of Geomorphic Landscape Units Onsite</li> <li>□ 6.2.2 Downstream Systems Sensitivity to Coarse Sediment</li> <li>□ 6.2.3 Optional Additional Analysis of Potential Critical Coarse Sediment Yield Areas Onsite</li> </ul> |
| Attachment 2c | Geomorphic Assessment of<br>Receiving Channels (Optional)  See Section 6.3.4 of the BMP Design<br>Manual.  | <ul> <li>Not Performed</li> <li>☐ Included</li> <li>☐ Submitted as separate stand-alone document</li> </ul>   |
| Attachment 2d | Flow Control Facility Design and Structural BMP Drawdown Calculations (Required)  Overflow Design Summary for each structural BMP  See Chapter 6 and Appendix G of the BMP Design Manual | <ul><li>☑ Included</li><li>☑ Submitted as separate stand-alone document</li></ul>   |
| Attachment 2e | Vector Control Plan (Required when<br>structural BMPs will not drain in 96<br>hours)   | ☐ Included ☐ Not required because BMPs will drain in less than 96 hours   |





#### BMP Sizing Spreadsheet V3.1

| Project Name:            | VIA CASA ALTA           |
|--------------------------|-------------------------|
| Project Applicant:       | LABIB FUNK & ASSOCIATES |
| Jurisdiction:            | CITY OF SAN DIEGO       |
| Parcel (APN):            | 3527501500              |
| Hydrologic Unit:         | 906.3                   |
| Rain Gauge:              | Oceanside               |
| Total Project Area (sf): | 33,016                  |
| Channel Susceptibility:  | High                    |

|                       | BMP Sizing Spreadsheet V3.1             |                                |           |  |  |  |  |
|-----------------------|---|--------------------------------|-----------|--|--|--|--|
| Project Name:         | e: VIA CASA ALTA Hydrologic Unit: 906.3 |                                |           |  |  |  |  |
| Project Applicant:    | LABIB FUNK & ASSOCIATES                 | Rain Gauge:                    | Oceanside |  |  |  |  |
| Jurisdiction:         | CITY OF SAN DIEGO                       | Total Project Area:            | 33,016    |  |  |  |  |
| Parcel (APN):         | 3527501500                              | Low Flow Threshold:            | 0.1Q2     |  |  |  |  |
| BMP Name:             | Vault                                   | BMP Type:                      | Cistern   |  |  |  |  |
| BMP Native Soil Type: | D                                       | BMP Infiltration Rate (in/hr): | NA        |  |  |  |  |

|                   | Areas Draining to BMP |                          |                   |                              |  |                    | Minimum BMP Size |
|-------------------|-----------------------|--------------------------|-------------------|------------------------------|--|--------------------|------------------|
| DMA<br>Name       | Area (sf)             | Pre Project Soil<br>Type | Pre-Project Slope | Post Project<br>Surface Type | Area Weighted Runoff<br>Factor<br>(Table G.2-1) <sup>1</sup> | Volume             | Volume (CF)      |
| imp paving        | 13,870                | D                        | Steep             | Concrete                     | 1.0  | 0.12               | 1664             |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
|                   |                       |                          |                   |                              |  | 0                  | 0                |
| MP Tributary Area | 13,870                |                          | ·                 | ·                            |  | Minimum BMP Size   | 1664             |
|                   |                       | _                        |                   |                              |  | Proposed BMP Size* | 1664             |

\* Assumes standard configuration

|   | FTOPOSEU BIVIF SIZE | 1004 |
|---|---------------------|------|
|   |                     |      |
|   |                     |      |
|   |                     |      |
|   |                     |      |
| Standard Cistern Depth (Overflow Elevation) | 3.5                 | ft   |
| Provided Cistern Depth (Overflow Elevation) | 3.5                 | ft   |
| Minimum Required Cistern Footprint)         | 476                 | CF   |

#### Notes:

1. Runoff factors which are used for hydromodification management flow control (Table G.2-1) are different from the runoff factors used for pollutant control BMP sizing (Table B.1-1). Table references are taken from the San Diego Region Model BMP Design Manu

Describe the BMP's in sufficient detail in your PDP SWQMP to demonstrate the area, volume, and other criteria can be met within the constraints of the site.

BMP's must be adapted and applied to the conditions specific to the development project such as unstable slopes or the lack of available head. Designated Staff have final review and approval authority over the project design.

This BMP Sizing Spreadsheet has been updated in conformance with the San Diego Region Model BMP Design Manual, May 2018. For questions or concerns please contact the jurisdiction in which your project is located.

| Cistern                      | BMP Type:           | Vault                   | BMP Name           |  |  |
|------------------------------|---------------------|-------------------------|--------------------|--|--|
| 0.102                        | Low Flow Threshold: | 327501500               | Parcel (APN):      |  |  |
| 33,016                       | Total Project Area: | CITY OF SAN DIEGO       | Jurisdiction:      |  |  |
| əbisnsəoO                    | Rain Gauge:         | LABIB FUNK & ASSOCIATES | Project Applicant: |  |  |
| £'906                        | Hydrologic Unit:    | ATJA ASAD AIV           | Project Name:      |  |  |
| 1.EV Jəərləbsənq2 gnisi2 AMB |                     |                         |                    |  |  |

| 72.0               | 810.0                          | 815.0         | 972.0             | Steep                   | О         | Oceanside  | Bniveq qr |
|--------------------|--------------------------------|---------------|-------------------|-------------------------|-----------|------------|-----------|
| ( <sup>z</sup> ni) | (cfs)                          |               | (cfs/ac)          | Slope                   | Soil Type |            | Aame      |
| Orifice Area       | Orifice Flow - %Q <sub>2</sub> | (วธ) ธ9าA AMO | Unit Runoff Ratio | Pre-developed Condition |           | AgueD nieA | AMQ       |

| (ni)        | ( <sup>z</sup> ni) | (cfs)              | (feet)             |
|-------------|--------------------|--------------------|--------------------|
| Diameter    | Orifice Area       | Wolf eoifice       | Max Orifice Head   |
| Max Orifice | Max Tot. Allowable | Max Tot. Allowable | bealt ositiso yeld |
| 65.0        | 72.0               | 810.0              | 3.50               |

| (ni)                         | ( <sup>z</sup> ni)  | (cfs)                   | (cfs)                                      |
|------------------------------|---------------------|-------------------------|--|
| Selected<br>Orifice Diameter | Actual Orifice Area | wolłtuO eoifice Outflow | Average outflow during<br>nwobwsab aserans |
| 0.580                        | 92.0                | 810.0                   | Provide Hand Calc.                         |

| Calculation  | Drawdown (Hrs)  |
|--------------|-----------------|
| Provide Hand | (23H) amobinesa |

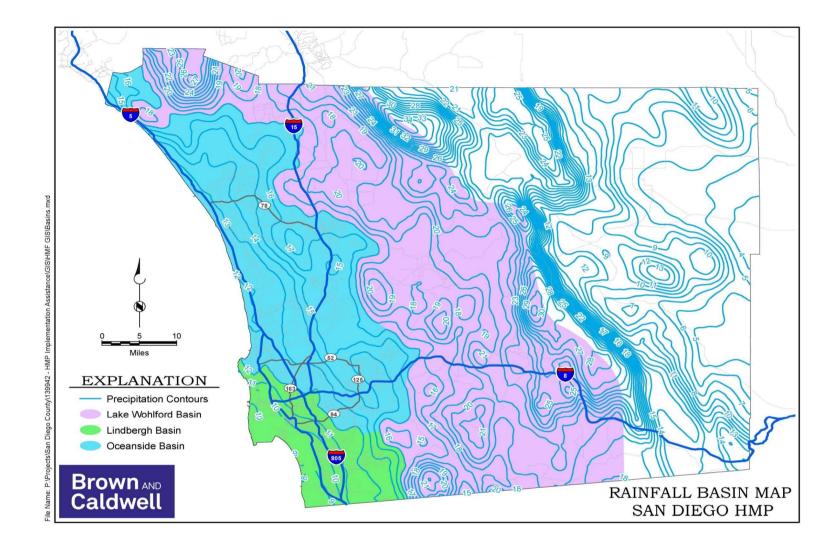


Table G.2-3: Sizing Factors for Hydromodification Flow Control Infiltration BMPs Designed Using Sizing Factor Method

| Lower Flow Threshold | Soil Group | Slope    | Rain Gauge    | A     |
|----------------------|------------|----------|---------------|-------|
| 0.1Q2                | A          | Flat     | Lindbergh     | 0.055 |
| 0.1Q2                | A          | Moderate | Lindbergh     | 0.055 |
| 0.1Q2                | Α          | Steep    | Lindbergh     | 0.055 |
| 0.1Q2                | В          | Flat     | Lindbergh     | 0.045 |
| 0.1Q2                | В          | Moderate | Lindbergh     | 0.045 |
| 0.1Q2                | В          | Steep    | Lindbergh     | 0.045 |
| 0.1Q2                | С          | Flat     | Lindbergh     | 0.035 |
| 0.1Q2                | С          | Moderate | Lindbergh     | 0.035 |
| 0.1Q2                | С          | Steep    | Lindbergh     | 0.035 |
| 0.1Q2                | D          | Flat     | Lindbergh     | 0.03  |
| 0.1Q2                | D          | Moderate | Lindbergh     | 0.03  |
| 0.1Q2                | D          | Steep    | Lindbergh     | 0.03  |
| 0.1Q2                | A          | Flat     | Oceanside     | 0.06  |
| 0.1Q2                | A          | Moderate | Oceanside     | 0.06  |
| 0.1Q2                | A          | Steep    | Oceanside     | 0.06  |
| 0.1Q2                | В          | Flat     | Oceanside     | 0.05  |
| 0.1Q2                | В          | Moderate | Oceanside     | 0.05  |
| 0.1Q2                | В          | Steep    | Oceanside     | 0.05  |
| 0.1Q2                | С          | Flat     | Oceanside     | 0.05  |
| 0.1Q2                | С          | Moderate | Oceanside     | 0.05  |
| 0.1Q2                | С          | Steep    | Oceanside     | 0.045 |
| 0.1Q2                | D          | Flat     | Oceanside     | 0.035 |
| 0.1Q2                | D          | Moderate | Oceanside     | 0.035 |
| 0.1Q2                | D          | Steep    | Oceanside     | 0.035 |
| 0.1Q2                | A          | Flat     | Lake Wohlford | 0.085 |
| 0.1Q2                | A          | Moderate | Lake Wohlford | 0.085 |
| 0.1Q2                | Α          | Steep    | Lake Wohlford | 0.085 |
| 0.1Q2                | В          | Flat     | Lake Wohlford | 0.07  |
|                      |            |          |               |       |

| 0.1Q2 | В | Moderate | Lake Wohlford | 0.07  |
|-------|---|----------|---------------|-------|
| 0.1Q2 | В | Steep    | Lake Wohlford | 0.07  |
| 0.1Q2 | С | Flat     | Lake Wohlford | 0.055 |
| 0.1Q2 | С | Moderate | Lake Wohlford | 0.055 |
| 0.1Q2 | С | Steep    | Lake Wohlford | 0.055 |
| 0.1Q2 | D | Flat     | Lake Wohlford | 0.04  |
| 0.1Q2 | D | Moderate | Lake Wohlford | 0.04  |
| 0.1Q2 | D | Steep    | Lake Wohlford | 0.04  |

| Table G.2-4: Sizing Factors for Hydromodification Flow Control Biofiltration with Partial Retention Designed Using Sizing Factor Method |                            |          |                        |            |       |  |  |  |
|---|----------------------------|----------|------------------------|------------|-------|--|--|--|
| Lower Flow Threshold  | Soil Group                 | Slope    | below low orifice invo | Rain Gauge | A     |  |  |  |
| <b>0.1Q</b> <sub>2</sub>  | Α                          | Flat     | 18                     | Lindbergh  | 0.08  |  |  |  |
| <b>0.1Q</b> <sub>2</sub>  | A                          | Moderate | 18                     | Lindbergh  | 0.08  |  |  |  |
| <b>0.1Q</b> <sup>2</sup>  | Α                          | Steep    | 18                     | Lindbergh  | 0.08  |  |  |  |
| <b>0.1Q</b> <sup>2</sup>  | В                          | Flat     | 18                     | Lindbergh  | 0.065 |  |  |  |
| <b>0.1Q</b> <sup>2</sup>  | В                          | Moderate | 18                     | Lindbergh  | 0.065 |  |  |  |
| <b>0.1Q</b> 2   | <b>0.1Q</b> 2 B S          |          |                        | Lindbergh  | 0.06  |  |  |  |
| <b>0.1Q</b> 2   | <b>0.1Q</b> <sup>2</sup> C |          | 6                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | С                          | Moderate | 6                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | С                          | Steep    | 6                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | D                          | Flat     | 3                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | D                          | Moderate | 3                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | D                          | Steep    | 3                      | Lindbergh  | 0.05  |  |  |  |
| <b>0.1Q</b> 2   | A                          | Flat     | 18                     | Oceanside  | 0.08  |  |  |  |
| <b>0.1Q</b> 2   | A                          | Moderate | 18                     | Oceanside  | 0.075 |  |  |  |
| <b>0.1Q</b> 2   | A                          | Steep    | 18                     | Oceanside  | 0.075 |  |  |  |
| <b>0.1Q</b> 2   | В                          | Flat     | 18                     | Oceanside  | 0.07  |  |  |  |
| <b>0.1Q</b> 2   | В                          | Moderate | 18                     | Oceanside  | 0.07  |  |  |  |
| <b>0.1Q</b> 2   | В                          | Steep    | 18                     | Oceanside  | 0.07  |  |  |  |
| <b>0.1Q</b> 2   | С                          | Flat     | 6                      | Oceanside  | 0.07  |  |  |  |
| <b>0.1Q</b> 2   | С                          | Moderate | 6                      | Oceanside  | 0.07  |  |  |  |


| <b>0.1Q</b> 2 | С | Steep    | 6  | Oceanside     | 0.07  |
|---------------|---|----------|----|---------------|-------|
| <b>0.1Q</b> 2 | D | Flat     | 3  | Oceanside     | 0.07  |
| <b>0.1Q</b> 2 | D | Moderate | 3  | Oceanside     | 0.07  |
| <b>0.1Q</b> 2 | D | Steep    | 3  | Oceanside     | 0.07  |
| <b>0.1Q</b> 2 | Α | Flat     | 18 | Lake Wohlford | 0.11  |
| <b>0.1Q</b> 2 | Α | Moderate | 18 | Lake Wohlford | 0.11  |
| <b>0.1Q</b> 2 | Α | Steep    | 18 | Lake Wohlford | 0.105 |
| <b>0.1Q</b> 2 | В | Flat     | 18 | Lake Wohlford | 0.09  |
| <b>0.1Q</b> 2 | В | Moderate | 18 | Lake Wohlford | 0.085 |
| <b>0.1Q</b> 2 | В | Steep    | 18 | Lake Wohlford | 0.085 |
| <b>0.1Q</b> 2 | С | Flat     | 6  | Lake Wohlford | 0.065 |
| <b>0.1Q</b> 2 | С | Moderate | 6  | Lake Wohlford | 0.065 |
| <b>0.1Q</b> 2 | С | Steep    | 6  | Lake Wohlford | 0.065 |
| <b>0.1Q</b> 2 | D | Flat     | 3  | Lake Wohlford | 0.06  |
| <b>0.1Q</b> 2 | D | Moderate | 3  | Lake Wohlford | 0.06  |
| <b>0.1Q</b> 2 | D | Steep    | 3  | Lake Wohlford | 0.06  |

| Table G.2-5: Sizing Factors for Hydromodification Flow Control Biofiltration BMPs Designed Using Sizing  Factor Method |   |          |           |       |  |  |  |  |  |  |
|--|---|----------|-----------|-------|--|--|--|--|--|--|
| Lower Flow Threshold Soil Group Slope Rain Gauge A   |   |          |           |       |  |  |  |  |  |  |
| 0.1Q2  | A | Flat     | Lindbergh | 0.32  |  |  |  |  |  |  |
| 0.1Q2  | A | Moderate | Lindbergh | 0.3   |  |  |  |  |  |  |
| 0.1Q2  | A | Steep    | Lindbergh | 0.285 |  |  |  |  |  |  |
| 0.1Q2  | В | Flat     | Lindbergh | 0.105 |  |  |  |  |  |  |
| 0.1Q2  | В | Moderate | Lindbergh | 0.1   |  |  |  |  |  |  |
| 0.1Q2  | В | Steep    | Lindbergh | 0.095 |  |  |  |  |  |  |
| 0.1Q2  | С | Flat     | Lindbergh | 0.055 |  |  |  |  |  |  |
| 0.1Q2  | С | Moderate | Lindbergh | 0.05  |  |  |  |  |  |  |
| 0.1Q2  | С | Steep    | Lindbergh | 0.05  |  |  |  |  |  |  |
| 0.1Q2  | D | Flat     | Lindbergh | 0.05  |  |  |  |  |  |  |
| 0.1Q2  | D | Moderate | Lindbergh | 0.05  |  |  |  |  |  |  |
| 0.1Q2  | D | Steep    | Lindbergh | 0.05  |  |  |  |  |  |  |
| 0.1Q2  | A | Flat     | Oceanside | 0.15  |  |  |  |  |  |  |
| 0.1Q2  | A | Moderate | Oceanside | 0.14  |  |  |  |  |  |  |
| 0.1Q2  | A | Steep    | Oceanside | 0.135 |  |  |  |  |  |  |

| 0.1Q2 | В | Flat     | Oceanside     | 0.085 |
|-------|---|----------|---------------|-------|
| 0.1Q2 | В | Moderate | Oceanside     | 0.085 |
| 0.1Q2 | В | Steep    | Oceanside     | 0.085 |
| 0.1Q2 | С | Flat     | Oceanside     | 0.075 |
| 0.1Q2 | С | Moderate | Oceanside     | 0.075 |
| 0.1Q2 | С | Steep    | Oceanside     | 0.075 |
| 0.1Q2 | D | Flat     | Oceanside     | 0.07  |
| 0.1Q2 | D | Moderate | Oceanside     | 0.07  |
| 0.1Q2 | D | Steep    | Oceanside     | 0.07  |
| 0.1Q2 | A | Flat     | Lake Wohlford | 0.285 |
| 0.1Q2 | A | Moderate | Lake Wohlford | 0.275 |
| 0.1Q2 | A | Steep    | Lake Wohlford | 0.27  |
| 0.1Q2 | В | Flat     | Lake Wohlford | 0.15  |
| 0.1Q2 | В | Moderate | Lake Wohlford | 0.145 |
| 0.1Q2 | В | Steep    | Lake Wohlford | 0.145 |
| 0.1Q2 | С | Flat     | Lake Wohlford | 0.07  |
| 0.1Q2 | С | Moderate | Lake Wohlford | 0.07  |
| 0.1Q2 | С | Steep    | Lake Wohlford | 0.07  |
| 0.1Q2 | D | Flat     | Lake Wohlford | 0.06  |
| 0.1Q2 | D | Moderate | Lake Wohlford | 0.06  |
| 0.1Q2 | D | Steep    | Lake Wohlford | 0.06  |
|       |   |          |               |       |

| Table G.2-6: Sizing Factors for Hydromodification Flow Control Cistern Facilities Designed Using Sizing Factor  Method |                |          |           |      |  |  |  |  |  |  |
|--|----------------|----------|-----------|------|--|--|--|--|--|--|
| Lower Flow Threshold Soil Group Slope Rain Gauge V   |                |          |           |      |  |  |  |  |  |  |
| 0.1Q2  | A              | Flat     | Lindbergh | 0.54 |  |  |  |  |  |  |
| 0.1Q2  | A              | Moderate | Lindbergh | 0.51 |  |  |  |  |  |  |
| 0.1Q2  | Q2 A           |          | Lindbergh | 0.49 |  |  |  |  |  |  |
| 0.1Q2  | В              | Flat     | Lindbergh | 0.19 |  |  |  |  |  |  |
| 0.1Q2  | В              | Moderate | Lindbergh | 0.18 |  |  |  |  |  |  |
| 0.1Q2  | В              | Steep    | Lindbergh | 0.18 |  |  |  |  |  |  |
| 0.1Q2  | С              | Flat     | Lindbergh | 0.11 |  |  |  |  |  |  |
| 0.1Q2  | С              | Moderate | Lindbergh | 0.11 |  |  |  |  |  |  |
| 0.1Q2  | <b>0.1Q2</b> C |          | Lindbergh | 0.11 |  |  |  |  |  |  |
| 0.1Q2  | D              | Flat     | Lindbergh | 0.09 |  |  |  |  |  |  |

| 0.1Q2 | D | Moderate | Lindbergh     | 0.09 |
|-------|---|----------|---------------|------|
| 0.1Q2 | D | Steep    | Lindbergh     | 0.09 |
| 0.1Q2 | A | Flat     | Oceanside     | 0.26 |
| 0.1Q2 | A | Moderate | Oceanside     | 0.25 |
| 0.1Q2 | A | Steep    | Oceanside     | 0.25 |
| 0.1Q2 | В | Flat     | Oceanside     | 0.16 |
| 0.1Q2 | В | Moderate | Oceanside     | 0.16 |
| 0.1Q2 | В | Steep    | Oceanside     | 0.16 |
| 0.1Q2 | С | Flat     | Oceanside     | 0.14 |
| 0.1Q2 | С | Moderate | Oceanside     | 0.14 |
| 0.1Q2 | С | Steep    | Oceanside     | 0.14 |
| 0.1Q2 | D | Flat     | Oceanside     | 0.12 |
| 0.1Q2 | D | Moderate | Oceanside     | 0.12 |
| 0.1Q2 | D | Steep    | Oceanside     | 0.12 |
| 0.1Q2 | A | Flat     | Lake Wohlford | 0.53 |
| 0.1Q2 | A | Moderate | Lake Wohlford | 0.49 |
| 0.1Q2 | A | Steep    | Lake Wohlford | 0.49 |
| 0.1Q2 | В | Flat     | Lake Wohlford | 0.28 |
| 0.1Q2 | В | Moderate | Lake Wohlford | 0.28 |
| 0.1Q2 | В | Steep    | Lake Wohlford | 0.28 |
| 0.1Q2 | С | Flat     | Lake Wohlford | 0.14 |
| 0.1Q2 | С | Moderate | Lake Wohlford | 0.14 |
| 0.1Q2 | С | Steep    | Lake Wohlford | 0.14 |
| 0.1Q2 | D | Flat     | Lake Wohlford | 0.12 |
| 0.1Q2 | D | Moderate | Lake Wohlford | 0.12 |
| 0.1Q2 | D | Steep    | Lake Wohlford | 0.12 |

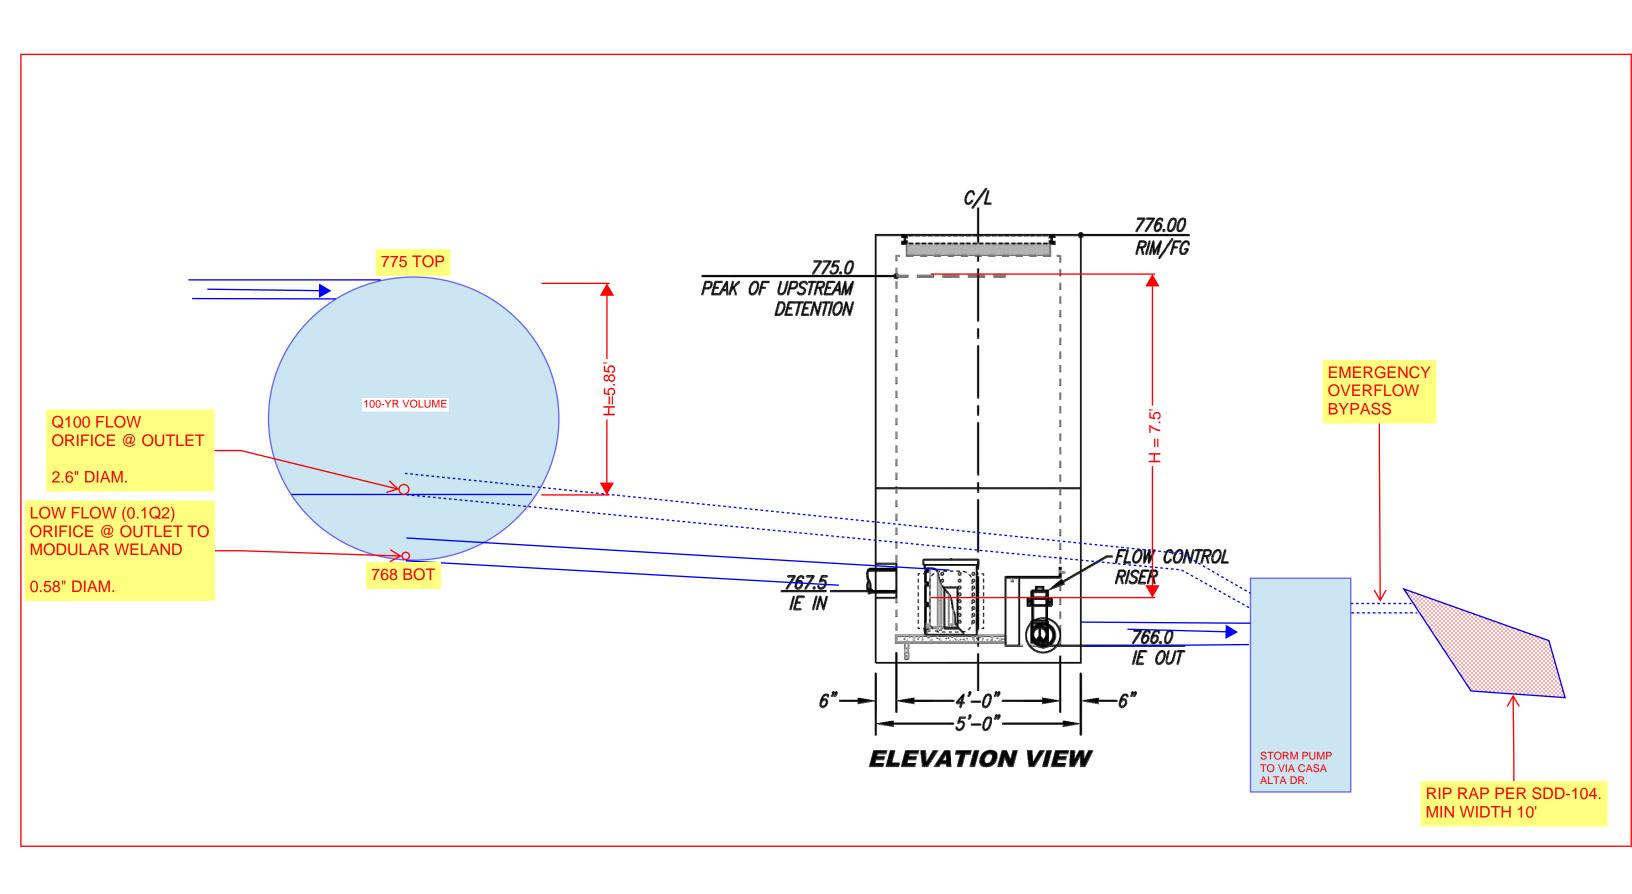

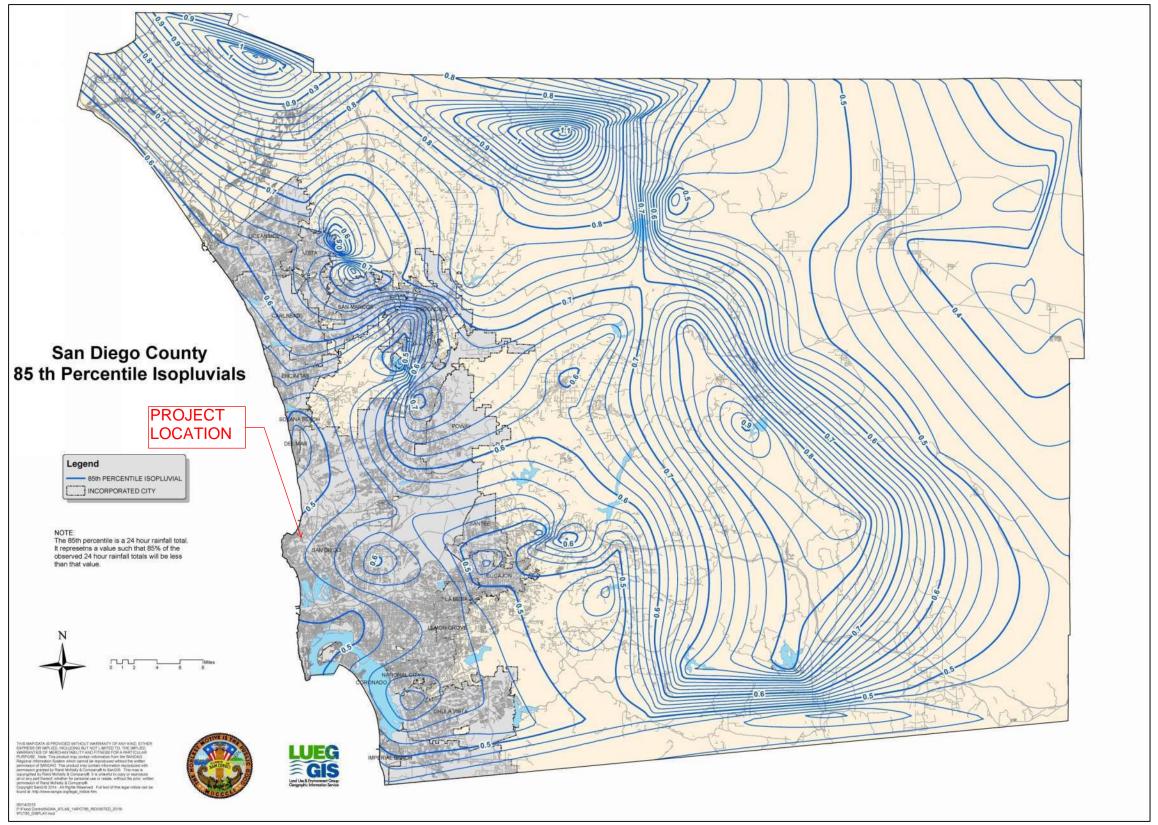


Figure B.1-1: 85th Percentile 24-hour Isopluvial Map



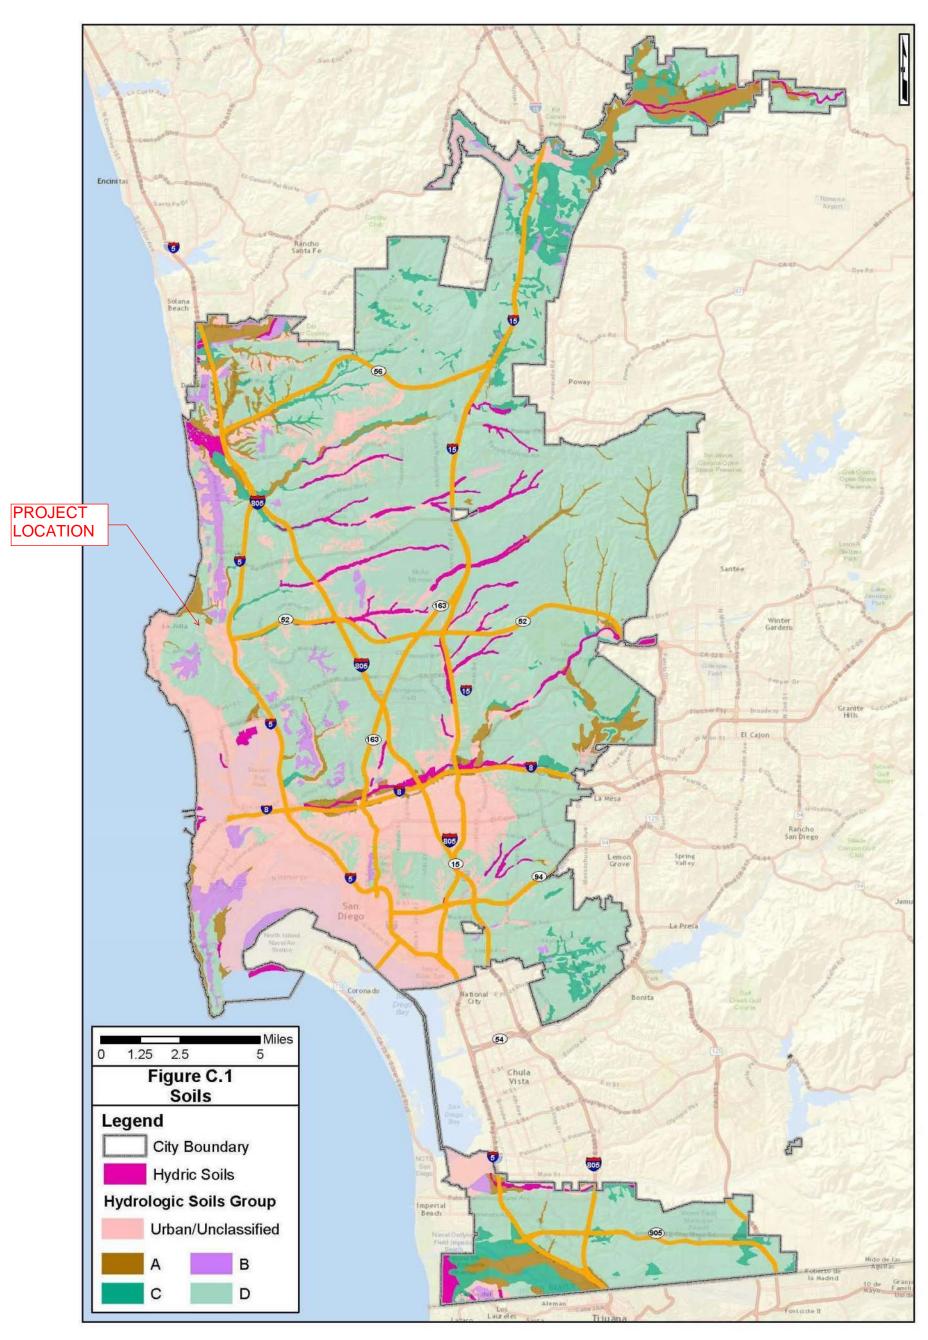


Figure C.4-1: Soils Exhibit



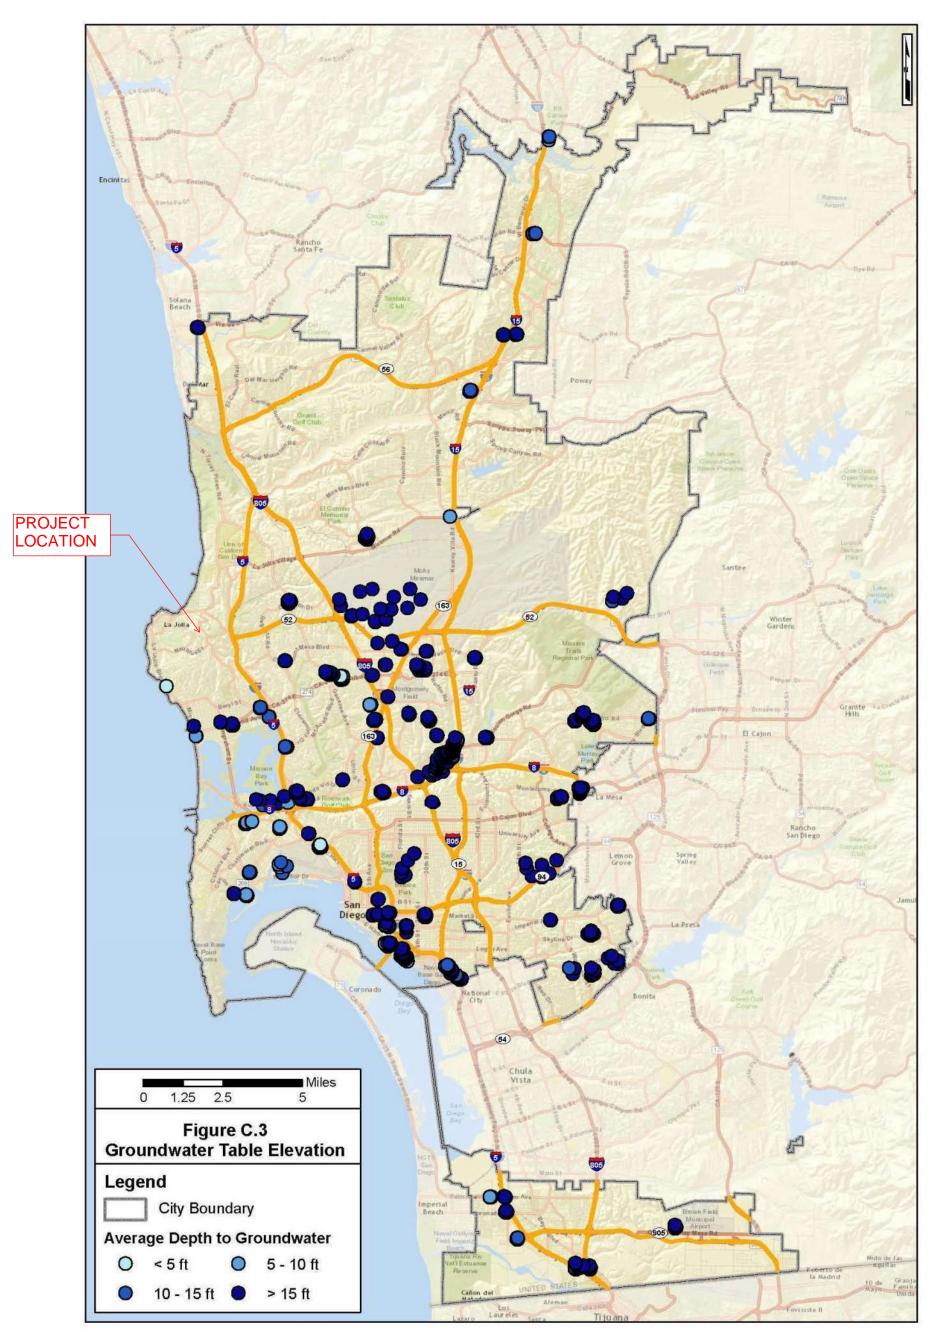


Figure C.4-3: Groundwater Table Elevation Exhibit



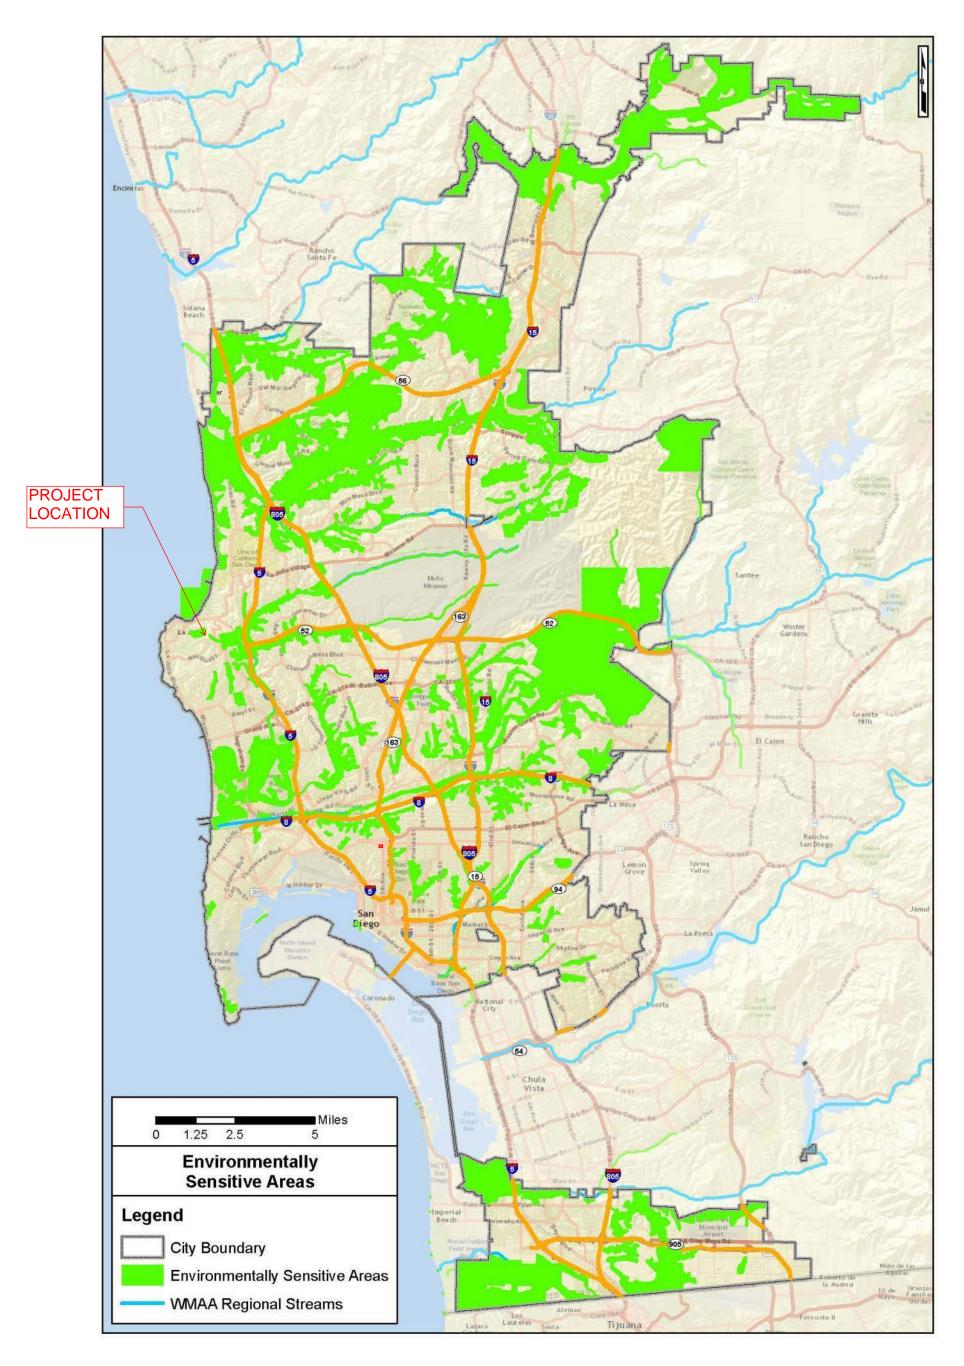


Figure K-1: Environmentally Sensitive Areas



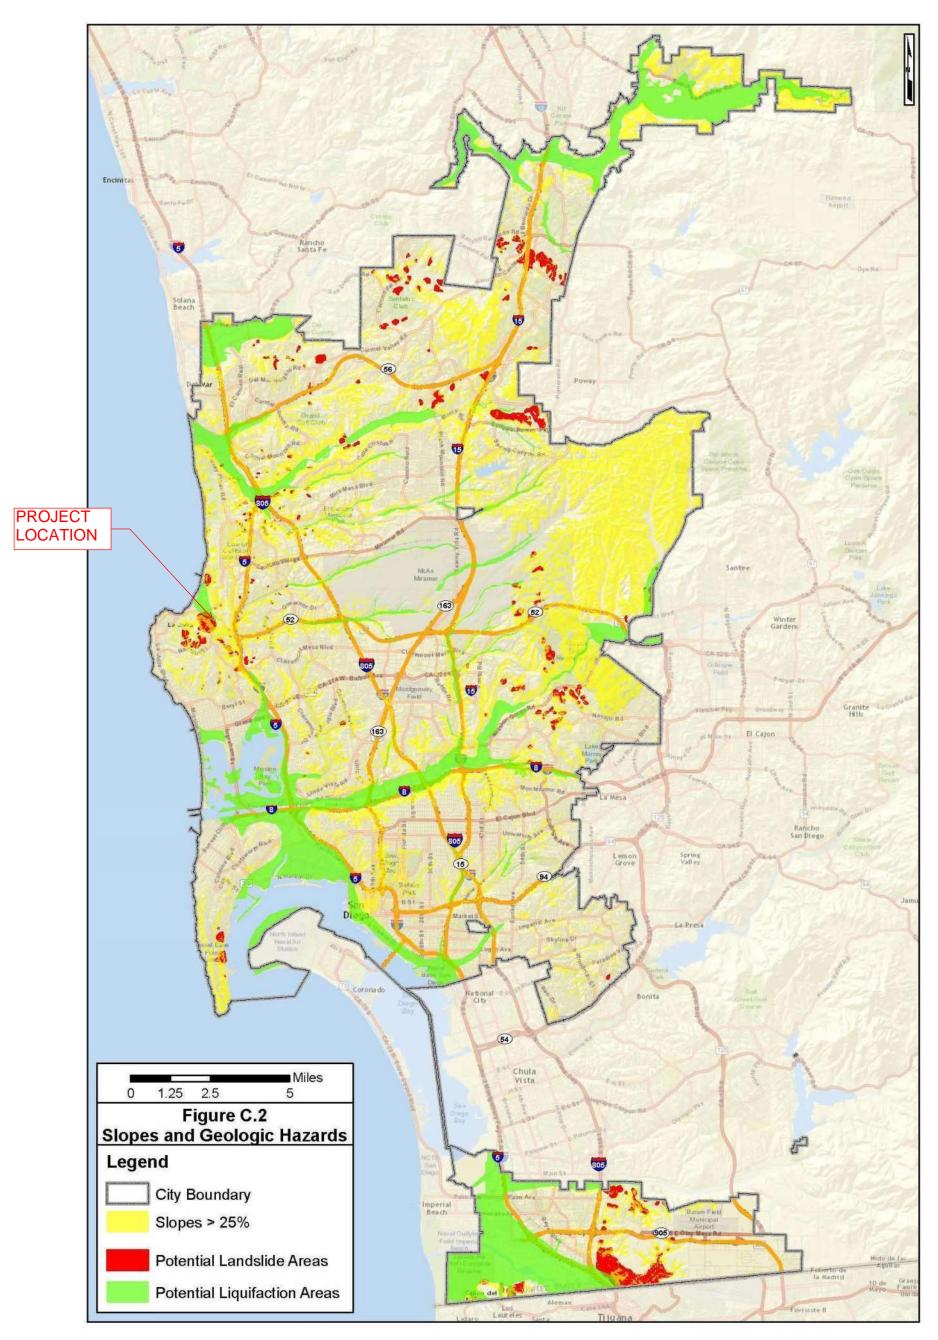


Figure C.4-2: Slopes and Geologic Hazards Exhibit




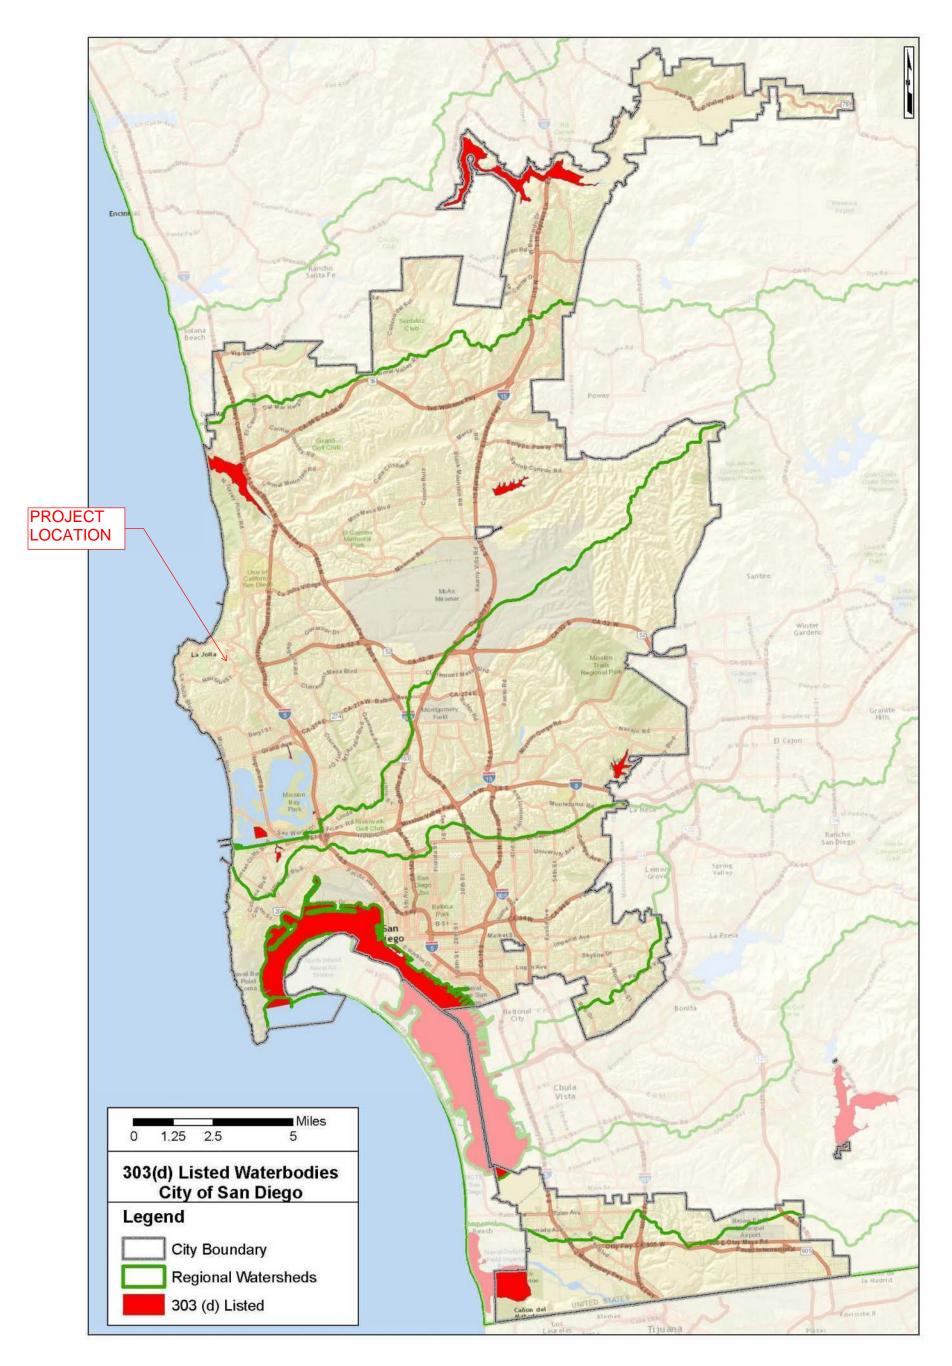



Figure K-2: 303(d) Listed Waterbodies



#### 1DWLRODO (DRRG-EDUGIDHU )51WWH



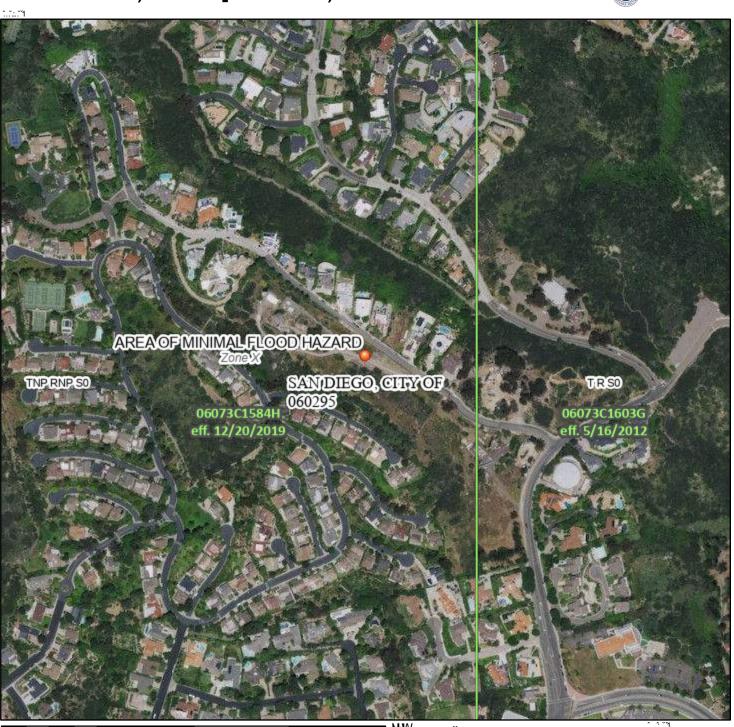


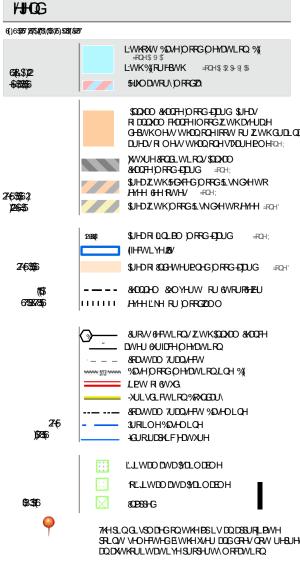

74LVESFREDLH/ZWK)(IV WDQDDJG/IFU WKHXHR G.LWDD IORRGEBYLI LW LV QRW YR GD/GHAFULEFGEFORZ 7KHED/HES WRQDREDLH/ZWK)(IV ED/HES DFXUFZ WDQDDJJG/

7KHIOREGKODUGLORUBWLRQLVG-ULYHGOLUHWO\IURRWKH DWKRULWDW.YHJKZE-WUYLFH/SURYLG-GEJB 7K.VBS 2V.HBUWHGRQ DW 30 DOGGRH/QRW UHOHFW HOOH/RU DROCPOWV/XEMIXHOW WRWKLVGDWHDOG WLFI 7KHJYGOCHIHWLYHLORUBWLRQB ROOHRU EFFRIVSHUW-G-GEQ-ZGDWDR/HU WLFI

7KLV BSL BJHLV YRLGLI WKHROHRU RUHRI WKHIROORZOJBS HOHPOW GROW DSHOU, EDABSL BJHJ IORGJROHODHOV OHJAG VFDOHEDU BSRJIHDWLROGDWH FRROLWILGHOWLILHUV )\$500-D QRHU DGG)\$HIFWLYHGDWH DSL BJHJIRU XDBSHGDGXCRG-JUQJ-JGDUHDV FDXDRW BHXJHGIRU UHJYODWRJ/SUSKIHJ

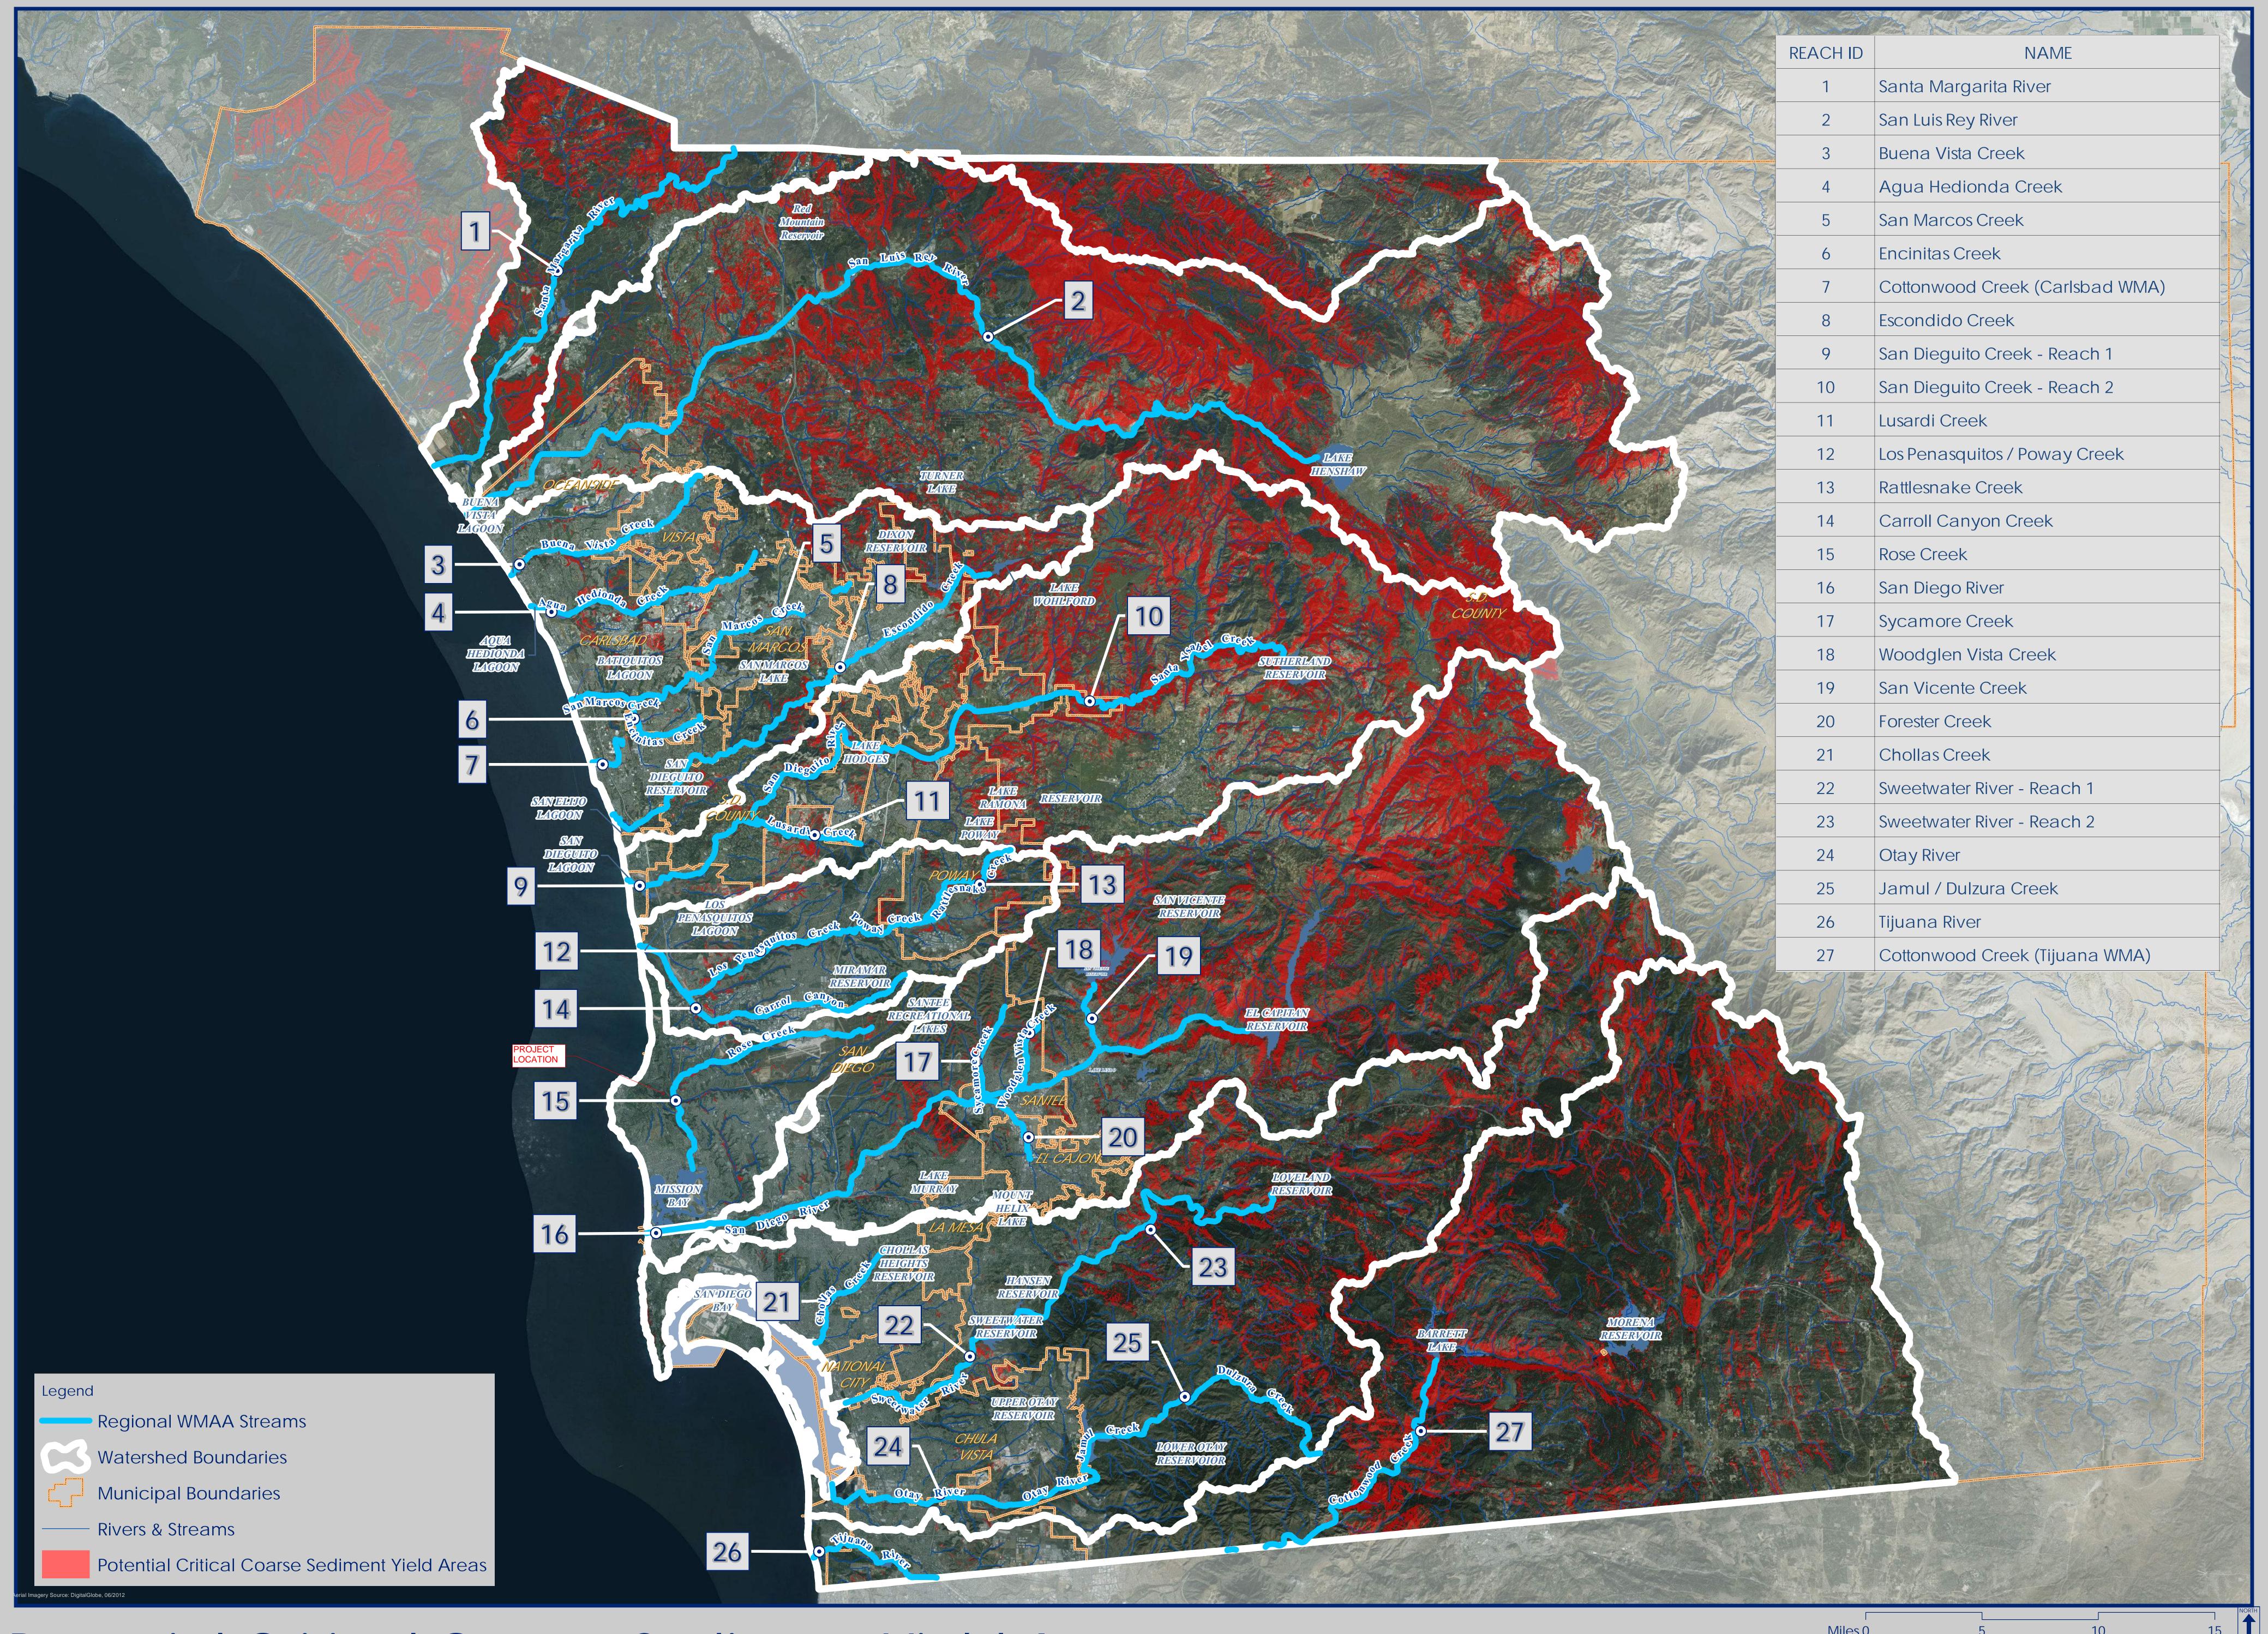

Potential Critical Coarse Sediment Yield Areas Regional San Diego County Watersheds







# ATTACHMENT 3 STRUCTURAL BMP MAINTENANCE INFORMATION

This is the cover sheet for Attachment 3.

MAINTENANCE AGREEMENT WILL BE PROVIDED UPON CONCEPTUAL APPROVAL OF BMPs.





#### Indicate which Items are Included:

| Attachment<br>Sequence | Contents  | Checklist   |
|------------------------|---|---|
| Attachment 3a          | Structural BMP Maintenance<br>Thresholds and Actions (Required) | ☐ Included  See Structural BMP Maintenance Information Checklist. |
| Attachment 3b          | Maintenance Agreement (Form DS-3247) (when applicable)          | <ul><li>☑ Included</li><li>☑ Not Applicable</li></ul>             |



Use this checklist to ensure the required information has been included in the Structural BMP

Maintenance Information Attachment:

#### <u>Preliminary Design / Planning / CEQA level submittal:</u>

- Attachment 3a must identify:
  - × Typical maintenance indicators and actions for proposed structural BMP(s) based on Section 7.7 of the BMP Design Manual
- Attachment 3b is not required for preliminary design / planning / CEQA level submittal.

#### Final Design level submittal:

Attachment 3a must identify:

| 0              | pecific maintenance indicators and actions for proposed structural BMP(s). This shall be based on Section 7.7 of the BMP Design Manual and enhanced to reflect actual proposed components of the structural BMP(s)                       |
|----------------|--|
| □Н             | low to access the structural BMP(s) to inspect and perform maintenance   |
| □ Fo           | eatures that are provided to facilitate inspection (e.g., observation ports, cleanouts, silt posts, or other features that allow the inspector to view necessary components of the structural BMP and compare to maintenance thresholds) |
| $\square$ M    | Ianufacturer and part number for proprietary parts of structural BMP(s) when applicable  |
| re             | Maintenance thresholds specific to the structural BMP(s), with a location-specific frame of eference (e.g., level of accumulated materials that triggers removal of the materials, to be   |
|                | dentified based on viewing marks on silt posts or measured with a survey rod with respect to   |
|                | fixed benchmark within the BMP)  |
|                | When applicable, frequency of bioretention soil media replacement  |
| □ R            | Recommended equipment to perform maintenance   |
| $\square$ W    | When applicable, necessary special training or certification requirements for inspection and   |
|                | naintenance personnel such as confined space entry or hazardous waste management   |
| Management and | For private entity operation and maintenance, Attachment 3b must include a Storm Water d Discharge Control Maintenance Agreement (Form DS-3247). The following information in the exhibits attached to the maintenance agreement:        |
| □ V:           | icinity map  |
|                | ite design BMPs for which DCV reduction is claimed for meeting the pollutant control obligations.  |
| □ B            | MP and HMP location and dimensions   |
| □ B            | MP and HMP specifications/cross section/model  |
| $\square$ M    | faintenance recommendations and frequency  |
|                | ID features such as (permeable paver and LS location, dim, SF).  |
|                |  |





# THE CITY OF SAN DIEGO RECORDING REQUESTED BY: THE CITY OF SAN DIEGO AND WHEN RECORDED MAIL

Click or tap here to enter text.

Click or tap here to enter text.

Click or tap here to enter text.

(THIS SPACE IS FOR THE RECORDER'S USE ONLY)

### STORM WATER MANAGEMENT AND DISCHARGE CONTROL MAINTENANCE AGREEMENT

APPROVAL NUMBER:

Click or tap here to enter text.

ASSESSOR'S PARCEL NUMBER:

Click or tap here to enter text.

PROJECT NUMBER:

Click or tap here to enter text.

This agreement is made by and between the City of San Diego, a municipal corporation [City] and Click or tap here to enter text.

the owner or duly authorized representative of the owner [Property Owner] of property located at:

Click or tap here to enter text.

(Property Address)

and more particularly described as: Click or tap here to enter text.

(LEGAL DESCRIPTION OF PROPERTY)

in the City of San Diego, County of San Diego, State of California.

Property Owner is required pursuant to the City of San Diego Municipal Code, Chapter 4, Article 3, Division 3, Chapter 14, Article 2, Division 2, and the Land Development Manual, Storm Water Standards to enter into a Storm Water Management and Discharge Control Maintenance Agreement [Maintenance Agreement] for the installation and maintenance of Permanent Storm Water Best Management Practices [Permanent Storm Water BMP's] prior to the issuance of construction permits. The Maintenance Agreement is intended to ensure the establishment and maintenance of Permanent Storm Water BMP's onsite, as described in the attached exhibit(s), the project's Storm Water Quality Management Plan [SWQMP] and Grading and/or Improvement Plan Drawing No(s), or Building Plan Project No(s): Click or tap here to enter text.

Property Owner wishes to obtain a building or engineering permit according to the Grading and/or Improvement Plan Drawing No(s) or Building Plan Project No(s): Click or tap here to enter text.



| Project Name: | 2072 Via Casa Alta |  |                     |
|---------------|--------------------|--|---------------------|
|               |                    |  |                     |
|               |                    |  |                     |
|               |                    |  |                     |
|               |                    |  | Continued on Page 2 |

#### Page 2 of 2 | City of San Diego • Development Services Department • Storm Water Requirements Applicability Checklist

NOW, THEREFORE, the parties agree as follows:

- 1. Property Owner shall have prepared, or if qualified, shall prepare an Operation and Maintenance Procedure [OMP] for Permanent Storm Water BMP's, satisfactory to the City, according to the attached exhibit(s), consistent with the Grading and/or Improvement Plan Drawing No(s), or Building Plan Project No(s):Click or tap here to enter text..
- 2. Property Owner shall install, maintain and repair or replace all Permanent Storm Water BMP's within their property, according to the OMP guidelines as described in the attached exhibit(s), the project's WQTR and Grading and/or Improvement Plan Drawing No(s), or Building Plan Project No(s)Click or tap here to enter text..
- 3. Property Owner shall maintain operation and maintenance records for at least five (5) years. These records shall be made available to the City for inspection upon request at any time.

This Maintenance Agreement shall commence upon execution of this document by all parties named hereon, and shall run with the land.

Executed by the City of San Diego and by Property Owner in San Diego, California.

|                                  | THE CITY OF SAN DIEGO            |
|----------------------------------|----------------------------------|
| (Owner Signature)                | THE CITT OF SAIV DIEGO           |
| Click or tap here to enter text. | APPROVED:                        |
| (Print Name and Title)           |                                  |
| Click or tap here to enter text. | (City Control engineer Signature |
| (Company/Organization Name)      |                                  |
| Click or tap to enter a date.    | (Print Name)                     |
| (Date)                           |                                  |
|                                  | (Date)                           |

See Attached Exhibits(s): Click or tap here to enter text.

NOTE: ALL SIGNATURES MUST INCLUDE NOTARY ACKNOWLEDMENTS PER CIVIL CODE SEC. 1180 ET.SEQ




# ATTACHMENT 4 COPY OF PLAN SHEETS SHOWING PERMANENT STORM WATER BMPS

This is the cover sheet for Attachment 4.





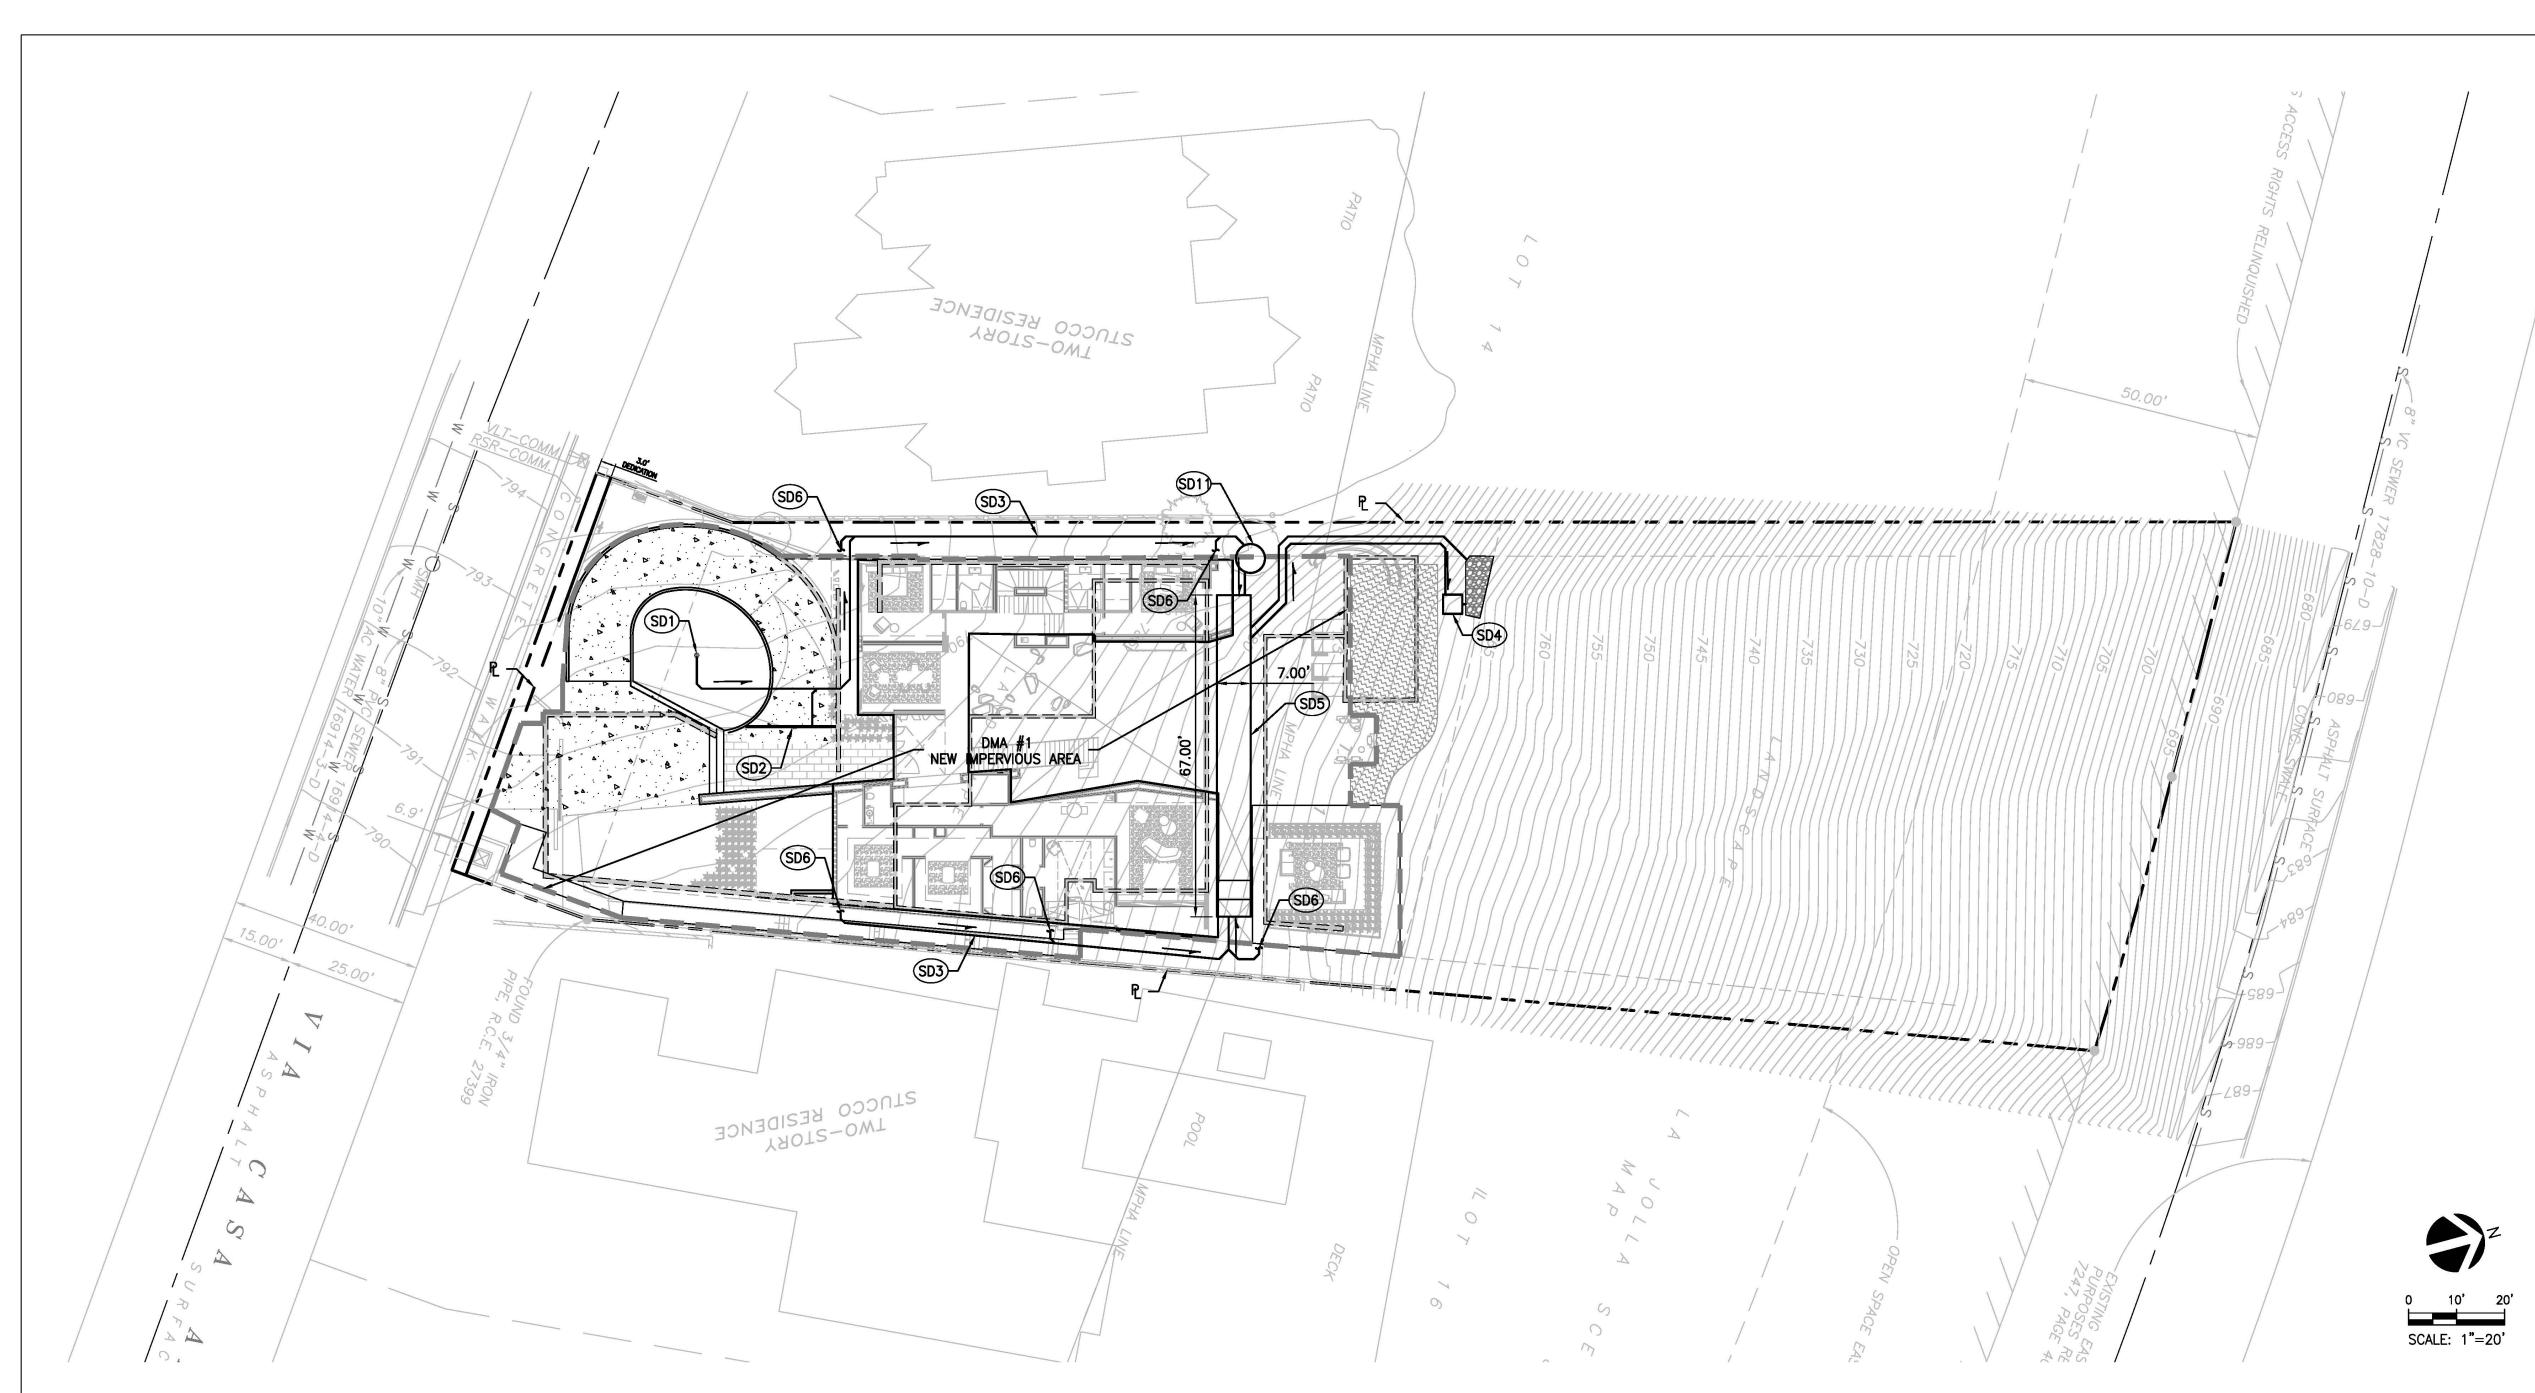



— PROPERTY LINE CONCRETE PAVING PLANTER AREA BASEMENT BUILDING WALL

RETAINING WALL ——SD— STORM DRAIN PIPE

### **CONSTRUCTION NOTES**

### STORM DRAIN

- (SD1) INSTALL 6" AREA DRAIN BY NDS OR APPROVED EQUIVALENT.
- SD2 INSTALL TRENCH DRAIN BY ACO OR APPROVED EQUIVALENT.

PROJECT SITE CHARACTERISTICS

TOTAL SITE AREA (S.F.)

IMPERVIOUS %

DCV (C.F.)

EXISTING IMPRERVIOUS AREA (S.F.)

85TH PERCENTILE RAINFALL DEPTH (IN)

HYDROMODIFICATION SIZING (C.F.)

RETENTION STORAGE SIZE (C.F.)

100-YR VOLUME (C.F.)

NEW IMPERVIOUS AREA (S.F.)

**QUANTITIES** 

33,016

0

13,870

42%

0.52

543

1,665

2,542

2,542

(SD1) INSTALL CONTECH CDS PRETREATMENT SYSTEM PER DETAIL 2, SHEET C310.

- SD3) INSTALL 6" STORM DRAIN PIPE. S=1% MIN.
- SD4) INSTALL CONTECH BIOFILTRATION SYSTEM MWS-L-4-4-V PER DETAIL 1, SHEET C310.
- SD5 INSTALL 2,542 CF CONTECH DETENTION SYSTEM PER DETAIL 1, SHEET C311.
- DOWNSPOUT POINT-OF-CONNECTION. SEE ARCHITECTURAL DRAWINGS FOR CONTINUATION.
- (SD7) INSTALL SUMP PUMP AND VAULT.
- SD8) INSTALL FORCE MAIN.
- SD9 INSTALL 12"X12" CATCH BASIN BY JENSEN OR APPROVED EQUIVALENT.
- ©D10 INSTALL CURB-0-LET CURB DRAIN.

#### Appendix B: Stormwater Pollutant Control Hydrologic Calculations and Sizing Methods

#### Worksheet B-1: Tabular Summary of DMAs

|                          |                              |  |           | Worksheet B-1 |   |                              |          |                       |                           |                       |
|--------------------------|------------------------------|--|-----------|---------------|---|------------------------------|----------|-----------------------|---------------------------|-----------------------|
| DMA Unique<br>Identifier | Area<br>(acres)              | Impervious<br>Area<br>(acres)          | % Imp     | HSG           | Area<br>Weighted<br>Runoff<br>Coefficient | DCV<br>(cubic<br>feet)       |          | d By (BMP<br>ID)      | Pollutant Control<br>Type | Drains to<br>(POC ID) |
| DMA #1                   | 0.76                         | 0.32                                   | 42%       | D             | .90                                       | 543                          | D۷       | V-1                   | BIOFILTRATION             | POC1                  |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
|                          |                              |  |           |               |   |                              | -        |                       |                           |                       |
|                          |                              |  |           |               |   |                              |          |                       |                           |                       |
| _                        | Summ                         | ary of DMA l                           | Informati | on (Mus       | st match proj                             | ject descript                | tion and | SWQMP N               | larrative)                | _                     |
| No. of DMAs              | Total DMA<br>Area<br>(acres) | Total<br>Impervious<br>Area<br>(acres) | % Imp     |               | Area<br>Weighted<br>Runoff<br>Coefficient | Total DCV<br>(cubic<br>feet) |          | al Area<br>ed (acres) |                           | No. of<br>POCs        |
| 1                        | 0.76                         | 0.32                                   | 42%       |               | .90                                       | 543                          | .32      | 2                     |                           | 1                     |

Where: DMA = Drainage Management Area; Imp = Imperviousness; HSG = Hydrologic Soil Group; DCV= Design Capture Volume; BMP = Best Management POC = Point of Compliance; ID = identifier; No. = Number

B-3 The City of San Diego | Stormwater Standards | May 2021 Edition Part 1: BMP Design Manual





319 Main Street El Segundo, California 90245 t: 213/ 239 9700 f: 213/ 239 9699

LFA Job no. 23003

JADE LJ,



**NOT FOR** CONSTRUCTION

ENTITLE MENT REVIEW

COSTAL DEVELOPMENT PERMIT APPROVAL NO. 2590140

SITE DEVELOPMENT PERMIT APPROVAL NO. 2590140

DRAINAGE PLAN

SHEET NUMBER:


| SITE SPECIFIC DATA                         |              |                    |            |
|--|--------------|--------------------|------------|
| PROJECT NUMBER                             |              | 800997             |            |
| PROJECT NAME                               |              | 2072 VIA CASA ALTA |            |
| PROJECT LOCATION                           |              | LA JOLLA, CA       |            |
| STRUCTURE ID                               |              | MWS-4-6            |            |
| TREATMENT REQUIRED                         |              |                    |            |
| VOLUME BASED (CF)                          |              | FLOW BASED (CFS)   |            |
| 1,709                                      |              | N/A                |            |
| TREATMENT HGL AVAILABLE (FT)               |              | •                  | N/K        |
| PEAK BYPASS REQUIRED (CFS) — IF APPLICABLE |              |                    | N/A        |
| PIPE DATA                                  | I.E.         | MATERIAL           | DIAMETER   |
| INLET PIPE 1                               | 767.5        | PVC                | 6"         |
| OUTLET PIPE                                | 766.0        | PVC                | 6"         |
|  | PRETREATMENT | BIOFILTRATION      | DISCHARGE  |
| RIM ELEVATION                              | 776.0        | 776.0              | 776.0      |
| SURFACE LOAD                               | PEDESTRIAN   | N/A                | PEDESTRIAN |
| FRAME & COVER                              | 24" X 42"    | OPEN PLANTER       | N/A        |
| WETLANDMEDIA VOLUME (CY)                   |              |                    | 3.67       |
| ORIFICE SIZE (DIA. INCHES)                 |              |                    | Ø0.61"     |
| NOTES: PRELIMINARY NOT FOR CONSTRUCTION.   |              |                    |            |


#### **INSTALLATION NOTES**


- CONTRACTOR TO PROVIDE ALL LABOR, EQUIPMENT, MATERIALS AND INCIDENTALS REQUIRED TO OFFLOAD AND INSTALL THE SYSTEM AND APPURTENANCES IN ACCORDANCE WITH THIS DRAWING AND THE MANUFACTURER'S SPECIFICATIONS, UNLESS OTHERWISE STATED IN MANUFACTURER'S CONTRACT.
- UNIT MUST BE INSTALLED ON LEVEL BASE. MANUFACTURER RECOMMENDS A MINIMUM 6" LEVEL ROCK BASE UNLESS SPECIFIED BY THE PROJECT ENGINEER. CONTRACTOR IS RESPONSIBLE FOR VERIFYING PROJECT ENGINEER'S RECOMMENDED BASE SPECIFICATIONS.
- CONTRACTOR TO SUPPLY AND INSTALL ALL EXTERNAL CONNECTING PIPES. ALL PIPES MUST BE FLUSH WITH INSIDE SURFACE OF CONCRETE (PIPES CANNOT INTRUDE BEYOND FLUSH). INVERT OF OUTFLOW PIPE MUST BE FLUSH WITH DISCHARGE CHAMBER FLOOR. ALL PIPES SHALL BE SEALED WATERTIGHT PER MANUFACTURER'S STANDARD CONNECTION DETAIL.
- HATCH SHIPPED CAST INTO TOP SLAB. CONTRACTOR TO USE GROUT AND/OR BRICKS TO MATCH TOP SLAB WITH FINISHED SURFACE UNLESS SPÉCIFIED OTHERWISE.
- VEGETATION SUPPLIED AND INSTALLED BY OTHERS. ALL UNITS WITH VEGETATION MUST HAVE DRIP OR SPRAY IRRIGATION SUPPLIED AND INSTALLED BY OTHERS.
- CONTRACTOR RESPONSIBLE FOR CONTACTING CONTECH FOR ACTIVATION OF UNIT. MANUFACTURER'S WARRANTY IS VOID WITHOUT PROPER ACTIVATION BY A CONTECH REPRESENTATIVE.


#### **GENERAL NOTES**

MANUFACTURER TO PROVIDE ALL MATERIALS UNLESS OTHERWISE NOTED. ALL DIMENSIONS, ELEVATIONS, SPECIFICATIONS AND CAPACITIES ARE SUBJECT TO CHANGE. FOR PROJECT SPECIFIC DRAWINGS DETAILING EXACT DIMENSIONS, WEIGHTS AND ACCESSORIES PLEASE CONTACT CONTECH.

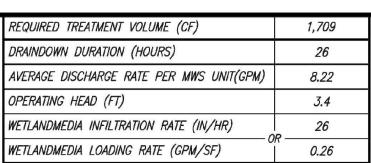

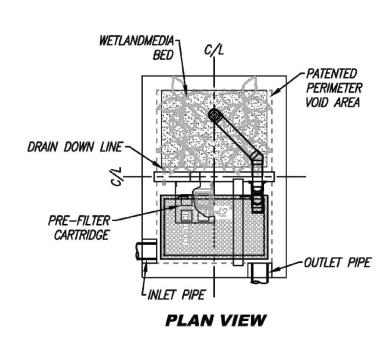

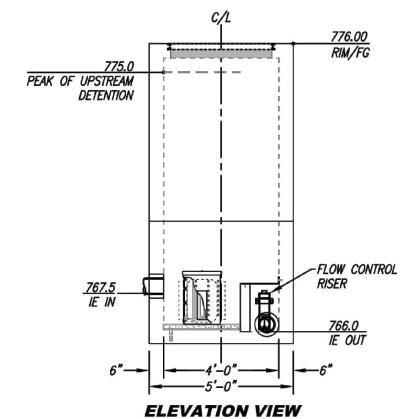

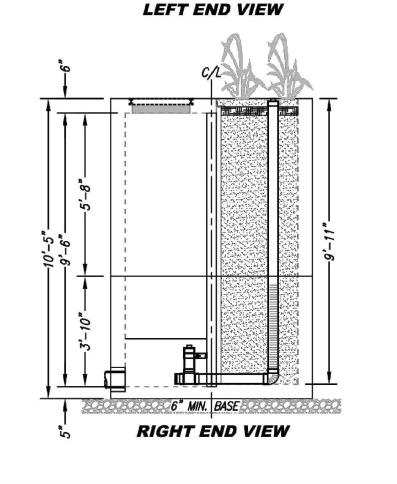

VEGETATION —

ESTABLISHMENT MEDIA


**ENGINEERED SOLUTIONS LLC** 

www.ContechES.com

ROPRIETARY AND CONFIDENTIAL: FOR PATENT INFORMATION, GO TO WAWW.ContechES.com/IP

*MWS-L-4-6-9'-11"-V* STORMWATER BIOFILTRATION SYSTEM STANDARD DETAIL

## 1 CONTECH MWS BIOFILTRATION SYSTEM DETAIL C300 CONTECH

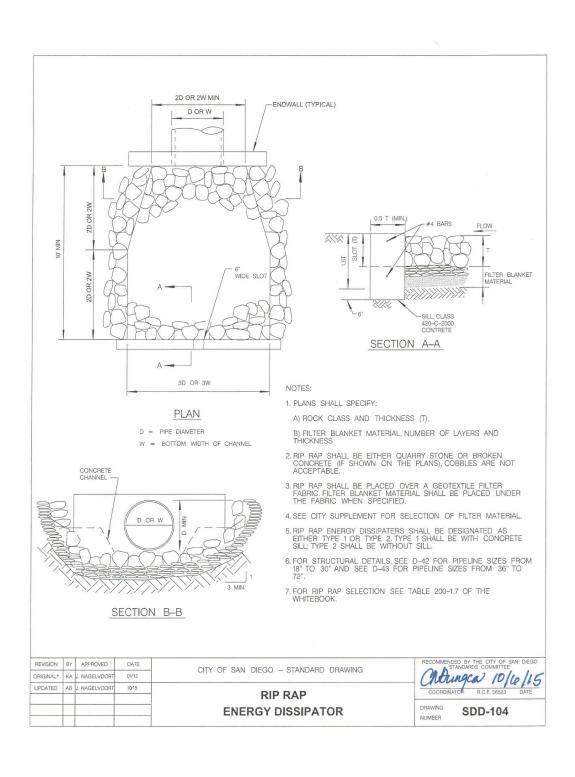



319 Main Street El Segundo, California 90245 t: 213/ 239 9700 f: 213/ 239 9699

LFA Job no. 23003



**NOT FOR** CONSTRUCTION

ENTITLE MENT REVIEW

SITE DEVELOPMENT PERMIT APPROVAL NO. 2590140

COSTAL DEVELOPMENT PERMIT APPROVAL NO. 2590140

**LOW IMPACT** DEVELOPMENT **DETAILS** 

# ATTACHMENT 5 DRAINAGE REPORT

Attach project's drainage report. Refer to Drainage Design Manual to determine the reporting requirements.





# ATTACHMENT 6 GEOTECHNICAL AND GROUNDWATER INVESTIGATION REPORT

Attach project's geotechnical and groundwater investigation report. Refer to Appendix C.4 to determine the reporting requirements.





## Geotechnical Exploration, Inc.

SOIL AND FOUNDATION ENGINEERING ● GROUNDWATER ● ENGINEERING GEOLOGY

08 November 2024

Mr. Kevin Javaheri 2072 Via Casa Alta La Jolla, CA 92037 Job No. 21-13556

Subject: Infiltration Feasibility Condition- Revised

Proposed Javaheri Residence

2072 Via Casa Alta La Jolla, California

Dear Mr. Javaheri:

In accordance with your request and as requested by the City of San Diego reviewer, *Geotechnical Exploration, Inc.* has prepared this letter regarding the infiltration feasibility conditions at the subject property. Our infiltration feasibility evaluation is based on the information gathered for preparation of our "*Report of Preliminary Geotechnical and Geologic Fault Investigation*" dated July 28, 2022, our "*Report of Limited Geotechnical Investigation for Proposed Storm Water Infiltration BMPs*" dated August 27,2024, review of the geologic map for the area of the subject property and review of the USDA Web Soil Survey, as well as our past experience with materials similar to those encountered at the site. In preparation of this letter we reviewed the preliminary drainage plan prepared by Labib, Funk and Associates, undated. Refer to the Vicinity Map, Figure No. I, for the location of the property. Refer to the Plot Plan and Site-Specific Geologic Map, Figure No. II, for proposed site development and other information.

Per the August 2024 City of San Diego Storm Water Standards BMP Design Manual, Appendix C, Section C.1 "Simple Feasibility Criteria" we are documenting the following:

- The site was first analyzed for infiltration feasibility during the planning phase.
- Geotechnical investigations were performed across the property consisting of an exploratory large-diameter boring and exploratory trench to gather subsurface data and evaluate geologic hazards at the site. Advancement, logging and sampling of the large diameter boring on December 20, 2021, gathered subsurface data and enabled us to assess potential landslide hazards across the project area. Excavation, logging and sampling of an exploratory trench on March 2 and 3, 2022, extending across the building pad area of the site, gathered subsurface data and enabled us to assess potential faulting hazards across the project area. The data obtained and the analyses performed were for the purpose of evaluating geologic hazards and providing appropriate mitigation, as well as providing geotechnical design and construction criteria for the project earthwork, building foundations, slab on-grade floors, swimming pool, driveway, retaining walls and associated improvements. In addition, we performed infiltration testing in the southern portion of the property on August 12 and 13, 2024 for the feasibility of infiltration storm water BMPS at a potential alternative location on the property.

Based on our exploratory trenching and drilling at the site, we found the site is underlain at relatively shallow depth by upper Cretaceous-aged Cabrillo sandstone (Kcs) formational materials. In the southern portion of the site, weathered argillic marine terrace materials of the middle to early Pleistoceneaged Very Old Paralic Deposits, (Qvop<sub>10</sub>) were encountered overlying Cabrillo formational materials. All existing fill soils on the property were not considered suitable and will require removal and recompaction. Refer to our "Report of Preliminary Geotechnical and Geologic Fault Investigation" dated July 28, 2022, for details.



Based on our infiltration testing, with measured infiltration rates of 0.0-inch/hour and 0.0155-inch/hour, with temperature correction and a factor of safety of 2 applied at the tested locations on the upper relatively level, southern portion of the property; and also considering that the northern (majority) portion of the property is located on a natural slope greater than 25%, the design of full or partial storm water infiltration BMPs is not considered feasible on the subject site. Refer to our "Report of Limited Geotechnical Investigation for Proposed Storm Water Infiltration BMPs" dated August 27,2024, for details.

- The subject property is raw undeveloped land. It is our understanding, based on communications with the project architect, Mr. Claude-Anthony Marengo of Marengo Morton Architects, and review of the preliminary architectural plans, that the vacant subject site is proposed to receive a new 16,251-square-foot, two-story over basement single-family residential structure, an accessory dwelling unit (ADU), a swimming pool, driveway, landscaping and associated improvements.
- It is our understanding that extensive design discussions were had with the property owner and design team, before our first involvement in 2021, resulting in the current design determination. The proposed location of storm water BMPs are northwest of the new development on the northern descending slope. Based on the conceptual grading plan and architectural design, we understand that this would be the most feasible location on the property (i.e., lowest elevation in relation to the proposed site development. As part of the design discussions, infiltration testing was performed for the potential of infiltration BMPs at a potential alternative location in the southern portion of the property, considering that the northern part of the property is a steep natural slope.



- Full/partial infiltration is not feasible on the subject property based the proposed infiltration area located within the standard setbacks of 50 feet of a natural slope (>25%) and 10 feet of proposed structures, walls, utility lines and property lines. The lower 62% of the property slopes at 64% to the north. Infiltration water at the proposed location on the property has the potential to result in an increase of slope failure of nearby slopes as well as movement to nearby structures. Natural slopes and structures in close proximity to the proposed infiltration area prevent full/partial infiltration.
- No physical impairments are known on the subject property that will additionally prevent full/partial infiltration, except for the existing fill conditions.
- It is our understanding that all considerations for site design alternatives were made in an effort to achieve partial/full infiltration within the DMA. As previously mentioned, infiltration testing was performed for the potential of infiltration at an alternative location in the southern portion of the property. Based on the measured infiltration rates and geologic hazards on the property, potential alternative locations for full/partial infiltration BMPs do not exist.
- Site design BMPs requirements were included in the overall design. After our geotechnical investigation findings were provided to the design team and discussions were had, it was determined that partial/full infiltration BMPs within the DMA are not feasible.
- Based on review of our previous "Report of Preliminary Geotechnical and Geologic Fault Investigation" dated July 28, 2022, our "Report of Limited Geotechnical Investigation for Proposed Storm Water Infiltration BMPs" dated August 27,2024, provided development plans, our recent site observations, and review of the geologic map for the area, as well as our past experience with



materials similar to those encountered at the site, it is our professional opinion that the design of full or partial storm water infiltration BMPs is not considered feasible on the subject site due to geologic hazards that cannot be reasonably mitigated to an acceptable level.

Full/partial infiltration is not feasible on the subject property based proposed infiltration BMPs will be within 50 feet of adjacent existing natural slopes. Section C.1 of the above referenced BMP Design Manual states that, "Full and partial infiltration BMPs shall not be proposed within 50 feet of a natural slope (>25%) or within a distance of 1.5H from fill slopes where H is the height of the fill slope." The lower 62% of the property slopes at 64% to the north. Infiltration water on the property has the potential to result in an increase of slope failure of nearby slopes. An increase in moisture content in the vicinity of a slope, which may result from storm water infiltration, has the potential to change the soil strength and unit weight, and add seepage forces to the slope, which in turn may reduce the factor of stability of the slope.

Also, full/partial infiltration is not feasible on the subject property based proposed infiltration BMPs will be located within 10 feet of the proposed 10 feet of proposed structures, walls, utility lines, exterior improvements and property lines. Section C.1 of the above referenced BMP Design Manual also states that "Full and partial infiltration BMPs shall not be proposed within 10 feet (horizontal radial distance) of existing underground utilities, structures, or retaining walls."

Based on the conditions and geotechnical hazard presented above as well as measured infiltration rates of 0.0-inch/hour and 0.0155-inch/hour, with temperature correction and a factor of safety of 2 applied at the tested locations on the upper relatively level, southern portion of the property, we recommend



that the proposed stormwater detention and treatment be designed by the project Civil Engineer and discharge into an approved drainage facility.

- Please see the attached Plot Plan, Figure II, for an exhibit with all applicable
   DMAs that clearly labels:
  - Proposed development areas and development type.
  - Applicable features and setbacks that prevent partial or full infiltration, including underground utilities, structures, retaining walls, fill slopes, natural slopes, and existing fill materials greater than 5 feet.
  - Potential locations for structural BMPs.
  - Areas where full/partial infiltration BMPs cannot be proposed.

This opportunity to be of continued service is sincerely appreciated. If you have any questions concerning this matter, please contact our office. Reference to our **Job No. 21-13556** will help to expedite a response to your inquiries.

Respectfully submitted,

GEOTECHNICAL EXPLORATION, INC.

Jaime A. Cerros, P.E.
Senior Geotechnical Engineer

R.C.E. 34422/G.E. 2007


Jay K. Heiser, Senior Project Geologist

Steve Osetek, Project Geologist






## **VICINITY MAP**

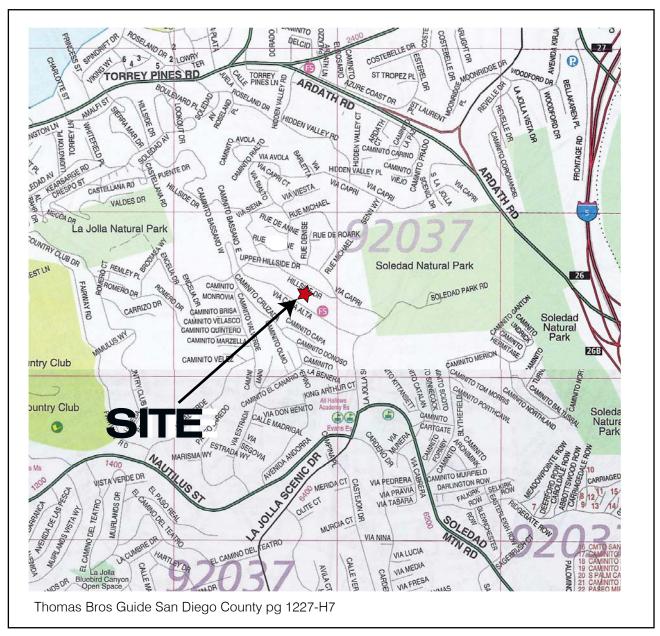

Javaheri Residence 2072 Via Casa Alta La Jolla, CA.

> Figure No. I Job No. 21-13556



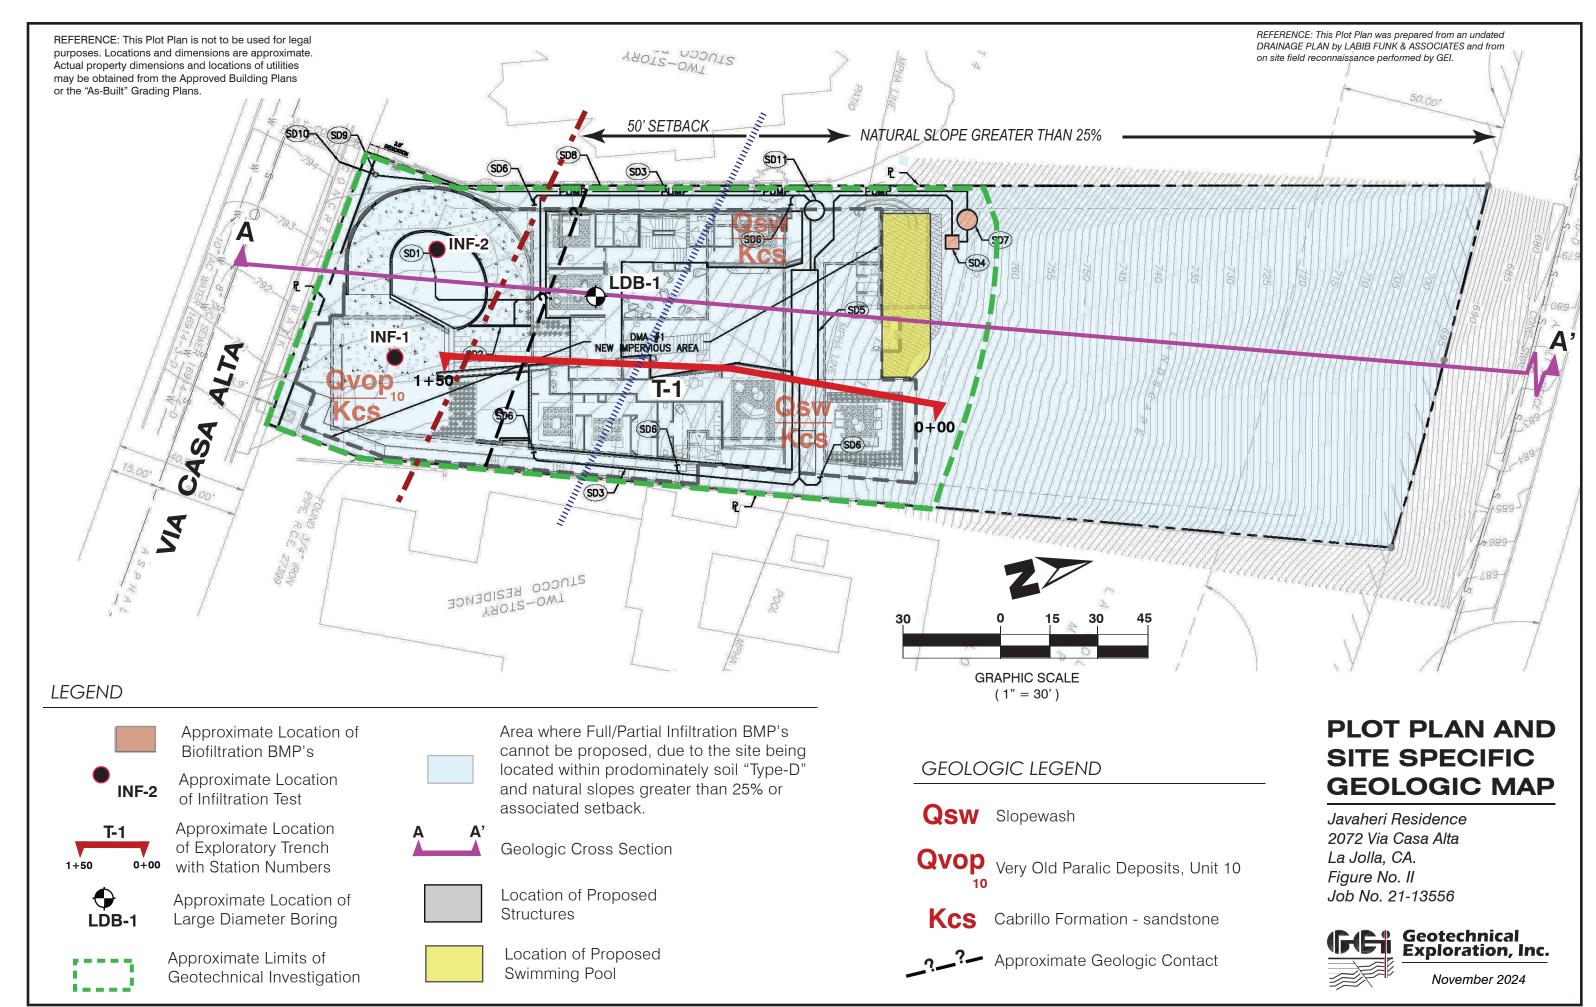

# REPORT OF PRELIMINARY GEOTECHNICAL AND GEOLOGIC FAULT INVESTIGATION

Proposed Javaheri Residence 2072 Via Casa Alta La Jolla, California

**JOB NO. 21-13556** 28 July 2022

Prepared for:

Mr. Kevin Javaheri





# Geotechnical Exploration, Inc.

SOIL AND FOUNDATION ENGINEERING ● GROUNDWATER ● ENGINEERING GEOLOGY

28 July 2022

Mr. Kevin Javaheri

Job No. 21-13556

c/o MARENGO MORTON ARCHITECTS Attn: Mr. Claude-Anthony Marengo Via email: CAMarengo@m2a.io

Subject: Report of Preliminary Geotechnical Investigation and Geologic

**Fault Investigation** 

Proposed Javaheri Residence

2072 Via Casa Alta La Jolla, California

Dear Mr. Javaheri:

In accordance with your request, and our work agreement dated September 14, 2021, *Geotechnical Exploration, Inc.* has performed a preliminary geotechnical investigation and geologic fault investigation for the subject project in La Jolla, California. The field work was performed on December 20, 2021, and March 2-3, 2022.

If the conclusions and recommendations presented in this report are incorporated into the design and construction of the proposed site development, it is our opinion that the site is suitable for the proposed project from a geotechnical perspective.

This opportunity to be of service is sincerely appreciated. Should you have any questions concerning the following report, please do not hesitate to contact us. Reference to our **Job No. 21-13556** will expedite a response to your inquiries.

Respectfully submitted,

GEOTECHNICAL EXPLORATION, INC.

Jaime A. Cerros, P.E.

R.C.E. 34422/G.E. 2007

Senior Geotechnical Engineer

Leslie D. Reed, President L.E.G. 999/P.G. 3391

GE 2007

EXP. 9/30/23

No. 999 Exp. 3/31/ 83

CERTIFIED ENGINEERING GEOLOGIST

7420 TRADE STREET SAN DIEGO, CA. 92121 8581-49-7222 FAX: (858) 549-1604 EMAIL: geotech@ger-sc. Carl

# **TABLE OF CONTENTS**

| I.    | PROJECT SUMMARY                              |    |  |
|-------|--|----|--|
| II.   | SCOPE OF WORK                                | 2  |  |
| III.  | SITE DESCRIPTION                             | 3  |  |
| IV.   | FIELD INVESTIGATION, OBSERVATIONS & SAMPLING | 4  |  |
| V.    | LABORATORY TESTING & SOIL INFORMATION        | 5  |  |
| VI.   | REGIONAL GEOLOGIC DESCRIPTION                | 7  |  |
| VII.  | SITE-SPECIFIC SOIL & GEOLOGIC DESCRIPTION    | 12 |  |
|       | A. Stratigraphy                              | 13 |  |
|       | B. Structure                                 | 15 |  |
| VIII. | GEOLOGIC HAZARDS                             | 18 |  |
|       | A. Local and Regional Faults                 | 19 |  |
|       | B. Other Geologic Hazards                    | 25 |  |
|       | C. Geologic Hazards Summary                  | 27 |  |
| IX.   | GROUNDWATER                                  | 28 |  |
| Χ.    | CONCLUSIONS & RECOMMENDATIONS                | 29 |  |
|       | A. Site Preparation and Earthwork            |    |  |
|       | B. Seismic Design Criteria                   |    |  |
|       | C. Foundation Recommendations                |    |  |
|       | D. Concrete Slab On-Grade Criteria           |    |  |
|       | E. Retaining Wall Design Criteria            |    |  |
|       | F. Swimming Pool Recommendations             |    |  |
|       | G. Driveway Recommendations                  |    |  |
|       | H. Slopes                                    |    |  |
|       | I. Site Drainage Considerations              |    |  |
|       | J. General Recommendations                   |    |  |
| XI.   | GRADING NOTES                                |    |  |
| XII.  | LIMITATIONS                                  | 55 |  |
|       |  |    |  |

# **REFERENCES**

#### **FIGURES**

| Ι.  | Vicinity Map       |
|-----|--------------------|
| TT_ | Dist Disp and Cita |

- IIa. Plot Plan and Site-Specific Geology
- IIb. Geologic Cross Section A-A'
- IIIa-d. Large Diameter Boring and Fault Trench Logs
- IVa-b. Laboratory Test Results
- V. Geologic Map Excerpt and Legend
- VI. Seismic Safety Study Map Excerpt and Legend
- VII. Retaining Wall Drainage Recommendations

#### **APPENDICES**

- A. Unified Soil Classification System
- B. USGS Design Maps Summary Report
- C. Beta Analytics, Inc. Radiocarbon Age Report
- D. Slope Stability Analysis



# REPORT OF PRELIMINARY GEOTECHNICAL AND GEOLOGIC FAULT INVESTIGATION

Proposed Javaheri Residence 2072 Via Casa Alta La Jolla, California

#### **JOB NO. 21-13556**

The following report presents the findings and recommendations of **Geotechnical Exploration, Inc.** for the subject project.

# I. PROJECT SUMMARY

It is our understanding, based on communications with your project architect, Mr. Claude-Anthony Marengo of Marengo Morton Architects, and review of the preliminary architectural plans, that the vacant subject site is proposed to receive a new 16,251-square-foot, two-story over basement single-family residential structure, an accessory dwelling unit (ADU), a swimming pool, driveway, landscaping and associated improvements. The proposed new structures and improvements are to be constructed of standard-type building materials utilizing conventional foundation systems with either concrete slab on-grade or raised wood floors. Foundation loads are expected to be typical for this type of relatively light construction.

Please be aware that the importance of thorough observation and testing during construction should be recognized by the client and the contractor(s) to provide appropriate documentation for any necessary as-graded reports. Recommendations for observation and testing are provided in this report under *Conclusions and Recommendations No. 8.* 

Based on our current understanding of the proposed construction, it is our explicit opinion that the proposed site development would not destabilize neighboring properties or induce the settlement of adjacent structures or right-of-way



improvements if designed and constructed in accordance with our recommendations. It is also our explicit opinion, based on our field investigation, review of pertinent geologic literature and analysis of geological maps and aerial photographs, that neither an active nor a potentially active fault or landslide underlies the subject site.

# II. SCOPE OF WORK

The scope of work performed for this investigation consisted of a field investigation with a site reconnaissance and geotechnical subsurface exploration program under the direction of our geologist, review of available published literature pertaining to the site geology, laboratory testing, geotechnical engineering analysis of the field and laboratory data, and the preparation of this report.

The field investigation consisted of an exploratory large-diameter boring and exploratory trench to gather subsurface data and evaluate geologic hazards at the site. Advancement, logging and sampling of the large diameter boring on December 20, 2021, gathered subsurface data and enabled us to assess potential landslide hazards across the project area. Excavation, logging and sampling of an exploratory trench on March 2 and 3, 2022, extending across the building pad area of the site, gathered subsurface data and enabled us to assess potential faulting hazards across the project area. The data obtained and the analyses performed were for the purpose of evaluating geologic hazards and providing appropriate mitigation, as well as providing geotechnical design and construction criteria for the project earthwork, building foundations, slab on-grade floors, swimming pool, driveway, retaining walls and associated improvements.



At the request of Mr. Marengo, **Geotechnical Exploration Inc.** also provided a "Report of Geologic Reconnaissance" dated 08 March 2022. The purpose of that report was to provide a research study of potential geologic hazards that should be evaluated during the investigation, provide preliminary opinions based on our research, and provide guidance and scope to investigate potential hazards.

# III. SITE DESCRIPTION

The subject property is known as Assessor's Parcel No. 352-750-15-00, Lot 15, per Recorded Map No. 8482, in the Mount Soledad area of the City and County of San Diego, State of California. Refer to Figure No. I, the Vicinity Map, for the site location.

The roughly rectangular-shaped site is 0.770-acre in size. The site consists of a relatively level to gently sloping, undeveloped southern portion where the new development is proposed. The northern portion of the site is a densely vegetated, relatively steep, northerly descending slope. Vegetation consists of weeds, grasses, native shrubs and mature trees.

The site is currently unoccupied with no structures or associated improvements. The site is bordered on the east by a single-family residence at a slightly lower elevation; on the west by a single-family residence at a slightly higher elevation; on the north by an unpaved portion of Hillside Drive approximately two-thirds down the slope; and on the south by Via Casa Alta, from where the site is also accessed.

The elevation across the site ranges from approximately 695 feet above Mean Sea Level (MSL) along the northern property line, to 794 feet above MSL in the southwestern corner. Information concerning elevations across the site was obtained from the Topographic Survey, undated, by Ciremele Surveying Inc.



# IV. FIELD INVESTIGATION, OBSERVATIONS & SAMPLING

The field investigation was performed in two phases. The first phase consisted of a surface reconnaissance and advancement of a 30-inch large diameter boring (LDB-1; see Figure No. IIIa) in the building pad area utilizing a truck-mounted drill rig with bucket auger. The large diameter boring was advanced to a depth of 80 feet below existing grade and our geologist was lowered into the boring to log in situ three-dimensional structural components, and gather data on subsurface conditions. In particular, the potential presence of shear zones was investigated to evaluate if the southern portion of the site is underlain by a landslide.

The second phase consisted of excavation of a trench (T-1; see Figure No. IIIb) across the building pad area utilizing a track-mounted hoe for the purpose of investigating if active faulting crosses the building pad area of the proposed development. The trench was excavated to a depth of up to 9 feet and a minimum of  $3\frac{1}{2}$  feet into formational soils across the entire length of the trench. The placement and total length of the trench was strategically located to intersect mapped faults of the area (Kennedy, 1975) and any potential strands of mapped faults within a 30-degree orientation within the building pad area of the proposed structure.

The soils encountered in the large diameter boring and trench were continuously logged in the field by our geologist and described in accordance with the Unified Soil Classification System (refer to Appendix A). The approximate locations of the large diameter boring, trench and site-specific geology are shown on the Plot Plan and Site-Specific Geologic Map, Figure No. II.

Representative soil samples for laboratory geotechnical testing were obtained from the large diameter boring and trench at selected depths appropriate to the



investigation. Sampling consisted of the collection of disturbed bulk samples and relatively undisturbed chunk samples to aid in classification and for appropriate laboratory testing. A 3-inch outer diameter hand driven sampler was also used to obtain undisturbed ring samples. All samples were returned to our laboratory for evaluation and testing. Exploratory boring and trench logs were prepared on the basis of our observations and laboratory test results and are attached as Figure Nos. IIIa-d.

The exploratory boring and trench logs and related information depict subsurface conditions only at the specific locations shown on the plot plan and on the particular date designated on the logs. Subsurface conditions at other locations may differ from conditions occurring at the locations. Also, the passage of time may result in changes in subsurface conditions due to environmental changes.

# V. LABORATORY TESTING & SOIL INFORMATION

Laboratory tests were performed on the retrieved soil samples in order to evaluate their physical and mechanical properties and their ability to support the proposed residential development. Test results are presented on the exploratory boring and trench logs, Figure Nos. IIIa-d and the Laboratory Test Results, Figure Nos. IVa-b. The following tests were conducted on the sampled soils:

- 1. Laboratory Compaction Characteristics (ASTM D1557-12[2021])
- 2. Determination of Percentage of Particles Smaller than #200 Sieve (ASTM D1140-17)
- 3. Expansion Index (ASTM D4829-19)
- 4. Standard Test Method for Direct Shear Test of Soils under Consolidated Drained Conditions (ASTM D3080-11)
- 5. Radiocarbon Age Dating by High Probability Density Range Method (HPD): INTCAL20



Laboratory compaction values (ASTM D1557-12[2021]) establish the optimum moisture content and the laboratory maximum dry density of the tested soils. The relationship between the moisture and density of remolded soil samples helps to establish the relative compaction of the existing fill soils and soil compaction conditions to be anticipated during any future grading operation. The test results are presented on the exploratory boring and trench logs at the appropriate sample depths and Figure Nos. IVa-b.

The particle size smaller than a No. 200 sieve analysis (ASTM D1140-17) aids in classifying the tested soils in accordance with the Unified Soil Classification System and provides qualitative information related to engineering characteristics such as expansion potential, permeability, and shear strength. The test results are presented on the exploratory boring and trench logs at the appropriate sample depths and on Figure Nos. IVa-b.

The expansion potential of soils is determined, when necessary, utilizing the Standard Test Method for Expansion Index of Soils (ASTM D4829-19). In accordance with the Standard (Table 5.3), potentially expansive soils are classified as follows:

| EXPANSION INDEX | POTENTIAL EXPANSION |
|-----------------|---------------------|
| 0 to 20         | Very low            |
| 21 to 50        | Low                 |
| 51 to 90        | Medium              |
| 91 to 130       | High                |
| Above 130       | Very high           |

Based on our visual classification and our laboratory test results of 90 and 92, the sandy fat clay slopewash, and lean clay/clayey sands argillic terrace materials overlying the upper 1 to 3 feet of the site possess a high potential for expansion. Based on our visual classification and experience with similar Cabrillo Formation



sandstone materials, it is our opinion that the formational materials underlying the site and encountered in our exploratory boring and trench possess a very low to low potential for expansion.

Radiocarbon age dating was performed on three samples by a third-party testing laboratory, Beta Analytic, Inc., using the High Probability Density Range Method (HPD): IntCal20. The naturally occurring unstable carbon-14 isotope undergoes beta decay into the stable nitrogen-14 isotope, with a half-life of  $5,370~(\pm40)$  years. By comparing the ratio of residual carbon-14 to stable carbon-12 and carbon-13 isotopes, the age of the sample can be determined. The three samples were obtained in the slopewash materials and were dated at  $3,530~(\pm30)$ ,  $3,060~(\pm30)$  and  $2,090~(\pm30)$  years before present. The test results are presented in Appendix C.

Based on the field and laboratory test data, our observations of the primary soil types, and our previous experience with laboratory testing of similar soils, our Geotechnical Engineer has assigned values for friction angle, coefficient of friction, and cohesion for those soils that will have significant lateral support or load bearing functions on the project. The assumed soil strength values have been utilized in determining the recommended bearing value as well as active and passive earth pressure design criteria for foundations and associated improvements.

# **VI. REGIONAL GEOLOGIC DESCRIPTION**

San Diego County has been divided into three major geomorphic provinces: the Coastal Plain, the Peninsular Ranges and the Salton Trough. The Coastal Plain exists west of the Peninsular Ranges. The Salton Trough is east of the Peninsular Ranges. These divisions are the result of the basic geologic distinctions between the areas. Mesozoic metavolcanic, metasedimentary and plutonic rocks predominate in the



Peninsular Ranges with primarily Cenozoic sedimentary rocks to the west and east of this central mountain range (Demere, 1997).

In the Coastal Plain region, where the subject property is located, the "basement" consists of Mesozoic crystalline rocks. Basement rocks are also exposed as high relief areas (e.g., Black Mountain northeast of the subject property and Cowles Mountain near the San Carlos area of San Diego). Younger Cretaceous and Tertiary sediments lap up against these older features. These sediments form a "layer cake" sequence of marine and non-marine sedimentary rock units, with some formations up to 140 million years old. Faulting related to the La Nacion and Rose Canyon Fault zones has broken up this sequence into a number of distinct fault blocks in the southwestern part of the county. Northwestern portions of the county are relatively undeformed by faulting (Demere, 1997).

The Peninsular Range forms the granitic spine of San Diego County. These rocks are primarily plutonic, forming at depth beneath the earth's crust 140 to 90 million years ago as the result of the subduction of an oceanic crustal plate beneath the North American continent. These rocks formed the much larger Southern California batholith. Metamorphism associated with the intrusion of these great granitic masses affected the much older sediments that existed near the surface over that period of time. These metasedimentary rocks remain as roof pendants of marble, schist, slate, quartzite and gneiss throughout the Peninsular Ranges. Locally, Miocene-age volcanic rocks and flows have also accumulated within these mountains (e.g., Jacumba Valley). Regional tectonic forces and erosion over time have uplifted and unroofed these granitic rocks to expose them at the surface (Demere, 1997).



The Salton Trough is the northerly extension of the Gulf of California. This zone is undergoing active deformation related to faulting along the Elsinore and San Jacinto Fault Zones, which are part of the major regional tectonic feature in the southwestern portion of California, the San Andreas Fault Zone. Translational movement along these fault zones has resulted in crustal rifting and subsidence. The Salton Trough, also referred to as the Colorado Desert, has been filled with sediments to depth of approximately 5 miles since the movement began in the early Miocene, 24 million years ago. The source of these sediments has been the local mountains as well as the ancestral and modern Colorado River (Demere, 1997).

As indicated previously, the San Diego area is part of a seismically active region of California. It is on the eastern boundary of the Southern California Continental Borderland, part of the Peninsular Ranges Geomorphic Province. This region is part of a broad tectonic boundary between the North American and Pacific Plates. The actual plate boundary is characterized by a complex system of active, major, right-lateral strike-slip faults, trending northwest/southeast. This fault system extends eastward to the San Andreas Fault (approximately 70 miles from San Diego) and westward to the San Clemente Fault (approximately 50 miles off-shore from San Diego) (Berger and Schug, 1991).

In California, major earthquakes can generally be correlated with movement on active faults. As defined by the California Geological Survey (CGS), 2018, a "Holocene-active fault" is one that has had surface displacement within Holocene time, the last 11,700 years. In addition, "pre-Holocene fault" is a fault whose recency of past movement is older than 11,700 years.

A three-tier fault classification is used as follows:



- <u>Active Faults</u> had demonstrable surface displacement during the Holocene time, where Holocene time is the geological epoch that began 11,700 years before present.
- <u>Potentially Active Faults</u> had demonstrable surface displacement during Quaternary time, but Holocene surface displacement is indeterminate.
- <u>Inactive Faults</u> are pre-Quaternary faults where the Quaternary period timeline is approximately 1.6 million years ago.

During recent history, prior to April 2010, the San Diego County area has been relatively quiet seismically. The youngest paleoearthquake that cuts the early historical living surface is likely the 1862 San Diego earthquake that had an estimated magnitude of M6 (Legg and Agnew, 1979; Singleton et al., 2019). Paleoseismic trenches at the Presidio Hills Golf Course on the main trace of the Rose Canyon Fault contained evidence for historical ground rupturing earthquakes as recently as 1862 and the mid-1700s. Results of the study also suggest the Rose Canyon Fault has a ~700-800-year recurrence interval (Singleton et al., 2019).

On June 15, 2004, a M5.3 earthquake occurred approximately 45 miles southwest of downtown San Diego (26 miles west of Rosarito, Mexico). Although this earthquake was widely felt, no significant damage was reported. Another widely felt earthquake on a distant southern California fault was a M5.4 event that took place on July 29, 2008, west-southwest of the Chino Hills area of Riverside County.

Several earthquakes ranging from M5.0 to M6.0 occurred in northern Baja California, centered in the Gulf of California on August 3, 2009. These were felt in San Diego but no injuries or damage was reported. A M5.8 earthquake followed by a M4.9 aftershock occurred on December 30, 2009, centered about 20 miles south of the



Mexican border city of Mexicali. These were also felt in San Diego, swaying high-rise buildings, but again no significant damage or injuries were reported.

On April 04, 2010, a large earthquake occurred in Baja California, Mexico. It was widely felt throughout the southwest including Phoenix, Arizona and San Diego in California. This M7.2 event, the Sierra El Mayor earthquake, occurred in northern Baja California, approximately 40 miles south of the Mexico-USA border at shallow depth along the principal plate boundary between the North American and Pacific plates. According to the U.S. Geological Survey this is an area with a high level of historical seismicity, and it has recently also been seismically active, although this is the largest event to strike in this area since 1892. The April 04, 2010, earthquake appears to have been larger than the M6.9 earthquake in 1940 or any of the early 20th century events (e.g., 1915 and 1934) in this region of northern Baja California. The event caused widespread damage to structures, closure of businesses, government offices and schools, power outages, displacement of people from their homes and injuries in the nearby major metropolitan areas of Mexicali in Mexico and Calexico in Southern California.

This event's aftershock zone extends significantly to the northwest, overlapping with the portion of the fault system that is thought to have ruptured in 1892. Some structures in the San Diego area experienced minor damage and there were some injuries. Ground motions for the April 04, 2010, main event, recorded at stations in San Diego and reported by the California Strong Motion Instrumentation Program (CSMIP), ranged up to 0.058g.

On July 07, 2010, a M5.4 earthquake occurred in Southern California at 4:53 pm (Pacific Time) about 30 miles south of Palm Springs, 25 miles southwest of Indio, and 13 miles north-northwest of Borrego Springs. The earthquake occurred near the



Coyote Creek segment of the San Jacinto Fault. The earthquake exhibited right lateral slip to the northwest, consistent with the direction of movement on the San Jacinto Fault. The earthquake was felt throughout Southern California, with strong shaking near the epicenter. It was followed by more than 60 aftershocks of M1.3 and greater during the first hour.

In the last 50 years, there have been four other earthquakes in the magnitude M5.0 range within 20 kilometers of the Coyote Creek segment: M5.8 in 1968, M5.3 on 2/25/1980, M5.0 on 10/31/2001, and M5.2 on 6/12/2005. The biggest earthquake near this location was the M6.0 Buck Ridge earthquake on 3/25/1937.

# VII. SITE-SPECIFIC SOIL & GEOLOGIC DESCRIPTION

Our field work, reconnaissance and review of the "Geologic Map of San Diego, 30'x60' Quadrangle, CA," by Kennedy and Tan, 2008, indicate that the site is underlain at relatively shallow depth by upper Cretaceous-aged Cabrillo sandstone (Kcs) formational materials. In the southern portion of the site, weathered argillic marine terrace materials of the middle to early Pleistocene-aged Very Old Paralic Deposits, (Qvop<sub>10</sub>) were encountered overlying Cabrillo formational materials. Terrace materials and materials characteristic of middle Eocene-aged Ardath Shale (Ta) lithology were encountered in transverse cracks crossing our test trench and the site (see Structure below). Of particular significance, unbroken or offset Qvop<sub>10</sub> ( $\pm 850$  ka) deposits were observed to overlie the infilled transverse cracks. The remainder of the investigated central portion of the site is overlain by approximately 1 to 3 feet of surficial slopewash materials (Qsw). As shown on the cross section (Figure No. IIId), the slopewash materials dated between 2,090 ( $\pm 30$ ) and 3,530 ( $\pm 30$ ) years before present were also not offset by any of the transverse crack features. Figure



No. V presents a plan view geologic map (Kennedy and Tan, 2008) of the general area of the site.

# A. <u>Stratigraphy</u>

<u>Slopewash (Qsw):</u> Slopewash materials were encountered overlying the central portion of the site and were observed in both the large diameter boring LDB-1 and trench T-1, ranging from 1 to 3 feet in thickness. The encountered slopewash consists of moist, dark brown, sandy fat clay (CH). In the large diameter boring, approximately 10% of the slopewash materials were observed to be angular to rounded gravels and cobbles, and some tree roots were also observed. As mentioned above, slopewash materials were carbon 14-dated between  $2090 \ (\pm 30)$  and  $3530 \ (\pm 30)$  years before present.

The slopewash is very stiff and, in our opinion, has a high expansion potential. In our opinion, due to the high expansion potential, the slopewash is not suitable to support loads from new foundations or additional fill. Review and evaluation of the final grading plan will be required to determine if all of the high expansion potential soils can be utilized on site. Refer to Figure Nos. IIIa-d and IVa-b for details.

Marine Terrace Deposits/Very Old Paralic Deposits ( $Qvop_{10}$ ): Very Old Paralic Deposit materials, also known as Marine Terrace Deposits, were encountered in the southern portion of the site and observed in trench T-1. The encountered terrace materials consist of slightly moist, dark reddish brown argillic lean clay/clayey sand (CL/SC) and a near vertical lens of dry to slightly moist, reddish brown to orangish brown silty gravel with sand (GM) infilling a transverse crack in the Cabrillo Formation. The basal contact of the  $850\pm$  ka Very Old Paralic Deposits were not offset across the transverse cracking in the Cabrillo Formation.



The material in the transverse crack was observed to contain up to approximately 40% rounded gravels and cobbles. The terrace materials are dense/very stiff. In our opinion the argillic lean clay/clayey sand has a high expansion potential and the silty gravel with sand has a low expansion potential. Furthermore, the argillic terrace materials are not suitable in their current condition for support of loads from new foundations or additional fill due to their high expansion potential. Review and evaluation of the final grading plan will be required to determine if all of the high expansion potential soils can be utilized on site. Refer to Figure Nos. IIIa-d and IVa-b for details. Kennedy and Tan (2008), describe the Very Old Paralic Deposits, Unit 10, as "Poorly sorted, moderately permeable, reddish-brown, interfingered strandline, beach, estuarine and colluvial deposits composed of siltstone, sandstone and conglomerate."

Cabrillo Formation Sandstone (Kcs): The Cabrillo formation sandstone underlies the entire project area at a relatively shallow depth. The encountered Cabrillo sandstone formational materials consist of fine- to medium-grained, slightly moist, yellowish brown, silty sand (SM). The formational materials encountered are dense to very dense, and in our opinion, have a very low to low expansion potential. Minor amounts of sandy silt (ML) and lean clay (CL) materials, possibly originating from the Ardath Shale or a Cabrillo formation lithologic unit similar to the Ardath Shale, were observed to be infilling traverse cracks. Refer to Figure Nos. IIIa-d and Figure Nos. IVa-b for details. In our opinion, the Cabrillo formational materials are suitable in their current condition to support additional fill or loads from the proposed additions or improvements. Kennedy and Tan (2008), describe the Cabrillo Formation as "Mostly massive medium-grained sandstone."



# B. <u>Structure</u>

Geologic structure was observed in the Cabrillo Formation during the large-diameter boring and trenching phases of the field investigation. Generally, the Cabrillo Formation was observed to have massive structure. However, at depths of 52 feet and 76 feet in the large diameter boring (Figure Nos. IIIa-c), bedding attitudes of N80°E, 20°N and N80°E, 26°N, respectively, were observed. These are in close agreement with the N70°E, 25°N attitude recorded by Kennedy approximately 300 feet northwest and on the same northerly sloping hillside as the subject property.

# General observations of geologic structure in the exploratory large diameter boring:

- 1. Clay and calcium carbonate filled fractures were observed, with the fracture planes generally being near vertical and random in bearing.
- 2. Minor caliche and conglomerate veins were observed in random orientation.
- 3. Minor fractures with no offset were observed, often with iron oxide staining or discolored sandstone.
- 4. Concretions in the sandstone were common.
- 5. Fractures were generally observed to be healed or infilled with clay or sandy materials. Open fractures were not observed. Indications of continuous shearing or brecciation were not observed.

#### General observations of geologic structure in the exploratory trench:

1. Minor fractures were observed in the Cabrillo Formation, generally near vertical and healed with calcium carbonate materials.



- 2. High-angle separations in the Cabrillo Formation from approximately 1 to 3 feet wide were generally observed to be infilled with Ardath Shale type material and Very Old Paralic Deposit, Unit 10 material. The orientation of these separations was generally close to east-west to northeast-southwest and the dip direction was generally approximately 45 to 80 degrees downslope. No indications of recent movement were observed in these fractures, and generally they appear to be healed.
- 3. The two largest separations in the Cabrillo Formation (up to approximately 10 feet wide) were observed to be infilled with materials characteristic of the Ardath Shale Formation. The larger separation zones are oriented N70°E, 64°NW and N90°E, 54°N. Due to the 54° and 64° dipping surfaces, and the inherent strength characteristics of the predominant Cabrillo Formation, it is our opinion that the geologic structure is neutral with respect to global stability of the site. Slope stability calculations have been performed along geologic cross section A-A' and are presented in Appendix D.
- 4. Two linear structural features are shown on the Geologic Hazards Map as Zone 12 (i.e., potentially active, inactive, presumed inactive or activity unknown) crossing Via Casa Alta. It is important to note that the two features were placed on the Geologic Hazards Map based on mapping by Kennedy, 1975. These two short linear features were eliminated as faults by Kennedy and Tan, 2008, in their update map of the San Diego Quadrangle (see Figure No. V for an excerpt of this map) and, in our opinion, are not faults but are most likely due to tectonic uplift breakage.



As shown on the geologic map (Figure No. V) and geologic hazards map (Figure No. VI), two linear features cross Via Casa Alta. The westernmost feature crosses Via Casa Alta approximately 8 parcels west of the subject property and the eastern feature crosses Via Casa Alta 4 lots to the west and across the subject property in an easterly direction. The eastern feature was encountered by our firm crossing the lower northwest corner of the lot, adjacent to the fire station, during the 1997 development of the property. The short eastern and western linear features are oriented at 50- to 80-degree angles, respectively, to the Mount Soledad branch of the Rose Canyon Fault zone, which crosses the lower northern flank of Mount Soledad. The Via Casa Alta features are not, therefore, aligned with the Rose Canyon Fault zone primary stress relief system. In our opinion, they are not faults with the potential for offset in response to accumulating strain relief but are more likely a result of intraformational breakage of tectonic origin due to structural deformation resulting in the 350 feet of Mount Soledad uplift.

We note that the western feature as mapped by Kennedy in 1975 passes under the Lindavista Formation (Qln)/Very Old Paralic Deposits (Qvop $_{10}$ ) without offsetting them. This indicates the breakage feature predates deposition of the 850± ka paralic deposits and the most recent uplift of Mount Soledad. The eastern feature was not mapped crossing the paralic deposit on the Via Casa Alta ridgeline but we consider it to also predate deposition of the 850± ka Very Old Paralic Deposits and the Mount Soledad 350 feet of uplift.

In summary, it is our opinion that, although the Via Casa Alta formational breakage features are faulting by definition, they are not part of the Rose Canyon Fault zone primary stress relief system that would warrant considering them active or potentially active faults. We consider it much more likely that both of the Via Casa Alta linear



features, which were eliminated from the 2008 Kennedy and Tan geologic map, are tectonic in origin and predate deposition of the ridgeline capping Very Old Paralic Deposits and the most recent 350-foot Mount Soledad uplift event.

Furthermore, it is our opinion that the risk of structurally significant damage to these features as a result of sympathetic movement in response to a Rose Canyon Fault zone event is nominal. Given all of the above, it is our opinion that an active or potentially active fault does not underlie the subject property.

# VIII. GEOLOGIC HAZARDS

Our review of the City of San Diego Seismic Safety Study, Geologic Hazards Map, Sheet 29 (2008) indicates that the site is located in a geologic hazard area designated as Geologic Hazard Categories (GHC) 12 and 27. An excerpt of the map is presented in Figure No. VI, Seismic Hazard Map Excerpt and Legend. GHC 12 is a fault zone category described as "Potentially Active, Inactive, Presumed Inactive, or Activity Unknown." GHC 27 is a slide prone formation category described as "Otay, Sweetwater, and others."

As previously described, based on our reconnaissance, the data obtained from our field investigation, and the Kennedy 1975 and Kennedy and Tan 2008 geologic map, it is our opinion that an active or potentially active fault does not underlie the site. Despite the evidence of ancient landsliding in the Cabrillo Formation on the northern flank of Mount Soledad, in our opinion, the site is not underlain by an active landslide or a high-risk, slide prone formation. Furthermore, our review of the "Earthquake Zones of Required Investigation, La Jolla Quadrangle" by the California Geological Survey (CGS), dated September 23, 2021, indicates the site is not within the



"Earthquake Fault Zones." No significant geologic hazards are known to exist on the subject site that would prohibit the proposed construction.

The following is a discussion of the geologic conditions and hazards common to this area of La Jolla, as well as project-specific geologic information relating to development of the subject property.

# A. Local and Regional Faults

Reference to the geologic map of the area (Kennedy and Tan, 2008), Figure No. V, indicates that no faults are shown to cross the site. In our explicit professional opinion, neither an active fault nor a potentially active fault underlies the site.

Newport-Inglewood-Rose Canyon Fault Zone System: The Rose Canyon portion of the Newport-Inglewood-Rose Canyon Fault Zone is mapped approximately 0.25-mile northeast of the site and the offshore portion of the Newport-Inglewood portion is mapped approximately 24 miles northwest of the site. The offshore portion of the Newport-Inglewood Fault Zone is described as a right-lateral, local reverse slip associated with fault steps (SCEDC, 2022). The reported length is 46.2 miles extending in a northwest-southeast direction. Surface trace is discontinuous in the Los Angeles Basin, but the fault zone can easily be noted there by the existence of a chain of low hills extending from Culver City to Signal Hill. South of Signal Hill, it roughly parallels the coastline until just south of Newport Bay, where it heads offshore, and becomes the Newport-Inglewood-Rose Canyon Fault Zone. A significant earthquake (M6.4) occurred along this fault on March 10, 1933. Since then, no additional significant events have occurred. The fault is believed to have a slip rate of approximately 0.6-mm/yr with an unknown recurrence interval. This fault



is believed capable of producing an earthquake of M6.0 to M7.4 (Grant Ludwig and Shearer, 2004).

Rose Canyon Fault Zone: The Rose Canyon Fault Zone is the southern section of the Newport-Inglewood-Rose Canyon Fault Zone system mapped in the San Diego County area as trending north-northwest to south-southeast from Oceanside to San Diego and generally north-south into San Diego Bay, through Coronado and offshore downtown San Diego, from where it appears to head southward. The Rose Canyon Fault Zone system is considered to be a complex zone of onshore and offshore, en echelon right lateral, strike slip, oblique reverse, and oblique normal faults. This fault is considered to be capable of generating an M6.9 earthquake (EERI, 2021) and is considered microseismically active, although no significant recent earthquakes since 1862 (Legg and Agnew, 1979) are known to have occurred on the fault.

Investigative work on faults that are part of the Rose Canyon Fault Zone at the Police Administration and Technical Center in downtown San Diego, at the SDG&E facility in Rose Canyon, and within San Diego Bay and elsewhere within downtown San Diego, has encountered offsets in Holocene (geologically recent) sediments (Singleton et al., 2019). These findings confirm Holocene displacement on the Rose Canyon Fault, which was designated an "active" fault in November 1991 (Hart and Bryant, 1997).

Rockwell (2010) has suggested that the Rose CFZ underwent a cluster of activity including 5 major earthquakes in the early Holocene, with a long period of inactivity following, suggesting major earthquakes on the RCFZ behaves in a cluster-mode, where earthquake recurrence is clustered in time rather than in a consistent recurrence interval. With the most recent earthquake (MRE) nearly 160 years ago, it is suggested that a period of earthquake activity on the RCFZ may have begun.



Rockwell (2010) and a compilation of the latest research implies a long-term slip rate of approximately 1 to 2 mm/year.

Coronado Bank Fault: The Coronado Bank Fault is located approximately 12.6 miles southwest of the site. Evidence for this fault is based upon geophysical data (acoustic profiles) and the general alignment of epicenters of recorded seismic activity (Greene, 1979). The Oceanside earthquake of M5.3, recorded July 13, 1986, is known to have been centered on the fault or within the Coronado Bank Fault Zone. Although this fault is considered active, due to the seismicity within the fault zone, it is significantly less active seismically than the Elsinore Fault (Hileman, 1973). It is postulated that the Coronado Bank Fault is capable of generating a M7.6 earthquake and is of great interest due to its close proximity to the greater San Diego metropolitan area.

<u>San Diego Trough Fault Zone</u>: The San Diego Trough Fault Zone is mapped approximately 23 miles west-southwest of the site at its closest point. This fault is described as a right-lateral type fault with a length of at least 93.2 miles and a slip rate of roughly 1.5 mm/yr. The most recent surface rupture is of Holocene age (SCEDC, 2022).

<u>San Clemente Fault Zone</u>: The San Clemente Fault Zone is mapped approximately 45 miles southwest of the site at its closest point. This fault is described as a right-lateral and vertical offsets type fault with a length of at least 130.5 miles described as essentially continuous with the San Isidro fault zone, off the coast of Mexico and a slip rate of roughly 1.5 mm/yr. The most recent surface rupture is of Holocene age (SCEDC, 2022).



Elsinore Fault: The Temecula and Julian sections of the Elsinore Fault Zone are located approximately 38 to 56 miles northeast and east of the site. The Elsinore Fault Zone extends approximately 200 kilometers (125 miles) from the Mexican border to the northern end of the Santa Ana Mountains. The Elsinore Fault zone is a 1- to 4-mile-wide, northwest-southeast-trending zone of discontinuous and en echelon faults extending through portions of Orange, Riverside, San Diego, and Imperial Counties. Individual faults within the Elsinore Fault Zone range from less than 1 mile to 16 miles in length. The trend, length and geomorphic expression of the Elsinore Fault Zone identify it as being a part of the highly active San Andreas Fault system.

Like the other faults in the San Andreas system, the Elsinore Fault is a transverse fault showing predominantly right-lateral movement. According to Hart, et al. (1979), this movement averages less than 1 centimeter per year. Along most of its length, the Elsinore Fault Zone is marked by a bold topographic expression consisting of linearly aligned ridges, swales and hallows. Faulted Holocene alluvial deposits (believed to be less than 11,700 years old) found along several segments of the fault zone suggest that at least part of the zone is currently active.

Although the Elsinore Fault Zone belongs to the San Andreas set of active, northwest-trending, right-slip faults in the southern California area (Crowell, 1962), it has not been the site of a major earthquake in historic time, other than a M6.0 earthquake near the town of Elsinore in 1910 (Richter, 1958; Toppozada and Parke, 1982). However, based on length and evidence of late-Pleistocene or Holocene displacement, Greensfelder (1974) has estimated that the Elsinore Fault Zone is reasonably capable of generating an earthquake with a magnitude as large as M7.5. Study and logging of exposures in trenches placed in Glen Ivy Marsh across the Glen Ivy North Fault (a strand of the Elsinore Fault Zone between Corona and Lake Elsinore), suggest a



maximum earthquake recurrence interval of 300 years, and when combined with previous estimates of the long-term horizontal slip rate of 0.8 to 7.0 mm/year, suggest typical earthquake magnitudes of M6.0 to M7.0 (Rockwell et al., 1985). The Working Group on California Earthquake Probabilities (2008) has estimated that there is a 11 percent probability that an earthquake of M6.7 or greater will occur within 30 years on this fault.

<u>San Jacinto Fault</u>: The San Jacinto Fault is located 60 to 82 miles northeast of the site. The San Jacinto Fault Zone consists of a series of closely spaced faults, including the Coyote Creek Fault, that form the western margin of the San Jacinto Mountains. The fault zone extends from its junction with the San Andreas Fault in San Bernardino, southeasterly toward the Brawley area, where it continues south of the international border as the Imperial Transform Fault (Rockwell et al., 2014).

The San Jacinto Fault zone has a high level of historical seismic activity, with at least 10 damaging earthquakes (M6.0 to M7.0) having occurred on this fault zone between 1890 and 1986. Earthquakes on the San Jacinto Fault in 1899 and 1918 caused fatalities in the Riverside County area. Offset across this fault is predominantly right-lateral, similar to the San Andreas Fault, although some investigators have suggested that dip-slip motion contributes up to 10% of the net slip (Ross et al., 2017).

The segments of the San Jacinto Fault that are of most concern to major metropolitan areas are the San Bernardino, San Jacinto Valley and Anza segments. Fault slip rates on the various segments of the San Jacinto are less well constrained than for the San Andreas Fault, but the available data suggest slip rates of  $12 \pm 6$  mm/yr for the northern segments of the fault, and slip rates of  $4 \pm 2$  mm/yr for the southern segments. For large ground-rupturing earthquakes on the San Jacinto fault, various investigators have suggested a recurrence interval of 150 to 300 years. The Working



Group on California Earthquake Probabilities (2008) has estimated that there is a 31 percent probability that an earthquake of M6.7 or greater will occur within 30 years on this fault. Maximum credible earthquakes of M6.7, M6.9, and M7.2 are expected on the San Bernardino, San Jacinto Valley and Anza segments, respectively, capable of generating peak horizontal ground accelerations of 0.48g to 0.53g in the County of Riverside. A M5.4 earthquake occurred on the San Jacinto Fault on July 7, 2010.

The United States Geological Survey has issued the following statements with respect to the recent seismic activity on southern California faults:

The San Jacinto fault, along with the Elsinore, San Andreas, and other faults, is part of the plate boundary that accommodates about 2 inches/year of motion as the Pacific plate moves northwest relative to the North American plate. The largest recent earthquake on the San Jacinto fault, near this location, the M6.5 1968 Borrego Mountain earthquake April 8, 1968, occurred about 25 miles southeast of the July 7, 2010, M5.4 earthquake. This M5.4 earthquake follows the 4th of April 2010, Easter Sunday, M7.2 earthquake, located about 125 miles to the south, well south of the US Mexico international border. A M4.9 earthquake occurred in the same area on June 12th at 8:08 pm (Pacific Time). Thus, this section of the San Jacinto fault remains active.

Seismologists are watching two major earthquake faults in southern California. The San Jacinto fault, the most active earthquake fault in southern California, extends for more than 100 miles from the international border into San Bernardino and Riverside, a major metropolitan area often called the Inland Empire. The Elsinore fault is more than 110 miles long, and extends into the Orange County and Los Angeles area as the Whittier fault. The Elsinore fault is capable of a major earthquake that would significantly affect the large metropolitan areas of southern California. The Elsinore fault has not hosted a major earthquake in more than 100 years. The occurrence of these earthquakes along the San Jacinto fault and continued aftershocks demonstrates that the earthquake activity in the region remains at an elevated level. The San Jacinto fault is known as the most active earthquake fault in southern California. Caltech and USGS seismologist continue to monitor the ongoing earthquake activity using the



Caltech/USGS Southern California Seismic Network and a GPS network of more than 100 stations.

# B. Other Geologic Hazards

<u>Ground Rupture</u>: Ground rupture is characterized by bedrock slippage along an established fault and may result in displacement of the ground surface. For ground rupture to occur along a fault, an earthquake usually exceeds M5.0. If a M5.0 earthquake were to take place on a local fault, an estimated surface-rupture length 1 mile long could be expected (Greensfelder, 1974). Our investigation indicates that the subject site is not directly on a known active fault trace and, therefore, the risk of ground rupture is remote.

<u>Ground Shaking</u>: Structural damage caused by seismically induced ground shaking is a detrimental effect directly related to faulting and earthquake activity. Ground shaking is considered to be the greatest seismic hazard in San Diego County. The intensity of ground shaking is dependent upon the magnitude of the earthquake, the distance from the earthquake, and the seismic response characteristics of underlying soils and geologic units. Earthquakes of M5.0 or greater are generally associated with significant damage. It is our opinion that the most serious damage to the site would be caused by a large earthquake originating on a nearby strand of the Rose Canyon, Coronado Bank or Newport-Inglewood Faults. Although the chance of such an event is remote, it could occur within the useful life of the structures.

<u>Landslides</u>: Based upon our geotechnical investigation as well as information provided on the Geologic Maps by Kennedy (1975) and Kennedy and Tan (2008), it is our opinion that the site is not underlain by the ancient landslide complex that exists lower on the northern flank of Mount Soledad. Refer to Section VII of this report, Site-Specific Soil and Geologic Description, subsection B, Structure, under



"<u>General Observations of Geologic Structure in the Exploratory Trench,</u>" (Numbers 1-4 beginning on page 15), for our description and analysis regarding the encountered Cabrillo Formation structural features.

Further review of the geologic map (Kennedy and Tan, 2008) and review of the aerial photographs (4-11-53, AXN-8M-1 and 2) show no conclusive geomorphic evidence that the site is underlain by a recent or active landslide.

<u>Slope Stability</u>: Slope stability analysis has been performed along geologic cross section A-A'. Refer to Appendix D for slope stability calculations. We performed a static and pseudo-static analysis with a seismic coefficient of 0.15g. We also performed a saturated surficial stability analysis for an assumed soil saturation up to 3.28 feet (1 meter). Our analysis indicates the site is stable with a global and surficial factor of safety of 1.5 for static conditions, and 1.15 for seismic loading. Upon review of the final grading plan, slope stability analysis will be performed and additional recommendations provided, if warranted.

<u>Liquefaction</u>: The liquefaction of saturated sands during earthquakes can be a major cause of damage to buildings. Liquefaction is the process by which soils are transformed into a viscous fluid that will flow as a liquid when unconfined. It occurs primarily in loose, saturated sands and silts when they are sufficiently shaken by an earthquake. In the areas of the proposed habitable structures, the risk of liquefaction of formational materials due to seismic shaking is considered to be very low due to the dense nature of the underlying formational materials and lack of shallow static groundwater.



<u>Tsunamis and Seiches</u>: A tsunami is a series of long waves generated in the ocean by a sudden displacement of a large volume of water. Underwater earthquakes, landslides, volcanic eruptions, meteor impacts, or onshore slope failures can cause this displacement. Tsunami waves can travel at speeds averaging 450 to 600 miles per hour. As a tsunami nears the coastline, its speed diminishes, its wave length decreases, and its height increases greatly. After a major earthquake or other tsunami-inducing activity occurs, a tsunami could reach the shore within a few minutes. One coastal community may experience no damaging waves while another may experience very destructive waves. Some low-lying areas could experience severe inland inundation of water and deposition of debris more than 3,000 feet inland.

The site is located approximately 1 mile from the exposed coastline and at an elevation of approximately 695 to 794 feet above MSL. There is no risk of tsunami inundation at the site.

A seiche is a run-up of water within a lake or embayment triggered by fault- or landslide-induced ground displacement. There are no significant bodies of water located at higher elevation or in the general vicinity capable of producing a seiche and inundating the subject site.

#### C. <u>Geologic Hazards Summary</u>

No significant geologic hazards are known to exist on the site that would prohibit the construction of the proposed residence and associated improvements. Ground shaking from earthquakes on active Southern California faults and active faults in northwestern Mexico is the greatest geologic hazard at the property. Design of the new additions and associated improvements in accordance with the current building



codes would reduce the potential for injury or loss of human life. Structures constructed in accordance with current building codes may suffer significant damage but should not undergo total collapse.

It is our opinion, based upon a review of the available maps, our research and our site investigation, that the site is underlain at a depth of approximately 2 to 3 feet below existing ground surface by relatively stable formational materials and is suited for the proposed residence and associated improvements provided the recommendations herein are implemented. Furthermore, based on our current understanding of the proposed construction, it is our explicit opinion that the proposed site development would not destabilize neighboring properties or induce the settlement of adjacent structures or right-of-way improvements if designed and constructed in accordance with our recommendations.

In our explicit professional opinion, no active or potentially active faults or landslides underlie the site in the area of the proposed construction.

# IX. **GROUNDWATER**

Groundwater was not was encountered during our field investigation. We do not anticipate significant groundwater problems to develop in the future, *if the property* is developed as proposed and proper drainage is implemented and maintained.

It should be kept in mind that grading operations can change surface drainage patterns and/or reduce permeabilities due to the densification of compacted soils. Such changes of surface and subsurface hydrologic conditions, plus irrigation of landscaping or significant increases in rainfall, may result in the appearance of surface or near-surface water at locations where none existed previously. The



appearance of such water is expected to be localized and cosmetic in nature, if good positive drainage is implemented, as recommended in this report, during and at the completion of construction.

It must be understood that unless discovered during initial site exploration or encountered during site grading operations, it is extremely difficult to predict if or where perched or true groundwater conditions may appear in the future. When site formational soils are fine-grained and of low permeability, water problems may not become apparent for extended periods of time.

Water conditions, where suspected or encountered during grading operations, should be evaluated and remedied by the project civil and geotechnical consultants. The project developer and property owner, however, must realize that post-construction appearances of groundwater may have to be dealt with on a site-specific basis.

#### X. <u>CONCLUSIONS & RECOMMENDATIONS</u>

The following recommendations are based upon the practical field investigations conducted by our firm, and resulting laboratory tests, in conjunction with our knowledge and experience with similar soils in the La Jolla area. The opinions, conclusions, and recommendations presented in this report are contingent upon *Geotechnical Exploration, Inc.* being retained to review the final plans and specifications as they are developed and to observe the site earthwork and installation of foundations. Accordingly, we recommend that the following paragraph be included on the grading and foundation plans for the project.

The geotechnical consultant that has prepared documents in support of an approved permit is considered the geotechnical consultant of record. A change of geotechnical consultant of record must be processed if the



project's geotechnical consultant is changed after a permit has been issued and before the project is as-built and closed. The new geotechnical consultant must prepare a Transfer of Geotechnical Responsibility letter. If the new geotechnical consultant utilized the geotechnical investigation and test data prepared by the previous geotechnical consultants of record, the new geotechnical consultant must reference the geotechnical reports approved for the project and must state that they agree with the data, recommendations and conclusions contained in those reports. The new consultant must also state that the data, recommendations and conclusions are valid for the proposed construction. For grading permits, the specific drawing number must be included in the statement. Alternatively, the new geotechnical consultant has the option of conducting an independent geotechnical investigation. A change of geotechnical consultant of record after a grading permit has been issued will require a formal construction change to the grading plans.

We recommend that the planned residential development and external improvements, including flatwork, be founded on properly compacted structural fill soils or suitably dense formational soils, supported by conventional, individual-spread and/or continuous footings. Existing slopewash soils and trench backfill soils across the project area are not suitable in their current condition to support the loads from structures or additional fill soils. Furthermore, slopewash soils should not be used as structural fill material. Existing formational materials are suitable for use as recompacted fill soils are selectively removed during grading. Fill soils across the site will be required to be compacted to at least 90 percent relative compaction.

# A. <u>Site Preparation and Earthwork</u>

1. <u>Stripping:</u> The areas of proposed development should be stripped of existing vegetation within the areas of proposed new construction. This includes any roots from existing trees and shrubbery. Holes resulting from the removal of root systems or other buried obstructions that extend below the planned



grades should be cleared and backfilled with suitable compacted material compacted to the requirements provided under Recommendation Nos. 3, 4 and 5 below. Prior to any filling operations, the cleared and stripped vegetation and debris should be disposed of off-site.

2. Excavation: For the new development, any slopewash below the grade of the bearing surfaces of footings and slabs should be removed and selectively stockpiled or removed from the site. Existing fill soils used to backfill the exploratory trenches are also to be removed and recompacted. It should be anticipated that the depth of removal will be up to 8 feet in the areas of the exploratory trench, and approximately 2 to 3 feet in all other areas. Recompaction of these existing fill materials should be done in accordance with Recommendation Nos. 3, 4 and 5 below. Based on the observations of our exploratory trench, as well as our experience with similar materials in the project area, it is our opinion that the existing fill soils and slopewash should be excavated utilizing ordinary light to heavy weight earthmoving equipment. Contractors should not, however, be relieved of making their own independent evaluation of excavating the on-site materials prior to submitting their bids. Variability in excavating the subsurface materials should be expected across the project area.

The areal extent and final depth required to remove the existing fill and slopewash soils should be confirmed by our representatives during the excavation work based on their examination of the soils being exposed. Dense formational soils shall be exposed at the bottom of excavation before any fill soils are placed. The lateral extent of the excavation and recompaction should be at least 5 feet beyond the edge of any areas to receive exterior



improvements, where feasible, or to the depth of excavation or fill at that location, whichever is greater.

- 3. <u>Subgrade Preparation:</u> After the required excavations have been made in the areas of new improvements, the exposed subgrade soils in areas to receive new fill and/or slab-on-grade improvements should be scarified to 6 inches in depth, moisture conditioned, and compacted to the requirements for structural fill. Where planned cuts expose any highly expansive materials in the building areas, these soils should be scarified and moisture conditioned to at least 5 percent over optimum moisture and placed in landscape areas where the effects of soil expansion are inconsequential.
- 4. <u>Material for Fill:</u> Existing on-site low expansion potential (Expansion Index of 50 or less per ASTM D4829-19) soils with an organic content of less than 3 percent by volume are, in general, suitable for use as fill in general areas. Imported fill material, where required, should have a low expansion potential. In addition, both imported and existing on-site materials for use as fill should not contain rocks or lumps more than 6 inches in greatest dimension if the fill soils are compacted with heavy compaction equipment (or 3 inches in greatest dimension if compacted with lightweight equipment). All materials for use as fill should be approved by our representative prior to importing to the site. Oversize material and organics should be selectively removed from the fill material prior to compaction operations.
- 5. <u>Structural Fill Compaction:</u> All structural fill, and areas to receive any associated improvements, should be compacted to a minimum degree of compaction of 90 percent based upon ASTM D1557-12[2021]. Fill material should be spread and compacted in uniform horizontal lifts not exceeding 8



inches in uncompacted thickness. Before compaction begins, the fill should be brought to a water content that will permit proper compaction by either: (1) aerating and drying the fill if it is too wet, or (2) watering the fill if it is too dry. Each lift should be thoroughly mixed before compaction to ensure a uniform distribution of moisture. For low expansive soils, the moisture content should be within 2 percent of optimum. High expansive soils to be exposed during general grading operations should be moisture conditioned to at least 5 percent over optimum moisture content for highly expansive soils, and placed in landscape areas where the effects of soil expansion are inconsequential.

Any rigid improvements founded on the existing undocumented fill soils can be expected to undergo movement and possible damage. *Geotechnical Exploration, Inc.* takes no responsibility for the performance of any improvements built on loose natural soils or inadequately compacted fills. Subgrade soils in any exterior area receiving concrete improvements should be verified for compaction and moisture by a representative of our firm within 48 hours prior to concrete placement.

6. <u>Chloride and Soluble Sulfate Testing</u>: Large concentrations of chlorides will adversely affect any ferrous metals such as iron and steel. Soil with a chloride concentration greater than or equal to 500 ppm (0.05 percent) or more is considered corrosive to ferrous metals. The chloride content of the near surface soils should be tested at the completion of grading and before foundation excavations. Test results should be evaluated by an engineer specializing in soil corrosivity. The primary cause of deterioration of concrete in foundations and other below ground structures is the corrosive attack by soluble sulfates present in the soil and groundwater. The soluble sulfate content of the near surface soils should be tested at the completion of grading and before



foundation excavations. Test results should be evaluated by an engineer specializing in soil corrosivity. Cement type recommendations for concrete specifications should be provided by the structural engineer based on the soluble sulfate test results.

It is noted that *Geotechnical Exploration Inc.*, does not practice corrosion engineering and our assessment here should be construed as an aid to the owner or owner's representative. A corrosion specialist should be consulted for any specific design requirement.

7. Trench and Retaining Wall Backfill: All utility trenches and retaining walls should be backfilled with properly compacted fill. Backfill material should be placed in lift thicknesses appropriate to the type of compaction equipment utilized and compacted to a minimum degree of compaction of 90 percent by mechanical means. Our experience has shown that even shallow, narrow trenches, such as for irrigation and electrical lines, that are not properly compacted can result in problems, particularly with respect to shallow groundwater accumulation and migration. Soil compaction testing by nuclear method ASTM D6938-17a or sand cone method ASTM D1556-15e1 should be performed for every 2 feet of fill placement by a representative of **Geotechnical Exploration, Inc.** in conventional retaining wall and trench backfill areas as well in general fill or backfill areas.

Backfill soils placed behind retaining walls should be installed as early as the retaining walls are capable of supporting lateral loads. Backfill soils behind retaining walls should be low expansive (Expansion Index less than 50 per ASTM D4829-19).



- 8. Observations and Testing: As stated in CBC 2019, Section 1705.6 Soils: "Special inspections and tests of existing site soil conditions, fill placement and load-bearing requirements shall be performed in accordance with this section and Table 1705.6 (see below). The approved geotechnical report and the construction documents prepared by the registered design professionals shall be used to determine compliance. During fill placement, the special inspector shall verify that proper materials and procedures are used in accordance with the provisions of the approved geotechnical report." A summary of Table 1705.6 "REQUIRED SPECIAL INSPECTIONS AND TESTS OF SOILS" is presented below:
  - a) Verify materials below shallow foundations are adequate to achieve the design bearing capacity;
  - b) Verify excavations are extended to proper depth and have reached proper material;
  - c) Perform classification and testing of compacted fill materials;
  - d) Verify use of proper materials, densities and fill thicknesses during placement and compaction of compacted fill prior to placement of compacted fill, inspect subgrade and verify that site has been prepared properly.

Section 1705.6 "Soils" statement and Table 1705.6 indicates that it is mandatory that a representative of this firm (responsible engineering firm) perform observations and fill compaction testing during grading and backfilling operations to verify that the operations are consistent with the recommendations presented in this report. All grading excavations resulting from the removal of soils should be observed and evaluated by a representative of our firm before they are backfilled.



Quality control grading observation and field density testing for the purpose of documenting that adequate compaction has been achieved and acceptable soils have been utilized to properly support a project applies not only to fill soils supporting primary structures (unless supported by deep foundations or caissons) but all site improvements such as stairways, patios, pools and pool decking, retaining walls, etc. Observation and testing of utility line trench backfill also reduces the potential for localized settlement of all of the above including all improvements outside of the footprint of primary structures.

Often after primary building pad grading and swimming pool excavation, it is not uncommon for the geotechnical engineer of record to not be notified of grading performed outside the footprint of the project primary structures. As a result, settlement damage of site improvements such as patios, pool and pool decks, exterior landscape walls and walks, and structure access stairways can occur. It is therefore strongly recommended that the project general contractor, grading contractor, and others tasked with completing the project, be advised and acknowledge the importance of adequate and comprehensive observation and testing of soils intended to support the project they are working on. The project geotechnical engineer of record must be contacted and requested to provide these services.

The geotechnical engineer of record, in this case *Geotechnical Exploration*, *Inc.*, cannot be held responsible for the costs and time delays associated with the lack of contact and requests for testing services by the client, general contractor, grading contractor or any of the project design team responsible for requesting the required geotechnical services. Requests for services are to be made through our office telephone number (858) 549-7222 and the telephone number of the GEI personnel assigned to the project.



#### B. <u>Seismic Design Criteria</u>

- 9. <u>Seismic Data Bases:</u> The estimation of the peak ground acceleration and the repeatable high ground acceleration (RHGA) likely to occur at the site is based on the known significant local and regional faults within 100 miles of the site.
- 10. <u>Seismic Design Criteria:</u> The proposed structure should be designed in accordance with the 2019 CBC, which incorporates by reference the ASCE 7-16 for seismic design. We have determined the mapped spectral acceleration values for the site based on a latitude of 32.8397 degrees and a longitude of -117.2511 degrees, utilizing a program titled "Seismic Design Map Tool" and provided by the USGS through SEAOC, which provides a solution for ASCE 7-16 utilizing digitized files for the Spectral Acceleration maps.
- 11. <u>Structure and Foundation Design</u>: The design of the new structures and foundations should be based on Seismic Design Category D, Risk Category II.
- 12. <u>Spectral Acceleration and Design Values</u>: The structural seismic design, when applicable, should be based on the following values, which are based on the site location, soil characteristics, and seismic maps by USGS, as required by the 2019 CBC. A response Spectrum Acceleration (SA) vs. Period (T) for the site is also included in Appendix B. The Site Class C (Very Dense Soil and Soft Rock) values for this property are:

TABLE I

Mapped Spectral Acceleration Values and Design Parameters

| S₅     | $S_1$  | $F_a$ | $F_v$ | S <sub>ms</sub> | S <sub>m1</sub> | $S_{ds}$ | S <sub>d1</sub> |
|--------|--------|-------|-------|-----------------|-----------------|----------|-----------------|
| 1.416g | 0.494g | 1.2   | 1.5   | 1.699g          | 0.742g          | 1.133g   | 0.494g          |



#### C. Foundation Recommendations

improvements be supported on adequately bearing formational materials or properly recompacted structural fill soils prepared in accordance with Recommendation Nos. 2, 3, 4 and 5. No footings should be underlain by undocumented fill or loose soils. All footings for two- to three-story structures should be founded at least 24 inches below lowest adjacent soil finished grade. All footings should be reinforced with at least four No. 5 bars or more as specified by the structural designer. A minimum clearance of 3 inches should be maintained between steel reinforcement and the bottom or sides of the footing.

The bearing surfaces of footings located adjacent to utility trenches should be situated below an imaginary 1.0:1.0 plane projected upward from the bottom edge of the adjacent utility trench. Otherwise, the utility trenches should be excavated farther from the footing locations. Footings located adjacent to the tops of slopes should be extended sufficiently deep in order to provide at least 7 feet of horizontal cover between the slope face and outside edge of the footing at the footing bearing level.

In order for us to offer an opinion as to whether the footings are founded on soils of sufficient load bearing capacity and with the necessary 7 feet of horizontal cover to the slope face, it is essential that our representative inspect the footing excavations prior to the placement of reinforcing steel or forms.



NOTE: The project Civil/Structural Engineer should review all reinforcing schedules. The reinforcing minimums recommended herein are not to be construed as structural designs, but merely as minimum reinforcement to reduce the potential for cracking and separations.

- 14. <u>Bearing Values</u>: At the recommended depths, footings on formational or properly recompacted fill soils may be designed for allowable bearing pressures of 2,500 pounds per square foot (psf) for combined dead and live loads and 3,325 psf for all loads, including wind or seismic. The footings should, however, have a minimum depth of 18 inches and 12 inches wide. An increase in soil allowable static bearing can be used as follows: 900 psf for each additional foot over 1½ feet in depth, and 500 psf for each additional foot in width over 1 foot, to a total allowable static bearing pressure not exceeding 4,500 psf. The static soil bearing value may be increased one-third for seismic and wind load analysis
- 15. <u>Lateral Loads:</u> Lateral load resistance for the structure supported on footing foundations may be developed in friction between the foundation bottoms and the supporting subgrade. An allowable friction coefficient of 0.35 is considered applicable. An additional allowable passive resistance equal to an equivalent fluid weight of 270 pounds per cubic foot (pcf) acting against the foundations may be used in design provided the footings are poured neat against the dense formational or properly compacted fill materials. These lateral resistance values assume a level surface in front of the footing for a minimum distance of three times the embedment depth of the footing and any shear keys, but not less than 7 feet from a descending slope face, measured from effective top of foundation. New retaining walls supporting surcharge loads or affected by upper foundations should consider the effect of those upper loads.



16. <u>Settlement:</u> Settlement under structural design loads is expected to be within tolerable limits for the proposed structures. For footings designed in accordance with the recommendations presented in the preceding paragraphs, we anticipate that total settlements should not exceed 1 inch and that post-construction differential settlement angular rotation should be less than 1/240.

#### D. <u>Concrete Slab On-Grade Criteria</u>

Slabs on-grade may only be used on new, properly compacted fill or when founded on adequately bearing formational soils.

17. <u>Minimum Floor Slab Thickness and Reinforcement:</u> Based on our experience, we have found that, for various reasons, floor slabs occasionally crack. Therefore, we recommend that all slabs on-grade contain at least a minimum amount of reinforcing steel to reduce the separation of cracks, should they occur. Slab subgrade soil should be verified by a **Geotechnical Exploration**, **Inc**. representative to have the proper moisture content within 48 hours prior to placement of the vapor barrier and pouring of concrete.

Soil moisture content should be kept above the optimum prior to waterproofing or vapor barrier placement under the new concrete slab. For interior areas in the new building, we recommend a 5-inch-thick slab reinforced with No. 4 steel bars spaced 18 inches apart. Interior slabs on grade shall be provided with control joints specified by the structural engineer.

We note that shrinkage cracking can result in reflective cracking in brittle flooring surfaces such as stone and tiles. It is imperative that if movement intolerant flooring materials are to be utilized, the flooring contractor and/or



architect should provide specifications for the use of high-quality isolation membrane products installed between slab and floor materials.

18. <u>Slab Moisture Emission:</u> Although it is not the responsibility of geotechnical engineering firms to provide moisture protection recommendations, as a service to our clients we provide the following discussion and suggested minimum protection criteria. Actual recommendations should be provided by the project architect and waterproofing consultants or product manufacturer. It is recommended to contact the vapor barrier manufacturer to schedule a pre-construction meeting and to coordinate a review, in-person or digital, of the vapor barrier installation.

Soil moisture vapor can result in damage to moisture-sensitive floors, some floor sealers, or sensitive equipment in direct contact with the floor, in addition to mold and staining on slabs, walls and carpets. The common practice in Southern California is to place vapor retarders made of PVC, or of polyethylene. PVC retarders are made in thickness ranging from 10- to 60-mil. Polyethylene retarders, called visqueen, range from 5- to 10-mil in thickness. These products are no longer considered adequate for moisture protection and can actually deteriorate over time.

Specialty vapor retarding and barrier products possess higher tensile strength and are more specifically designed for and intended to retard moisture transmission into and through concrete slabs. The use of such products is highly recommended for reduction of floor slab moisture emission.

The following American Society for Testing and Materials (ASTM) and American Concrete Institute (ACI) sections address the issue of moisture transmission into and through concrete slabs: ASTM E1745-17 Standard Specification for



Plastic Water Vapor Retarders Used in Contact Concrete Slabs; ASTM E1643-18a Standard Practice for Selection, Design, Installation, and Inspection of Water Vapor Retarders Used in Contact with Earth or Granular Fill Under Concrete Slabs; ACI 302.2R-06 Guide for Concrete Slabs that Receive Moisture-Sensitive Flooring Materials; and ACI 302.1R-15 Guide to Concrete Floor and Slab Construction.

- 18.1 Based on the above, we recommend that the vapor barrier consist of a minimum 15-mil extruded polyolefin plastic (no recycled content or woven materials permitted). Permeance as tested before and after mandatory conditioning (ASTM E1745 Section 7.1 and subparagraphs 7.1.1-7.1.5) should be less than 0.01 perms (grains/square foot/hour/per inch of Mercury) and comply with the ASTM E1745-17 Class A requirements. Installation of vapor barriers should be in accordance with ASTM E1643-18a. The basis of design is 15-mil Stego Wrap vapor barrier placed per the manufacturer's guidelines. Reef Industries Vapor Guard membrane has also been shown to achieve a permeance of less than 0.01 perms. We recommend that the slab be poured directly on the vapor barrier, which is to be placed directly on 4 inches of Class II base layer or 3/8-inch maximum diameter crushed rock gravel on the prepared properly compacted smooth subgrade soil surface.
- 18.2 Common to all acceptable products, vapor retarder/barrier joints must be lapped at least 6 inches. Seam joints and permanent utility penetrations should be sealed with the manufacturer's recommended tape or mastic. Edges of the vapor retarder should be extended to terminate at a location in accordance with ASTM E1643-18a or to an alternate location that is acceptable to the project's structural engineer.



All terminated edges of the vapor retarder should be sealed to the building foundation (grade beam, wall, or slab) using the manufacturer's recommended accessory for sealing the vapor retarder to pre-existing or freshly placed concrete. Additionally, in actual practice, stakes are often driven through the retarder material, equipment is dragged or rolled across the retarder, overlapping or jointing is not properly implemented, etc. All these construction deficiencies reduce the retarder's effectiveness. In no case should retarder/barrier products be punctured or gaps be allowed to form prior to or during concrete placement. Vapor barrier-safe screeding and forming systems should be used that will not leave puncture holes in the vapor barrier, such as Beast Foot (by Stego Industries) or equivalent.

- 18.3 Vapor retarders/barriers do not provide full waterproofing for structures constructed below free water surfaces. They are intended to help reduce or prevent vapor transmission and/or capillary migration through the soil and through the concrete slabs. Waterproofing systems must be designed and properly constructed if full waterproofing is desired. The owner and project designers should be consulted to determine the specific level of protection required.
- 18.4 Following placement of any concrete floor slabs, sufficient drying time must be allowed prior to placement of floor coverings. Premature placement of floor coverings may result in degradation of adhesive materials and loosening of the finish floor materials.



19. <u>Exterior Slab Thickness and Reinforcement:</u> Exterior slab reinforcement and control joints should be designed by the project Structural Engineer. As a minimum for protection of on-site improvements, we recommend that all exterior pedestrian concrete slabs be at least 4 inches thick, reinforced with No. 3 bars at 15-inch centers, both ways at the center of the slab, and contain adequate isolation and control joints and be sealed with elastomeric joint sealant.

The performance of on-site improvements can be greatly affected by soil base preparation and the quality of construction. It is therefore important that all improvements are properly designed and constructed for the existing soil conditions. The improvements should not be built on loose soils or fills placed without our observation and testing. Slabs on-grade may only be used on dense formational soils or properly compacted fill soils.

#### E. Retaining Wall Design Criteria

20. <u>Design Parameters – Unrestrained:</u> The active earth pressure to be utilized in the design of any cantilever site retaining walls, utilizing low-expansion potential [EI less than 50] imported soils as backfill should be based on an Equivalent Fluid Weight of 38 pcf (for level backfill only). For 2.0:1.0 sloping backfill, the cantilever retaining walls should be designed with an equivalent fluid pressure of 52 pcf. Unrestrained retaining walls should be backfilled with imported or on-site very low to low expansion potential soils. Restrained building retaining walls should be designed for 56 pcf for level imported low expansion potential soil backfill, and use a conversion load factor of 0.47 for vertical surcharge loads to be converted to uniform lateral surcharge loads. Temporary cantilever shoring walls supporting on-site low expansive



formational soils can use an active pressure of 40 pcf and a conversion factor of 0.35 to convert vertical uniform surcharge to horizontal uniform pressure. For passive resistance, use the value of 685 pcf times the diameter of the soldier pile, times the depth of embedment below the grade excavation in front of the piles. To reduce the expansion potential of on-site soils, the low expansive backfill soils should extend behind the walls at least a distance equal to the height of the wall. The upper 1 foot of backfill may consist of properly compacted on-site soils, and should be provided with proper surface drainage.

21. <u>Design Parameters – Restrained:</u> Permanent site restrained building retaining walls supporting low expansion potential level backfill may utilize a triangular pressure increasing at a rate of 56 pcf for wall design (78 pcf for sloping 2.0:1.0 backfill). Restrained shoring walls supporting on site high expansion potential soils, should be designed for 71 pcf soil pressure and a vertical to lateral load conversion factor of 0.60. The soil pressure produced by any footings, improvements, or any other surcharge placed within a horizontal distance equal to the height of the retaining portion of the wall should be included in the wall design pressure. A conversion factor of 0.56 pcf may be used to convert vertical uniform surcharge loads to lateral uniform pressure behind a restrained retaining wall with imported low expansion potential level backfill and 0.76 when supporting a 2 to 1 sloping backfill.

The recommended lateral soil pressures are based on the assumption that no loose soils or unstable soil wedges will be retained by the retaining wall. Backfill soils should consist of low expansion potential soils with EI less than 50, and should be placed from the heel of the foundation to the ground surface within a distance equal to the equal height, and passing by the heel of the foundation and the back face of the retaining wall. When imported low



expansion potential backfill soils cannot be placed due to property line proximity, the retaining walls should be designed for the expansive soil pressures recommended above.

- 22. <u>Retaining Wall Seismic Design Pressures:</u> For seismic design of unrestrained walls over 6 feet in exposed height, we recommend that the seismic pressure increment be taken as a fluid pressure distribution utilizing an equivalent fluid weight of 20 pcf. This seismic increment is waived for restrained walls. If the walls are designed as unrestrained walls, then the seismic load should be added to the static soil pressure.
- 23. Retaining Wall Drainage: The preceding design pressures assume that the walls are backfilled with low expansion potential materials (Expansion Index less than 50) and that there is sufficient drainage behind the walls to prevent the build-up of hydrostatic pressures from surface water infiltration. We recommend that as a minimum drainage be provided by a composite drainage material such as J-Drain 200/220 and J-Drain SWD, or equivalent. No perforated pipes or gravel are utilized with the J-Drain system. The drain board material should terminate 12 inches below the exterior finish surface where the surface is covered by slabs or 18 inches below the finish surface in landscape areas. Actual waterproofing recommendations to prevent water access to below grade spaces must be provided by the retaining wall/waterproofing contractor or project architect.

**Geotechnical Exploration, Inc.** will assume no liability for damage to structures or improvements that is attributable to poor drainage. In order to improve the potential of maintaining below grade spaces in a dry condition, we recommend that consideration be given to placing lower-level wall subdrains



at least 1 foot  $\emph{below}$  the bottom of the lower-level slabs (refer to Figure No. VI).

- 24. <u>Drainage Quality Control</u>: It must be understood that it is not within the scope of our services to provide quality control oversight for surface or subsurface drainage construction or retaining wall sealing and base of wall drain construction. It is the responsibility of the contractor to verify proper wall sealing, geofabric installation, protection board (if needed), drain depth below interior floor or yard surface, pipe percent slope to the outlet, etc.
- 25. <u>Retaining Wall Backfill:</u> Backfill placed behind retaining walls should be compacted to a minimum degree of compaction of 90 percent using light compaction equipment. If heavy equipment is used, the walls should be appropriately temporarily braced. Crushed rock gravel may only be used as backfill in areas where access is too narrow to place compacted soils. Sand slurry backfill may be used behind the lagging of the shoring walls. Medium to high expansion potential on-site soils should not be used as retaining wall backfill material.

#### F. Swimming Pool Recommendations

26. <u>Excavation and Foundations:</u> We recommend that the proposed pool bear on the underlying undisturbed formational materials. Plans should be furnished to us indicating the location and dimensions of the pool for our review prior to construction.



- 27. <u>Pool Shell Loads:</u> The pool should be designed using a static earth pressure of 75 pcf for the highly expansive soil condition and a seismic pressure increment of 20 pcf if the pool depth is 6 feet or deeper. If the pool is to be raised above the adjacent grade or located within 10 feet of the existing descending slope face, free standing walls must be incorporated into the design. Free standing walls should be designed to resist a water pressure of 62.4 pcf. No cut/fill transition line should underlie the pool. A maximum 5 feet of fill differential thickness should be used beneath the pool shell to help reduce potential differential soil settlement. Additional recommendations may be provided as warranted after pool plans are reviewed by our firm before construction starts.
- 28. <u>Deck Subgrade, Slab and Drainage:</u> Any existing loose fill soils supporting a planned pool deck should be properly moisture-conditioned and compacted prior to steel and concrete placement per the requirements of Recommendations 2, 3, 4 and 5.

Proper drainage with area drains should be provided in the pool deck area. The pool deck slab should be at least 5 inches thick and be reinforced with at least No. 3 bars every 18 inches apart unless designed as a structural slab (which might require still more reinforcing) with supports properly spaced to span the design distances. Adequately spaced control joints should be placed by the contractor and sealed with elastomeric joint sealant. Joint spacing should not exceed 12 feet apart. Joints should also be placed at re-entrant corners. The control joints should be placed within 12 hours after concrete placement and penetrate at least one-quarter the thickness of the slab. All joints should be sealed with elastomeric joint sealant. Drainage around the pool deck should be positive to drain away from the deck's perimeter and the



slope face into area drains. Proper soil moisture content should be confirmed within 48 hours prior to concrete placement.

#### G. <u>Driveway Recommendations</u>

- 29. <u>Pervious Pavers</u>: We recommend that if pervious pavers are desired for the driveway, subject to automobile and fire truck traffic, the driveway should be underlain by 1 inch of bedding sand No. 8 on 12 inches of crushed rock miscellaneous base. The upper 12 inches of the subgrade soils should be compacted to a minimum degree of compaction of 90 percent and the base layer to at least 95 percent relative compaction. A collector perforated pipe should be placed in the lower areas of subgrade and outlet in an appropriate low point. For driveways with sloping surface concrete, curbs may be needed to help reduce potential for lateral movement of the paver blocks.
- 30. <u>PCC Pavement</u>: We recommend that if Portland Cement Concrete is desired for the driveway specially if the pavement slope exceeds 5 percent, the driveway should have a thickness of 6 inches and the concrete should be underlain by 12 inches of crushed miscellaneous base. The upper 12 inches of the subgrade soils as well as the base layer should be compacted to a minimum degree of compaction of 90 percent. The concrete should conform to Section 201 of The Standard Specifications for Public Works Construction, 2019 Edition, for Class 560-C-3250 and be reinforced with No. 4 bars on 18-inch centers, both ways, placed at midheight in the slab. Control and isolation joints should be provided with elastomeric joint sealant.



#### H. Slopes

- 31. <u>Permanent Slopes</u>: Any new cut or fill slopes should be constructed at an inclination no steeper than 2.0:1.0 (horizontal to vertical). Proper vegetation placed on slope surfaces will help prevent or reduce soil erosion. Irrigation of vegetation should be kept to the minimum for plant survival.
- 32. <u>Temporary Slopes</u>: Based on our subsurface investigation work, laboratory test results, and engineering analysis, temporary slopes should be stable for a maximum slope height of up to 10 feet at a slope ratio of 1.5:1.0 in the existing fill soils, and at 0.75:1.0 in dense formational soils. Our representative, however, should observe temporary slope excavations, and if variability in the subsurface materials is observed, additional temporary slope recommendations will be presented at that time. Localized sloughing or raveling of soils exposed on the slopes should be anticipated.

Since the stability of temporary construction slopes will depend largely on the contractor's activities and safety precautions (storage and equipment loadings near the tops of cut slopes, surface drainage provisions, etc.), it should be the contractor's responsibility to establish and maintain all temporary construction slopes at a safe inclination appropriate to the method of operation. No soil stockpiles or surcharge may be placed or exist within a horizontal distance of 10 feet from the top of the excavation.

33. <u>Slope Top/Face Performance:</u> The soils that occur in close proximity to the top or face of even properly compacted fill or dense natural ground cut slopes often possess poor lateral stability. The degree of lateral and vertical deformation depends on the inherent expansion and strength characteristics of the soil



types comprising the slope, slope steepness and height, loosening of slope face soils by burrowing rodents, and irrigation and vegetation maintenance practices, as well as the quality of compaction of fill soils. Structures and other improvements could suffer damage due to these soil movement factors if not properly designed to accommodate or withstand such movement. New fill or cut slopes should be constructed at a 2.0:1.0 slope gradient. Any existing steeper slopes that will remain should be analyzed for stability.

34. <u>Slope Top Structure Performance:</u> Rigid improvements such as top-of-slope walls, columns, decorative planters, concrete flatwork and other similar types of improvements can be expected to display varying degrees of separation typical of improvements constructed at the top of a slope. The separations result primarily from slope top lateral and vertical soil deformation processes. These separations often occur regardless of being underlain by cut or fill slope material. Proximity to a slope top is often the primary factor affecting the degree of separations occurring.

## I. <u>Site Drainage Considerations</u>

35. <u>Surface Drainage:</u> Adequate measures should be taken to properly finish-grade the site after the new improvements are in place. Drainage waters from this site and adjacent properties should be directed away from the footings, slabs, and slopes, onto the natural drainage direction for this area or into properly designed and approved drainage facilities provided by the project civil engineer. Proper subsurface and surface drainage will help reduce the potential for waters to seek the level of the bearing soils under the wall footings or other extensive improvements.



Failure to observe this recommendation could result in undermining, soil expansion, and possible differential settlement of the retaining wall or other improvements or cause other moisture-related problems. Currently, the 2019 CBC requires a minimum of 1 percent surface gradient for proper drainage of building pads unless waived by the building official. Concrete pavement may have a minimum gradient of 0.5-percent. The surface gradient adjacent to structures must drain away as indicated in the 2019 CBC at least 5 percent within 5 feet from the perimeter.

Due to the possible build-up of groundwater (derived primarily from rainfall and irrigation), excess moisture is a common problem behind retaining walls that may be planned. These problems are generally in the form of water seepage through walls and mineral staining. In order to minimize the potential for moisture-related problems to develop, the backfill side of all retaining walls must be adequately waterproofed and drained.

- 36. <u>Erosion Control</u>: Appropriate erosion control measures should be taken at all times during and after construction to prevent surface runoff waters from entering footing excavations or ponding on finished building pad areas.
- 37. <u>Planter Drainage:</u> Planter areas and planter boxes should be sloped to drain away from the foundations. Planter boxes should be constructed with a closed bottom and a subsurface drain, installed in gravel, with the direction of subsurface and surface flow away from the footings to an adequate drainage facility.



38. <u>Drainage Quality Control</u>: It must be understood that it is not within the scope of our services to provide quality control oversight for surface or subsurface drainage construction or retaining wall sealing and base of wall drain construction. It is the responsibility of the contractor to verify proper wall sealing, geofabric installation, protection board (if needed), drain depth below interior floor or yard surface, pipe percent slope to the outlet, etc.

#### J. <u>General Recommendations</u>

- 39. <u>Cal-OSHA</u>: Where not superseded by specific recommendations presented in this report, trenches, excavations, and temporary slopes at the subject site should be constructed in accordance with Title 8, Construction Safety Orders, issued by Cal-OSHA.
- 40. <u>Project Start Up Notification:</u> In order to reduce any work delays during site excavation and development, our firm should be contacted at least 48 hours before any required observation of footing excavations or field density testing of compacted fill soils. If possible, placement of formwork and steel reinforcement in footing excavations should not occur prior to our observations of the excavations. If our observations reveal the need for deepening or redesigning foundation structures at any locations, any formwork or steel reinforcement in the affected footing excavation areas would have to be removed before the correction of the observed problem (i.e., deepening the footing excavation, compacting or removal of loose soil in the bottom of the excavation, etc.).



41. <u>Construction Best Management Practices (BMPs):</u> Sufficient BMPs must be installed to prevent silt, mud, or other construction debris from being tracked into the adjacent street(s) or stormwater conveyance systems due to construction vehicles or any other construction activity. The contractor is responsible for cleaning any such debris that may be in the street at the end of each work day or after a storm event that causes a breach in the installed construction BMPs.

All stockpiles of uncompacted soil and/or building materials that are left unprotected for a period greater than 7 days are to be provided with erosion and sediment controls. Such soil must be protected each day when the probability of rain is 40% or higher. A concrete washout should be provided on all projects that propose the construction of any concrete improvements that are to be poured in place. All erosion/sediment control devices should be maintained and in working order at all times. All slopes that are created or disturbed by construction activity must be protected against erosion and sediment transport at all times. The storage of all construction materials and equipment must be protected against any potential release of pollutants into the environment.

#### XI. GRADING NOTES

**Geotechnical Exploration, Inc.** recommends that we be retained to verify the actual soil conditions revealed during site grading work and footing excavation to be as anticipated in this "Report of Preliminary Geotechnical and Geologic Fault Investigation" for the project. In addition, the compaction of any fill soils placed during site grading work must be observed and tested by the soil engineer. It is the responsibility of the general contractor to comply with the requirements on the



approved plans and the local building ordinances. All/any retaining wall and trench backfill should be properly compacted. *Geotechnical Exploration, Inc.* will assume no liability for damage occurring due to improperly compacted or uncompacted backfill placed without our observations and testing.

#### XII. LIMITATIONS

Our conclusions and recommendations have been based on available data obtained from our field investigation, background review and laboratory analysis, as well as our experience with similar soils and natural ground materials located in the County of San Diego. Of necessity, we must assume a certain degree of continuity between exploratory excavations and/or natural exposures. It is, therefore, necessary that all observations, conclusions, and recommendations be verified at the time excavation begins. In the event discrepancies are noted, additional recommendations may be issued, if required.

The work performed and recommendations presented herein are the result of an investigation and analysis that meet the contemporary standard of care in our profession within the County of San Diego. No warranty is provided.

This report should be considered valid for a period of two (2) years, and is subject to review by our firm following that time. If significant modifications are made to the wall plans, especially with respect to the height and location of the proposed wall structure, this report must be presented to us for immediate review and possible revision.



As stated previously, it is not within the scope of our services to provide quality control oversight for surface or subsurface drainage construction or retaining wall sealing and base of wall drain construction. It is the responsibility of the contractor to verify proper wall sealing, geofabric installation, protection board installation (if needed), drain depth below interior floor or yard surfaces, pipe percent slope to the outlet, etc.

It is the responsibility of the owner and/or developer to ensure that the recommendations summarized in this report are carried out in the field operations and that our recommendations for design of this project are incorporated in the project plans. We should be retained to review the final project plans once they are available, to verify that our recommendations are adequately incorporated in the plans. Additional or revised recommendations may be necessary after our review.

This firm does not practice or consult in the field of safety engineering. We do not direct the contractor's operations, and we cannot be responsible for the safety of personnel other than our own. The safety of others is the responsibility of the contractor. The contractor should notify the owner if any of the recommended actions presented herein are considered to be unsafe.

The firm of *Geotechnical Exploration, Inc.* shall not be held responsible for changes to the physical condition of the property, such as addition of fill soils or changing drainage patterns, which occur subsequent to issuance of this report and the changes are made without our observations, testing, and approval.



Once again, should any questions arise concerning this report, please feel free to contact the undersigned. Reference to our **Job No. 21-13556** will expedite a reply to your inquiries.

Respectfully submitted,

### GEOTECHNICAL EXPLORATION, INC.

Jaime A. Cerros, P.E.

R.C.E. 34422/G.E. 2007

Senior Gotechnical Engineer

Jay K. Heiser

Senior Project Geologist

Leslie D. Reed, President C.E.G. 999/P.G. 3391







#### REFERENCES

JOB NO. 21-13556 July 2022

2007 Working Group on California Earthquake Probabilities, 2008, The Uniform California Earthquake Rupture Forecast, Version 2 (UCERF 2), U.S Geological Survey Open-file Report 2007-1437 and California Geological Survey Special Report 203.

Berger, V. and Schug, D.L., 1991, Probabilistic Evaluation of Seismic Hazard in the San Diego-Tijuana Metropolitan Region, Environmental Perils, San Diego Region, Geological Society of America by the San Diego Association of Geologists, p. 89-99.

California Emergency Management Agency, California Geologic Survey, University of California, State of California – County of San Diego Tsunami Inundation Map for Emergency Planning, La Jolla Quadrangle, June 1,2009.

California Geological Survey, Revised 2018, Earthquake Fault Zones, A guide for Government Agencies, Property Owners/Developers, And Geoscience Practitioners for Assessing Fault Rupture Hazards in California, Special Publication 42.

California Geological Survey, 2021, Earthquake Zones of Required Investigation, Point Loma 7.5-minute Quadrangle, Scale 1:24,000, https://maps.conservation.ca.gov/cgs/informationwarehouse/, accessed July 22, 2022.

City of San Diego, 2008, Seismic Safety Study, Geologic Hazards and Faults, Development Services Department, Grid Tile No. 20.

Crowell, J.C., 1962, Displacement Along the San Andreas, Fault, California, Geological Society of America, Special Papers, no. 71.

Demere, T.A. 1997, Geology of San Diego County, California, San Diego Natural History Museum, http://archive.sdnhm.org/research/paleontology/sdgeol.html, accessed July 30, 2020.

Earthquake Engineering Research Institute (EERI), 2021, San Diego Planning Scenario, Magnitude 6.9 on the Rose Canyon Fault.

Grant Ludwig, L.B. and Shearer, P.M., 2004, Activity of the Offshore Newport-Inglewood Rose Canyon Fault Zone, Coastal Southern California, from Relocated Microseismicity, Bulletin of the Seismological Society of America, 94(2), 747-752.

Greene, H.G., Bailey, K.A., Clarke, S.H., Ziony, J.I. and Kennedy, M.P., 1979, Implications of fault patterns of the inner California continental borderland between San Pedro and San Diego, *in* Abbott, P.L., and Elliot, W.J., eds., Earthquakes and other perils, San Diego region: San Diego Association of Geologists, Geological Society of America field trip, p. 21–28.

Greensfelder, R.W., 1974, Maximum Credible Rock Accelerations from Earthquakes in California, California Division of Mines and Geology.

Hart, E.W. and Bryant, W.A., 1997, Fault-Rupture Hazard Zones in California, California Division of Mines and Geology, Special Publication 42.

Hart, E.W., Smith, D.P. and Saul, R.B., 1979, Summary Report: Fault Evaluation Program, 1978 Area (Peninsular Ranges-Salton Trough Region), California Division of Mines and Geology, Open-file Report 79-10 SF, 10.



#### REFERENCES/Page 2

Hauksson, E. and Jones, L.M., 1988, The July 1986 Oceanside ( $M_L$ =5.3) Earthquake Sequence in the Continental Borderland, Southern California Bulletin of the Seismological Society of America, v. 78, p. 1885-1906.

Hileman, J.A., Allen, C.R. and Nordquist, J.M., 1973, Seismicity of the Southern California Region, January 1, 1932 to December 31, 1972; Seismological Laboratory, Cal-Tech, Pasadena, California.

Jennings, C.W., and Bryant, W.A., 2010, Fault Activity Map of California, California Geological Survey Geologic Data Map No. 6

Kennedy, M.P. and Tan, S.S., 2008, Geologic Map of San Diego 30'x60' Quadrangle, California, California Geological Survey, Department of Conservation.

Legg, M., and Agnew, D., 1979, The 1862 Earthquake in San Diego, in Earthquakes and Other Perils: San Diego Region (Abbott, P.L., Elliott, W.J., eds.), San Diego Association of Geologists, San Diego, CA 139-141.

Reed, L.D., 2009, Preliminary Evidence of a Mount Soledad Western Flank Mega-slide, La Jolla California, AEG, Lake Tahoe, California.

Richter, C.F., 1958, Elementary Seismology, W.H. Freeman and Company, San Francisco, California.

Rockwell, T.K., 2010, The Rose Canyon Fault Zone in San Diego, Proceedings of the Fifth International Conference on Recent Advances in Geotechnical Earthquake Engineering and Soil Dynamics. Paper No. 7.06C.

Rockwell, T.K., Dawson, T.E., Young Ben-Horin, J. and Seitz, G., 2014, A 21-Event, 4,000-Year History of Surface Ruptures in the Anza Seismic Gap, San Jacinto Fault, and Implications for Long-term Earthquake Production on a Major Plate Boundary Fault, Pure and Applied Geophysics, v. 172, 1143–1165 (2015).

Rockwell, T.K., Millman, D.E., McElwain, R.S. and Lamar, D.L., 1985, Study of Seismic Activity by Trenching Along the Glen Ivy North Fault, Elsinore Fault Zone, Southern California: Lamar-Merifield Technical Report 85-1, USGS Contract 14-08-0001-21376, 19 p.

Ross, Z.E., Hauksson E. and Ben-Zion Y., 2017, Abundant Off-fault Seismicity and Orthogonal Structures in the San Jacinto Fault Zone, Science Advances, 2017; 3(3): e1601946. Published 2017 Mar 15.

Singleton, D.M., Rockwell, T.K., Murbach, D., Murbach, M., Maloney, J., Freeman, T., Levy, Y., 2019, Late-Holocene Rupture History of the Rose Canyon Fault in Old Town, San Diego: Implications of Cascading Earthquakes on the Newport-Inglewood-Rose Canyon Fault System, Bulletin of the Seismological Society of America 109, 855-874.

Southern California Earthquake Data Center (SCEDC), 2022, Earthquake Information, Fault Name Index, Division of Geological and Planetary Sciences, California Institute of Technology.


Toppozada, T.R. and Parke, D.L., 1982, Areas Damaged by California Earthquakes, 1900-1949, California Division of Mines and Geology, Open-file Report 82-17.

U.S. Dept. of Agriculture, 04-11-1953, Aerial Photographs AXN-8M-1 and 2.

U.S. Geological Survey and California Geological Survey, Quaternary fault and fold database for the United States, accessed January 28, 2022, at <a href="https://www.usgs.gov/natural-hazards/earthquake-hazards/faults">https://www.usgs.gov/natural-hazards/earthquake-hazards/faults</a>.




# **VICINITY MAP**

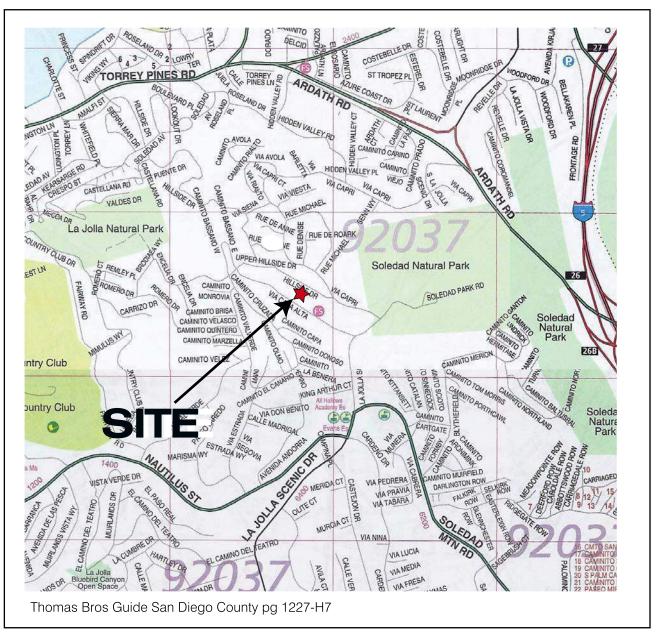


Javaheri Residence 2072 Via Casa Alta La Jolla, CA.

> Figure No. I Job No. 21-13556



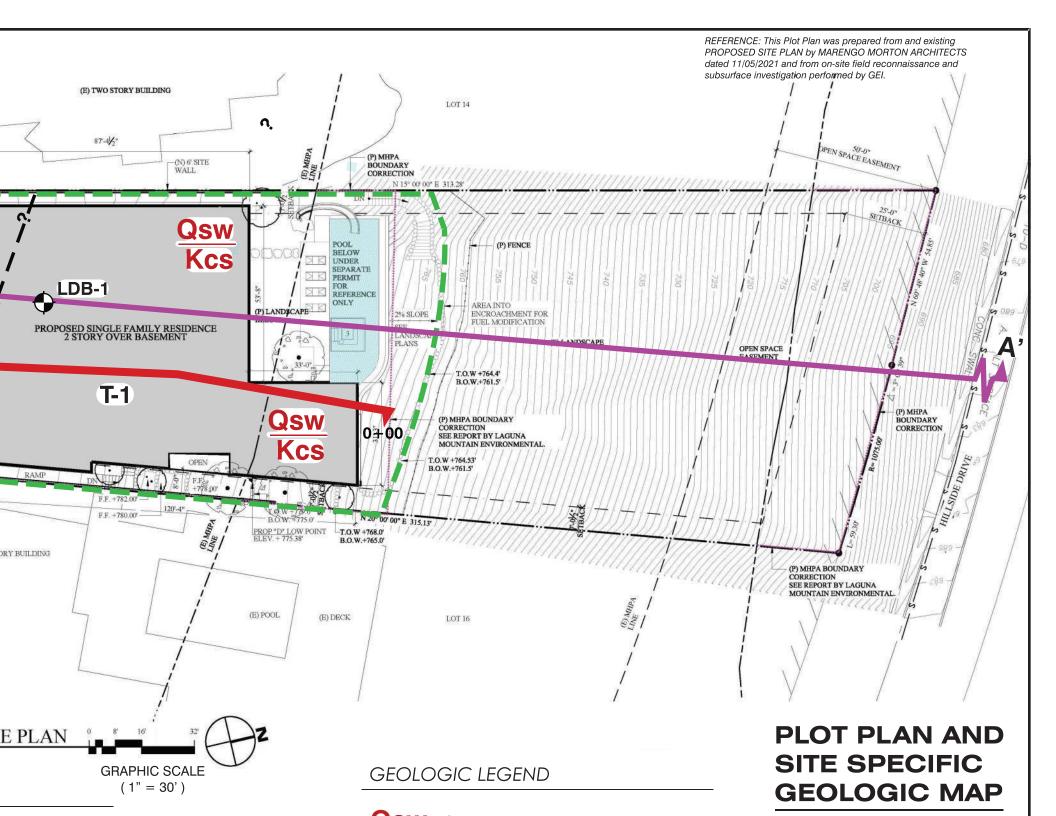

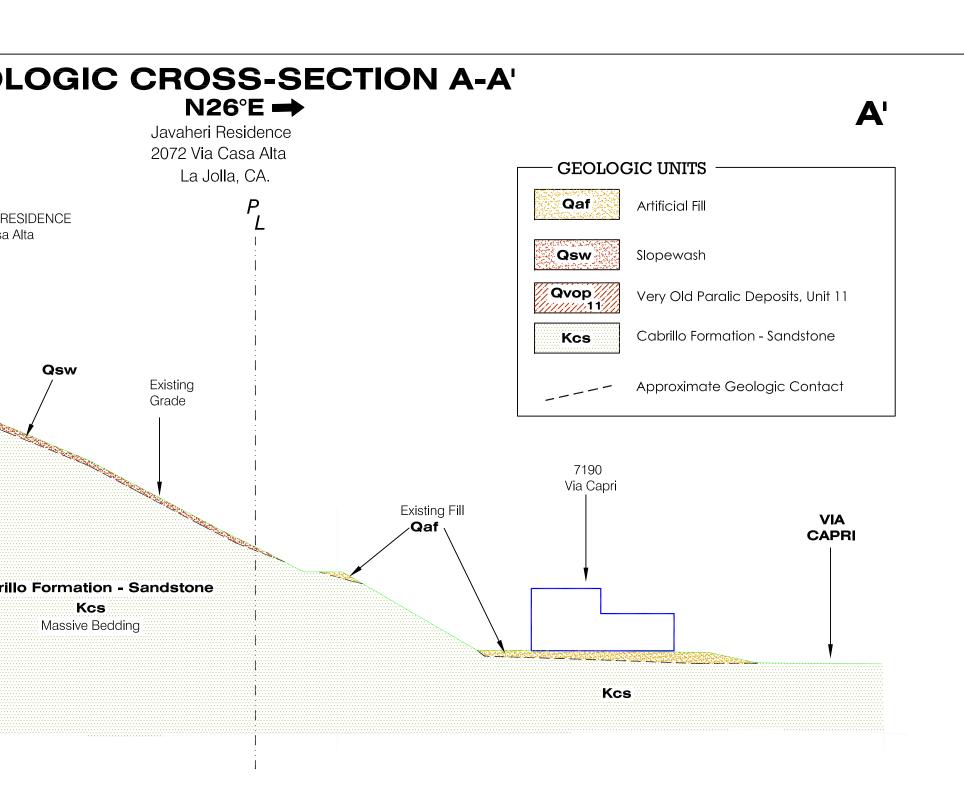

| Geotechnical Exploration, Inc. |        | EQUIPMENT: Bucket auger drill rig |  |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
|--------------------------------|--------|-----------------------------------|--|---|---------|---------------------------|--------------------------|-------------------------------|-------------------------|------------------------------|-----------------------|---------------------------|-----------------|-------------------|------------------|
|                                |        |                                   |  | <b>DIMENSI</b><br>30-inch di  |         |                           |                          | XCAV                          | ATION                   | :                            |                       |                           |                 |                   |                  |
|                                |        |                                   | D: December 20, 2021   |   |         |                           |                          | . 7001                        |                         |                              |                       |                           |                 |                   |                  |
|                                |        |                                   | JKH/MM   | SURFACE ELEVATION: ± 790' Above Mean Sea Level GROUNDWATER/SEEPAGE DEPTH: Not Encountered |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| KEVII                          | EWE    | :DB                               | Y: LDR   | GROUND  | WAI     | ER/S                      | EEPA                     | JE DEF                        | 'IH: r                  | Not Enc                      | ounter                | ed                        |                 |                   |                  |
|                                | ٦,     | ш                                 | FIELD DESCRIPTION AND CLASSIFICATION   |   |         | 3 NO. 200<br>6)           | E<br>RE (%)              | E DRY<br>/ (pcf)              | M<br>RE (%)             | M DRY<br>/ (pcf)             | / (% of               | (%-) -<br>(-%)            | EXPANSION INDEX | OUNTS /           | SAMPLE O.D. (in) |
| DEPTH<br>(feet)                | SYMBOL | SAMPLE                            | DESCRIPTION AND REMARKS<br>(Grain Size, Density, Moisture, Color   | )   | U.S.C.S | PASSING NO.:<br>SIEVE (%) | IN-PLACE<br>MOISTURE (%) | IN-PLACE DRY<br>DENSITY (pcf) | OPTIMUM<br>MOISTURE (%) | MAXIMUM DRY<br>DENSITY (pcf) | DENSITY (% of<br>MDD) | EXPAN (+%)<br>CONSOL (-%) | EXPANS          | BLOW COUNTS<br>FT | SAMPLE           |
| _<br>2                         |        |                                   | SLOPEWASH (Qsw) SANDY FAT CLAY. Very stiff. Moist. Dark brow Approx. 10% angular to rounded gravels and c Some roots.  | obbles.   | СН      |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 4 —<br>-<br>6 —                |        |                                   | CABRILLO FORMATION SANDSTONE (Kcs) SILTY SAND. Fine- to medium-grained. Dense Slightly moist. Yellowish brown. Micaceous. Disby adjacent Rose Canyon Fault Zone and resu tectonic uplift of Mount Soledad. | e.<br>sturbed   | SM      |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 8 —                            |        |                                   | @8': Clay filled fractures, near vertical.   |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 10 —<br>–                      |        |                                   | @10': Calcium carbonate filled fracture, near v dip ±70°SE.  | ertical,  |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 12 —<br>-<br>14 —              |        |                                   | @12': 1/4" caliche veins with 1/2-2" wide pebbl conglomerate, N55°E, dip 72°SE. @13.5': Pebble conglomerate terminates SE si boring.   | ide of  |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| _<br>16 —<br>_                 |        |                                   | <ul> <li>@14': Calcium carbonate filled fracture, near v ±78°SE, 1/2" wide.</li> <li>@15': Discontinuous offsets in gray and tan sa with random calcium carbonate veining.</li> </ul>                      |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 18 —<br>_                      |        |                                   | @18' Infilled fractures, 1/4-1/2" wide. @19' Some concretionary masses.  |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 20 —<br>–<br>22 —              |        |                                   |  |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 24 —<br>-<br>26 —              |        |                                   | @24': 3-4" layer of remolded clay, discontinuou<br>±15°<br>@25': drag folded on east side with N70°E trer<br>vertical thin discontinuous clay veins with some<br>calcium carbonate filling on east side.   | nd, near  |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 28 —                           |        |                                   |  |   |         |                           |                          |                               |                         |                              |                       |                           |                 |                   |                  |


|   | GROUNDWATER                | JOB NUMBER: 21-13556 |                 |
|---|----------------------------|----------------------|-----------------|
| X | BULK BAG SAMPLE            | JOB NAME:            | LOG NO. LDB-1   |
| 1 | IN-PLACE SAMPLE            | Javaheri Residence   |                 |
|   | MODIFIED CALIFORNIA SAMPLE | SITE LOCATION:       |                 |
| Н | IN-PLACE HAND-DRIVE SAMPLE | 2072 Via Casa Alta,  | FIGURE NO. IIIa |
|   | STANDARD PENETRATION TEST  | La Jolla, CA         |                 |

| Geotechnical Exploration, Inc. |        | EQUIPMENT: Bucket auger drill rig |  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
|--------------------------------|--------|-----------------------------------|--|---|---------|--------------------------|--------------------------|-------------------------------|-------------------------|------------------------------|-----------------------|---------------------------|-----------------|-------------------|------------------|
|                                | 7      |                                   | •  | DIMENSION & TYPE OF EXCAVATION: 30-inch diameter boring |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
|                                |        |                                   | <b>D:</b> December 20, 2021  | SURFACE ELEVATION: ± 790' Above Mean Sea Level          |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
|                                |        |                                   | JKH/MM   |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| REVII                          | EWE    | ED B                              | Y: LDR   | GROUNDWATER/SEEPAGE DEPTH: Not Encountered              |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
|                                |        |                                   | FIELD DESCRIPTION AND CLASSIFICATION   |   |         | NO. 200                  | :<br>:E (%)              | DRY (pcf)                     | ۸<br>RE (%)             | A DRY<br>(pcf)               | (% of                 | (%-)                      | EXPANSION INDEX | ) SINDO           | O.D. (in)        |
| DEPTH<br>(feet)                | SYMBOL | SAMPLE                            | DESCRIPTION AND REMARKS<br>(Grain Size, Density, Moisture, Color   | ·)  | U.S.C.S | PASSING NO.<br>SIEVE (%) | IN-PLACE<br>MOISTURE (%) | IN-PLACE DRY<br>DENSITY (pcf) | OPTIMUM<br>MOISTURE (%) | MAXIMUM DRY<br>DENSITY (pcf) | DENSITY (% of<br>MDD) | EXPAN (+%)<br>CONSOL (-%) | EXPANSI         | BLOW COUNTS<br>FT | SAMPLE O.D. (in) |
|                                |        |                                   | Numerous high angle fractures in sandstone.  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 30 —                           |        | 1                                 | @29-30': Concretion. 1/4-1/2" olive gray clay N 68°E. Discontinuous, truncated by high angle of gray clay veins.   |   |         | 34                       | 11.6                     | 119.5                         | 12.3                    | 120.3                        | 99                    |                           |                 |                   |                  |
| 32 —                           |        |                                   | <ul><li>@30': 5 blows with kelly bar.</li><li>@32': Low to high angle fractures filled with olibrown sand fractures in light brown sandstone</li></ul>   | •   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 34 —                           |        |                                   | @33-40': Massive fine- to medium-grained sar micaceous, fracturing continued, as noted abo   |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 36 —                           |        |                                   |  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 38 —<br>_                      |        |                                   |  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 40 —<br>–                      |        |                                   | @40': Concretion. Slight fracturing, no open fragenerally massive, some reddish brown iron or staining.  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 42 —<br>_                      |        |                                   |  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 44 —<br>-<br>46 —              |        |                                   | @45-46': Concretion, west wall.  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| -<br>48 —                      |        |                                   |  |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| _<br>50 —                      |        |                                   | @49': Large concretion, used rock auger.   |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| _<br>52 —                      |        |                                   | @52': Massive fine- to medium-grained sands continued below contact N80°E, 20°N. Thin grades the same and the | ay  |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 54 —<br>_                      |        |                                   | clayey sand veins, truncated, light brown sand with iron staining along veins.   | SIUHE   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |
| 56 —                           |        |                                   | @56': Concretion on west wall.   |   |         |                          |                          |                               |                         |                              |                       |                           |                 |                   |                  |


| $\bigvee$ | GROUNDWATER                | JOB NUMBER: 21-13556 |               |
|-----------|----------------------------|----------------------|---------------|
| $\bowtie$ | BULK BAG SAMPLE            | JOB NAME:            | LOG NO. LDB-1 |
| 1         | IN-PLACE SAMPLE            | Javaheri Residence   |               |
|           | MODIFIED CALIFORNIA SAMPLE | SITE LOCATION:       |               |
| Н         | IN-PLACE HAND-DRIVE SAMPLE | 2072 Via Casa Alta,  | FIGURE NO.    |
|           | STANDARD PENETRATION TEST  | La Jolla, CA         |               |

| Geotechnical Exploration, Inc. |   | EQUIPMENT: Bucket auger drill rig   |         |                           |                          |                               |                         |                              |              |                           |                 |                     |             |
|--------------------------------|---|---|---------|---------------------------|--------------------------|-------------------------------|-------------------------|------------------------------|--------------|---------------------------|-----------------|---------------------|-------------|
|                                |   | DIMENSION & TYPE OF EXCAVATION: 30-inch diameter boring                               |         |                           |                          |                               |                         |                              |              |                           |                 |                     |             |
| OGGED BY:                      | ED: December 20, 2021   | SURFACE ELEVATION: ± 790' Above Mean Sea Level  |         |                           |                          |                               |                         |                              |              |                           |                 |                     |             |
| EVIEWED B                      |   | GROUNDWATER/SEEPAGE DEPTH: Not Encountered  |         |                           |                          |                               |                         |                              |              |                           |                 |                     |             |
| LVILVVLD                       |   | GROOND  | 110     |                           |                          | JL DLI                        |                         | NOT LITE                     |              |                           | ×               |                     |             |
| -                              | FIELD DESCRIPTION AND CLASSIFICATION  |   |         | IG NO. 200<br>(%)         | IN-PLACE<br>MOISTURE (%) | IN-PLACE DRY<br>DENSITY (pcf) | OPTIMUM<br>MOISTURE (%) | MAXIMUM DRY<br>DENSITY (pcf) | ک (% of      | (%-) T(<br>(%+)           | EXPANSION INDEX | BLOW COUNTS /<br>FT | E O.D. (in) |
| (feet) SYMBOL                  | DESCRIPTION AND REMARKS<br>(Grain Size, Density, Moisture, Color  | r)  | U.S.C.S | PASSING NO.:<br>SIEVE (%) | IN-PLA(<br>MOIST         | IN-PLA(                       | OPTIMI<br>MOISTI        | MAXIM                        | DENSITY (% o | EXPAN (+%)<br>CONSOL (-%) | EXPAN           | BLOW (              | SAMPLE O.D. |
| 8 —                            | <ul> <li>@59': Some fractures, none open above conc west wall with some gravel, generally massive N40°E, 5°SE discontinuous 1/8-1/4" remolded brown clay, truncated 3" on north wall, clay rep by iron staining and calcium carbonate, 1' long on NW wall.</li> <li>@64-66': Dark gray clay block on west wall.</li> <li>@66': 6" wide high angle dark gray clay infilling light brown sandstone clasts.</li> <li>@69': Tapers out, depositional, parrallel iron s @70': Dark clay infilled fracture 2-3" wide, nea and discontinuous.</li> <li>@71': Truncated zone 12" wide deposition with iron staining.</li> <li>@73': Sandstone concretions continue.</li> <li>@76': Becomes fractured claystone-sandstone fragments, wavy surface N80°E, ±26°NW. Marfine- to medium-grained sandstone with occas gravels: light brown, iron staining continued wi vertical zones of dark brown to olive gray clay fractures, not brecciated, no sign of shearing, occassional sandstone clasts, blocky fractured claystone.</li> <li>Bottom of boring at 80 feet.</li> </ul> | olive olaced a zone g with taining.  r vertical on parallel e ssive sional the filled |         |                           |                          |                               |                         |                              |              |                           |                 |                     |             |

| <b>l</b> [ | $\bigvee$ | GROUNDWATER                | JOB NUMBER: 21-13556 |               |
|------------|-----------|----------------------------|----------------------|---------------|
|            | X         | BULK BAG SAMPLE            | JOB NAME:            | LOG NO. LDB-1 |
|            | 1         | IN-PLACE SAMPLE            | Javaheri Residence   |               |
|            |           | MODIFIED CALIFORNIA SAMPLE | SITE LOCATION:       |               |
|            | Н         | IN-PLACE HAND-DRIVE SAMPLE | 2072 Via Casa Alta,  | FIGURE NO.    |
|            |           | STANDARD PENETRATION TEST  | La Jolla, CA         |               |

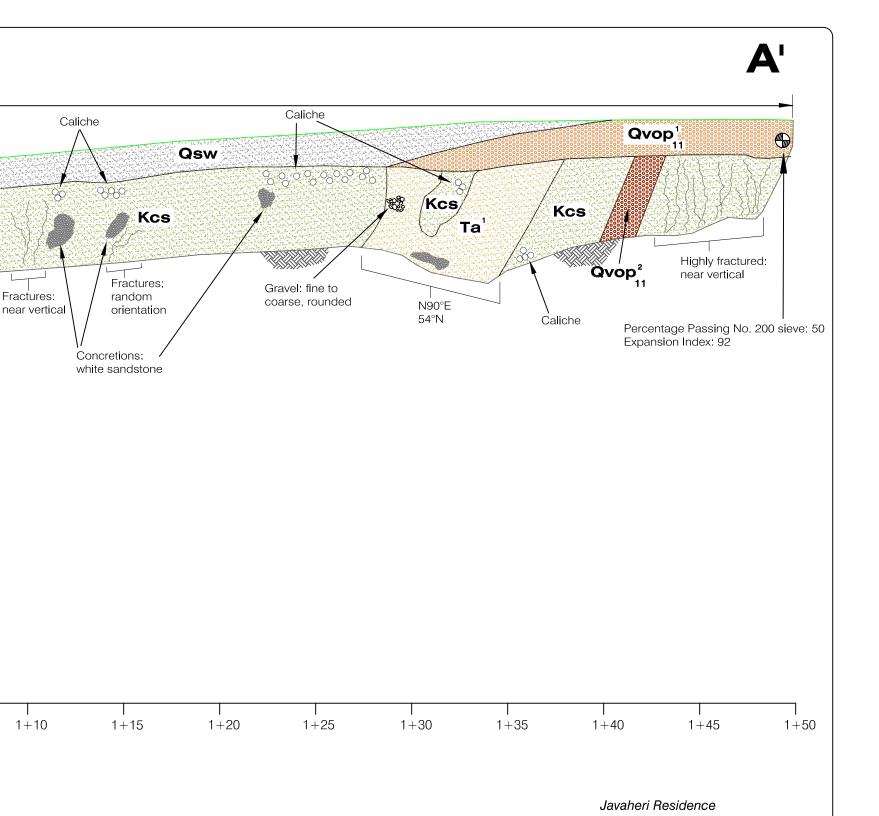

# **Laboratory Test Results**

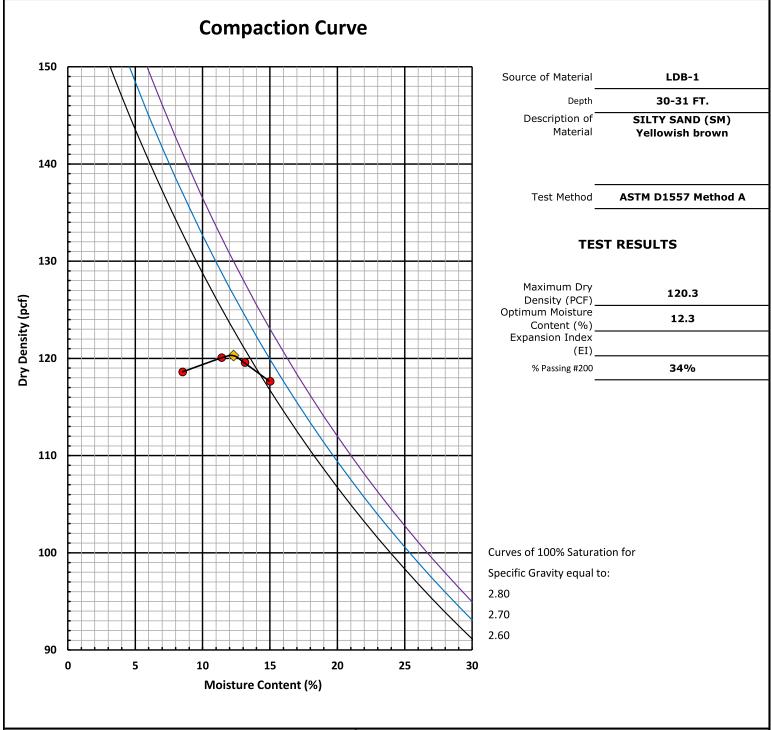



## **MOISTURE-DENSITY RELATIONSHIP**


Figure Number: IVa

Job Name: Javaheri Residence

Site Location: 2072 Via Casa Alta, La Jolla

Job Number: 21-13556

# **Laboratory Test Results**

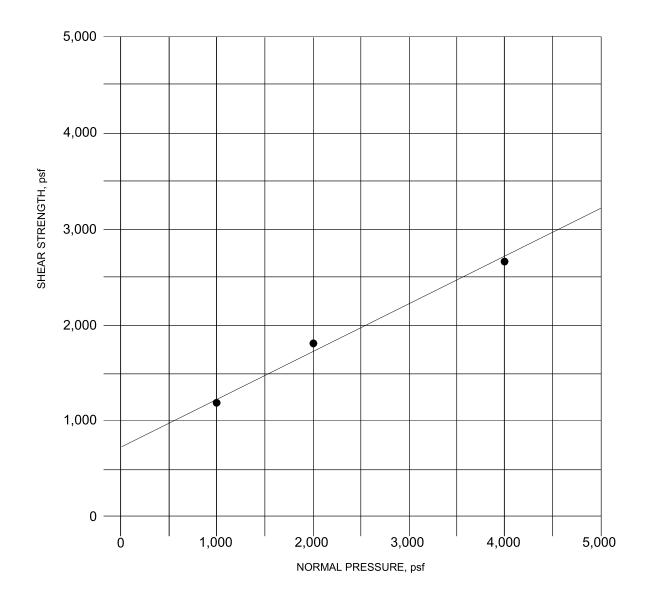

| Sp | pecimen I.D.   | Classification                          | $\gamma_{\!_{d}}$ | MC% | С   | ф    |
|----|----------------|---|-------------------|-----|-----|------|
| •  | T-1 @ 29-29.5' | SILTY SAND (SM), Undisturbed, Saturated |                   |     | 756 | 25.9 |
|    |                |   |                   |     |     |      |
|    |                |   |                   |     |     |      |
|    |                |   |                   |     |     |      |
|    |                |   |                   |     |     |      |
|    |                |   |                   |     |     |      |



# **DIRECT SHEAR TEST**

Figure Number: IVb

Job Name: Javaheri Residence

Site Location: 2072 Via Casa Alta, La Jolla, CA

Job Number: 21-13556



### EXCERPT FROM

#### GEOLOGIC MAP OF THE SAN DIEGO 30' x 60' QUADRANGLE, CALIFORNIA

By

Michael P. Kennedy<sup>1</sup> and Siang S. Tan<sup>1</sup> 2008

Digital preparation by

Kelly R. Bovard<sup>2</sup>, Anne G. Garcia<sup>2</sup>, Diane Burns<sup>2</sup>, and Carlos I. Gutierrez<sup>1</sup>

Department of Conservation, California Geological Survey
 U.S. Geological Survey, Department of Earth Sciences, University of California, Riverside

#### ONSHORE MAP SYMBOLS

Contact - Contact between geologic units; dotted where concealed.

Fault - Solid where accurately located; dashed where approximately located; dotted where concealed. U = upthrown block, D = downthrown block. Arrow and number indicate direction and angle of dip of fault plane.



Anticline - Solid where accurately located; dashed where approximately located; dotted where concealed. Arrow indicates direction of axial plunge.



Syncline - Solid where accurately located; dotted where concealed. Arrow indicates direction of axial plunge.



Landslide - Arrows indicate principal direction of movement. Queried where existence is questionable.

Strike and dip of beds

70 Inclined

Strike and dip of igneous joints

60

Inclined Vertical

<del>-0-</del>

Strike and dip of metamorphic foliation

55

Inclined

#### DESCRIPTION OF MAP UNITS

Qya Young Alluvial Deposits

Qvop<sub>11</sub> Very Old Paralic Deposits, unit 11

Qvop<sub>10</sub> Very Old Paralic Deposits, unit 10

Ta Ardath Shale

Tmsc Mount Soledad Formation - cobble conglomerate

Kcs Cabrillo Formation - Sandstone

Kccg Cabrillo Formation - cobble conglomerate

Kp Point Loma Formation


pt

### **LEGEND**

\_\_\_\_\_


lap

### Geologic Hazard Categories

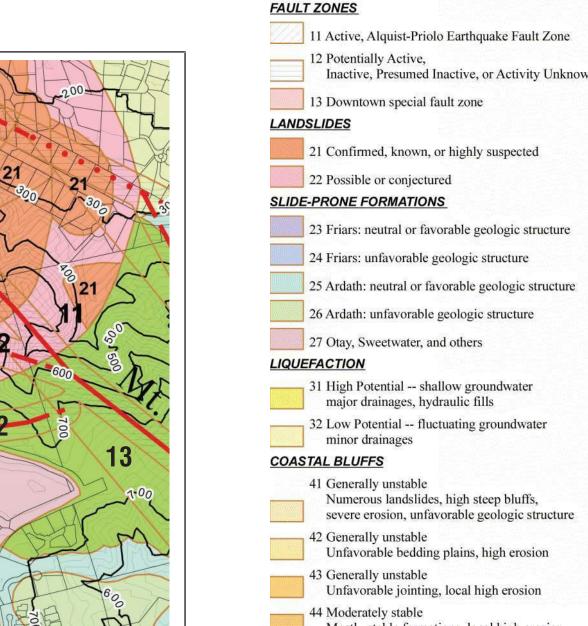

|     | 51 Level mesas underlain by terrace deposits and bedrock nomimal risk                         |
|-----|---|
|     | 52 Other level areas, gently sloping to steep terrain, favorable geologic structure, Low risk |
|     | 53 Level or sloping terrain, unfavorable geologic structure,<br>Low to moderate risk          |
|     | 54 Steeply sloping terrain, unfavorable or fault controlled geologic structure, Moderate risk |
|     | 55 Modified terrain (graded sites)<br>Nominal risk  |
| AUL | r (Bays and Lakes)  TS  Fault   |
|     | Inferred Fault  |
|     |   |
| ••• | Concealed Fault   |

# SUBGRADE RETAINING WALL DRAINAGE RECOMMENDATIONS

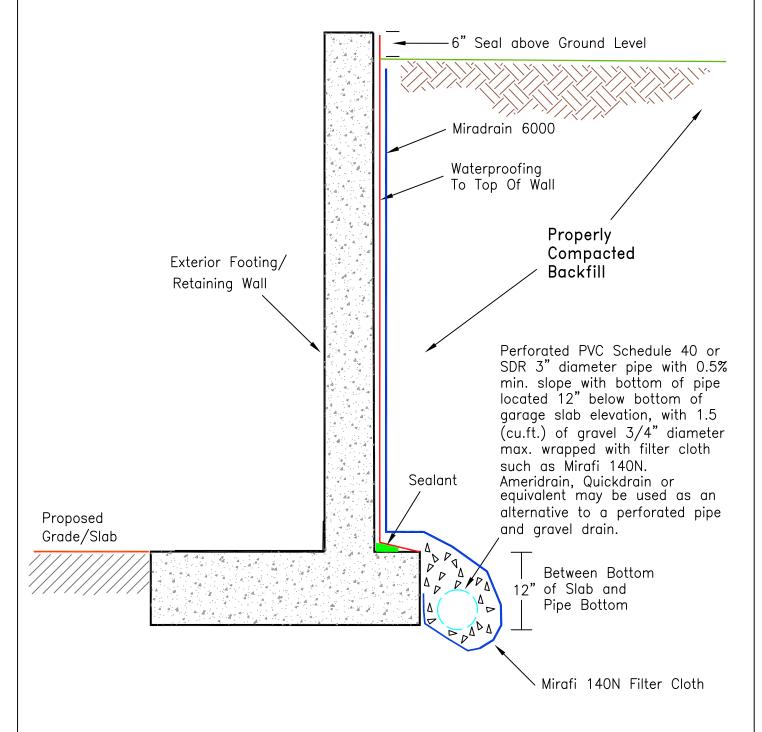

#### **NOT TO SCALE**

NOTE: As an option to Miradrain 6000, gravel or crushed rock 3/4" maximum diameter may be used with a minimum 12" thickness along the exterior face of the wall and 2.0 cu/ft of pipe.

Figure No. VII Job No. 21-13556



# APPENDIX A UNIFIED SOIL CLASSIFICATION CHART SOIL DESCRIPTION

#### Coarse-grained (More than half of material is larger than a No. 200 sieve)

| GRAVELS, CLEAN GRAVELS<br>(More than half of coarse fraction<br>is larger than No. 4 sieve size, but | GW | Well-graded gravels, gravel and sand mixtures, little or no fines.   |
|--|----|--|
| smaller than 3")   | GP | Poorly graded gravels, gravel and sand mixtures, little or no fines. |
| GRAVELS WITH FINES (Appreciable amount)  | GC | Clay gravels, poorly graded gravel-sand-silt mixtures                |
| SANDS, CLEAN SANDS<br>(More than half of coarse fraction   | SW | Well-graded sand, gravelly sands, little or no fines                 |
| is smaller than a No. 4 sieve)   | SP | Poorly graded sands, gravelly sands, little or no fines.             |
| SANDS WITH FINES   | SM | Silty sands, poorly graded sand and silty mixtures.                  |
| (Appreciable amount)   | SC | Clayey sands, poorly graded sand and clay mixtures.                  |

#### Fine-grained (More than half of material is smaller than a No. 200 sieve)

#### SILTS AND CLAYS

| <u>Liquid Limit Less than 50</u>    | ML | Inorganic silts and very fine sands, rock flour, sandy silt and clayey-silt sand mixtures with a slight plasticity |
|-------------------------------------|----|--|
|                                     | CL | Inorganic clays of low to medium plasticity, gravelly clays, silty clays, lean clays.                              |
|                                     | OL | Organic silts and organic silty clays of low plasticity.   |
| <u>Liquid Limit Greater than 50</u> | МН | Inorganic silts, micaceous or diatomaceous fine sandy or silty soils, elastic silts.                               |
|                                     | СН | Inorganic clays of high plasticity, fat clays.   |
|                                     | ОН | Organic clays of medium to high plasticity.  |
| HIGHLY ORGANIC SOILS                | PT | Peat and other highly organic soils  |



### **APPENDIX B**



Latitude, Longitude: 32.8397, -117.2511



 Date
 7/22/2022, 10:32:17 AM

 Design Code Reference Document
 ASCE7-16

 Risk Category
 II

 Site Class
 C - Very Dense Soil and Soft Rock

| Туре            | Value | Description   |
|-----------------|-------|---|
| S <sub>S</sub>  | 1.416 | MCE <sub>R</sub> ground motion. (for 0.2 second period) |
| S <sub>1</sub>  | 0.494 | MCE <sub>R</sub> ground motion. (for 1.0s period)       |
| S <sub>MS</sub> | 1.699 | Site-modified spectral acceleration value               |
| S <sub>M1</sub> | 0.742 | Site-modified spectral acceleration value               |
| S <sub>DS</sub> | 1.133 | Numeric seismic design value at 0.2 second SA           |
| S <sub>D1</sub> | 0.494 | Numeric seismic design value at 1.0 second SA           |

| Туре             | Value | Description   |
|------------------|-------|---|
| SDC              | D     | Seismic design category   |
| Fa               | 1.2   | Site amplification factor at 0.2 second   |
| F <sub>v</sub>   | 1.5   | Site amplification factor at 1.0 second   |
| PGA              | 0.647 | MCE <sub>G</sub> peak ground acceleration   |
| F <sub>PGA</sub> | 1.2   | Site amplification factor at PGA  |
| PGA <sub>M</sub> | 0.777 | Site modified peak ground acceleration  |
| TL               | 8     | Long-period transition period in seconds  |
| SsRT             | 1.416 | Probabilistic risk-targeted ground motion. (0.2 second)                                   |
| SsUH             | 1.637 | Factored uniform-hazard (2% probability of exceedance in 50 years) spectral acceleration  |
| SsD              | 2.272 | Factored deterministic acceleration value. (0.2 second)                                   |
| S1RT             | 0.494 | Probabilistic risk-targeted ground motion. (1.0 second)                                   |
| S1UH             | 0.558 | Factored uniform-hazard (2% probability of exceedance in 50 years) spectral acceleration. |
| S1D              | 8.0   | Factored deterministic acceleration value. (1.0 second)                                   |
| PGAd             | 0.942 | Factored deterministic acceleration value. (Peak Ground Acceleration)                     |
| C <sub>RS</sub>  | 0.865 | Mapped value of the risk coefficient at short periods                                     |
| C <sub>R1</sub>  | 0.886 | Mapped value of the risk coefficient at a period of 1 s                                   |

# **APPENDIX C**

Radiocarbon Age Dating Report





Beta Analytic, Inc. 4985 SW 74th Court

Miami, FL 33155 USA Tel: 305-667-5167 Fax: 305-663-0964

info@betalabservices.com

#### ISO/IEC 17025:2017-Accredited Testing Laboratory

June 06, 2022

Mr. Jay Heiser Geotechnical Exploration, Inc. 7420 Trade Street San Diego, CA 92121 United States

RE: Radiocarbon Dating Results

Dear Mr. Heiser,

Enclosed are the radiocarbon dating results for four samples recently sent to us. As usual, the method of analysis is listed on the report with the results and calibration data is provided where applicable. The Conventional Radiocarbon Ages have all been corrected for total fractionation effects and where applicable, calibration was performed using 2020 calibration databases (cited on the graph pages).

The web directory containing the table of results and PDF download also contains pictures, a cvs spreadsheet download option and a quality assurance report containing expected vs. measured values for 3-5 working standards analyzed simultaneously with your samples.

Reported results are accredited to ISO/IEC 17025:2017 Testing Accreditation PJLA #59423 standards and all chemistry was performed here in our laboratory and counted in our own accelerators here. Since Beta is not a teaching laboratory, only graduates trained to strict protocols of the ISO/IEC 17025:2017 Testing Accreditation PJLA #59423 program participated in the analyses.

As always Conventional Radiocarbon Ages and sigmas are rounded to the nearest 10 years per the conventions of the 1977 International Radiocarbon Conference. When counting statistics produce sigmas lower than +/- 30 years, a conservative +/- 30 BP is cited for the result unless otherwise requested. The reported d13C values were measured separately in an IRMS (isotope ratio mass spectrometer). They are NOT the AMS d13C which would include fractionation effects from natural, chemistry and AMS induced sources.

When interpreting the results, please consider any communications you may have had with us regarding the samples.

Thank you for prepaying the analyses. As always, if you have any questions or would like to discuss the results, don't hesitate to contact us.

Sincerely,

Ronald E. Hatfield President



4985 SW 74<sup>th</sup> Court Miami, FL 33155 USA Tel: 305-667-5167

Fax: 305-663-0964

info@betalabservices.com

ISO/IEC 17025:2017-Accredited Testing Laboratory

#### REPORT OF RADIOCARBON DATING ANALYSES

Jay Heiser Report Date: June 06, 2022

Geotechnical Exploration, Inc.

Material Received: May 20, 2022

Laboratory Number

Sample Code Number

Conventional Radiocarbon Age (BP) or
Percent Modern Carbon (pMC) & Stable Isotopes

**Beta - 628129 21-13556-1 3530 +/- 30 BP** IRMS δ13C; -23.8 ο/οο

(94.0%) 1945 - 1765 cal BC (3894 - 3714 cal BP) (1.4%) 1759 - 1750 cal BC (3708 - 3699 cal BP)

Submitter Material: Organic Sediment/Gyttja

Pretreatment: (organic sediment) acid washes

Analyzed Material: Organic sediment
Analysis Service: AMS-Standard delivery

Percent Modern Carbon: 64.44 +/- 0.24 pMC
Fraction Modern Carbon: 0.6444 +/- 0.0024

D14C: -355.60 +/- 2.41 o/oo

Δ14C: -361.19 +/- 2.41 o/oo (1950:2022)

Measured Radiocarbon Age: (without d13C correction): 3510 +/- 30 BP

Calibration: BetaCal4.20: HPD method: INTCAL20

Results are ISO/IEC-17025:2017 accredited. No sub-contracting or student labor was used in the analyses. All work was done at Beta in 4 in-house NEC accelerator mass spectrometers and 4 Thermo IRMSs. The "Conventional Radiocarbon Age" was calculated using the Libby half-life (5568 years), is corrected for total isotopic fraction and was used for calendar calibration where applicable. The Age is rounded to the nearest 10 years and is reported as radiocarbon years before present (BP), "present" = AD 1950. Results greater than the modern reference are reported as percent modern carbon (pMC). The modern reference standard was 95% the 14C signature of NIST SRM-4990C (oxalic acid). Quoted errors are 1 sigma counting statistics. Calculated sigmas less than 30 BP on the Conventional Radiocarbon Age are conservatively rounded up to 30. d13C values are on the material itself (not the AMS d13C). d13C and d15N values are relative to VPDB. References for calendar calibrations are cited at the bottom of calibration graph pages.



4985 SW 74<sup>th</sup> Court Miami, FL 33155 USA Tel: 305-667-5167

Fax: 305-663-0964

info@betalabservices.com

ISO/IEC 17025:2017-Accredited Testing Laboratory

#### REPORT OF RADIOCARBON DATING ANALYSES

Jay Heiser Report Date: June 06, 2022

Geotechnical Exploration, Inc.

Material Received: May 20, 2022

Laboratory Number

Sample Code Number

Conventional Radiocarbon Age (BP) or
Percent Modern Carbon (pMC) & Stable Isotopes

Beta - 628130 21-13556-2 3060 +/- 30 BP IRMS δ13C; -24.1 o/oo

(91.0%) 1412 - 1257 cal BC (3361 - 3206 cal BP) (4.4%) 1247 - 1227 cal BC (3196 - 3176 cal BP)

Submitter Material: Organic Sediment/Gyttja

Pretreatment: (organic sediment) acid washes

Analyzed Material: Organic sediment
Analysis Service: AMS-Standard delivery
Percent Modern Carbon: 68.32 +/- 0.26 pMC

Fraction Modern Carbon: 0.6832 +/- 0.20 pMC

D14C: -316.78 +/- 2.55 o/oo

Δ14C: -322.70 +/- 2.55 o/oo (1950:2022)

Measured Radiocarbon Age: (without d13C correction): 3040 +/- 30 BP

Calibration: BetaCal4.20: HPD method: INTCAL20

Results are ISO/IEC-17025:2017 accredited. No sub-contracting or student labor was used in the analyses. All work was done at Beta in 4 in-house NEC accelerator mass spectrometers and 4 Thermo IRMSs. The "Conventional Radiocarbon Age" was calculated using the Libby half-life (5568 years), is corrected for total isotopic fraction and was used for calendar calibration where applicable. The Age is rounded to the nearest 10 years and is reported as radiocarbon years before present (BP), "present" = AD 1950. Results greater than the modern reference are reported as percent modern carbon (pMC). The modern reference standard was 95% the 14C signature of NIST SRM-4990C (oxalic acid). Quoted errors are 1 sigma counting statistics. Calculated sigmas less than 30 BP on the Conventional Radiocarbon Age are conservatively rounded up to 30. d13C values are on the material itself (not the AMS d13C). d13C and d15N values are relative to VPDB. References for calendar calibrations are cited at the bottom of calibration graph pages.



4985 SW 74<sup>th</sup> Court Miami, FL 33155 USA Tel: 305-667-5167

Fax: 305-663-0964

info@betalabservices.com

ISO/IEC 17025:2017-Accredited Testing Laboratory

#### REPORT OF RADIOCARBON DATING ANALYSES

Jay Heiser Report Date: June 06, 2022

Geotechnical Exploration, Inc.

Material Received: May 20, 2022

Laboratory Number

Sample Code Number

Conventional Radiocarbon Age (BP) or
Percent Modern Carbon (pMC) & Stable Isotopes

**Beta - 628131 21-13556-3 2090 +/- 30 BP** | RMS δ13C: -24.3 o/oo

(91.2%) 178 - 38 cal BC (2127 - 1987 cal BP) ( 2.8%) 13 cal BC - 4 cal AD (1962 - 1946 cal BP) ( 1.3%) 196 - 185 cal BC (2145 - 2134 cal BP)

Submitter Material: Organic Sediment/Gyttja

Pretreatment: (organic sediment) acid washes

Analyzed Material: Organic sediment
Analysis Service: AMS-Standard delivery
Percent Modern Carbon: 77.09 +/- 0.29 pMC

Fraction Modern Carbon: 0.7709 +/- 0.0029

D14C: -229.09 +/- 2.88 o/oo

Δ14C: -235.77 +/- 2.88 o/oo (1950:2022)

Measured Radiocarbon Age: (without d13C correction): 2080 +/- 30 BP

Calibration: BetaCal4.20: HPD method: INTCAL20

Results are ISO/IEC-17025:2017 accredited. No sub-contracting or student labor was used in the analyses. All work was done at Beta in 4 in-house NEC accelerator mass spectrometers and 4 Thermo IRMSs. The "Conventional Radiocarbon Age" was calculated using the Libby half-life (5568 years), is corrected for total isotopic fraction and was used for calendar calibration where applicable. The Age is rounded to the nearest 10 years and is reported as radiocarbon years before present (BP), "present" = AD 1950. Results greater than the modern reference are reported as percent modern carbon (pMC). The modern reference standard was 95% the 14C signature of NIST SRM-4990C (oxalic acid). Quoted errors are 1 sigma counting statistics. Calculated sigmas less than 30 BP on the Conventional Radiocarbon Age are conservatively rounded up to 30. d13C values are on the material itself (not the AMS d13C). d13C and d15N values are relative to VPDB. References for calendar calibrations are cited at the bottom of calibration graph pages.

## Calibration of Radiocarbon Age to Calendar Years

(High Probability Density Range Method (HPD): INTCAL20)

(Variables: d13C = -23.8 o/oo)

Laboratory number Beta-628129


Conventional radiocarbon age 3530 ± 30 BP

#### 95.4% probability

| (94%)  | 1945 - 1765 cal BC | (3894 - 3714 cal BP) |
|--------|--------------------|----------------------|
| (1.4%) | 1759 - 1750 cal BC | (3708 - 3699 cal BP) |

#### 68.2% probability

| (28.6%) | 1922 - 1873 cal BC | (3871 - 3822 cal BP) |
|---------|--------------------|----------------------|
| (21.3%) | 1846 - 1817 cal BC | (3795 - 3766 cal BP) |
| (18.3%) | 1802 - 1776 cal BC | (3751 - 3725 cal BP) |

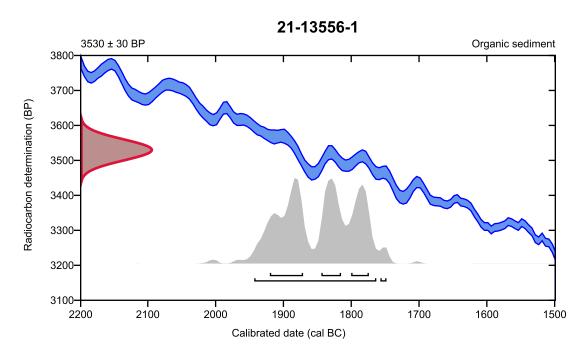

# Database used INTCAL20

#### References

#### **References to Probability Method**

Bronk Ramsey, C. (2009). Bayesian analysis of radiocarbon dates. Radiocarbon, 51(1), 337-360.

**References to Database INTCAL20** 

Reimer, et al., 2020, Radiocarbon 62(4):725-757.

## Calibration of Radiocarbon Age to Calendar Years

(High Probability Density Range Method (HPD): INTCAL20)

(Variables: d13C = -24.1 o/oo)

Laboratory number Beta-628130


Conventional radiocarbon age 3060 ± 30 BP

#### 95.4% probability

| (91%)  | 1412 - 1257 cal BC | (3361 - 3206 cal BP) |
|--------|--------------------|----------------------|
| (4.4%) | 1247 - 1227 cal BC | (3196 - 3176 cal BP) |

#### 68.2% probability

| (35.9%) | 1389 - 1337 cal BC | (3338 - 3286 cal BP) |
|---------|--------------------|----------------------|
| (32.3%) | 1322 - 1274 cal BC | (3271 - 3223 cal BP) |

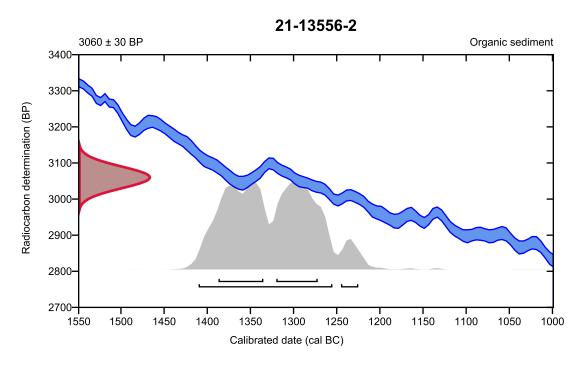

# Database used INTCAL20

#### References

#### **References to Probability Method**

Bronk Ramsey, C. (2009). Bayesian analysis of radiocarbon dates. Radiocarbon, 51(1), 337-360.

#### **References to Database INTCAL20**

Reimer, et al., 2020, Radiocarbon 62(4):725-757.

## Calibration of Radiocarbon Age to Calendar Years

(High Probability Density Range Method (HPD): INTCAL20)

(Variables: d13C = -24.3 o/oo)

Laboratory number Beta-628131


Conventional radiocarbon age 2090 ± 30 BP

#### 95.4% probability

| (91.2%) | 178 - 38 cal BC      | (2127 - 1987 cal BP) |
|---------|----------------------|----------------------|
| (2.8%)  | 13 cal BC - 4 cal AD | (1962 - 1946 cal BP) |
| (1.3%)  | 196 - 185 cal BC     | (2145 - 2134 cal BP) |

#### 68.2% probability

| (54.6%) | 121 - 51 cal BC  | (2070 - 2000 cal BP) |
|---------|------------------|----------------------|
| (13.6%) | 150 - 131 cal BC | (2099 - 2080 cal BP) |

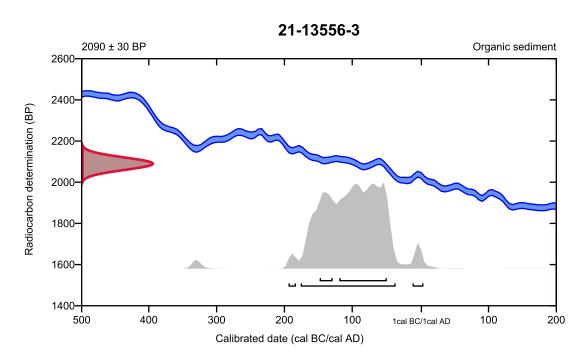

# Database used INTCAL20

#### References

#### **References to Probability Method**

Bronk Ramsey, C. (2009). Bayesian analysis of radiocarbon dates. Radiocarbon, 51(1), 337-360.

#### References to Database INTCAL20

Reimer, et al., 2020, Radiocarbon 62(4):725-757.



4985 SW 74th Court Miami, FL 33155 USA

Tel: 305-667-5167 Fax: 305-663-0964

info@betalabservices.com

ISO/IEC 17025:2017-Accredited Testing Laboratory

#### **Quality Assurance Report**

This report provides the results of reference materials used to validate radiocarbon analyses prior to reporting. Known-value reference materials were analyzed quasi-simultaneously with the unknowns. Results are reported as expected values vs measured values. Reported values are calculated relative to NISTSRM-1990C and corrected for isotopic fractionation. Results are reported using the direct analytical measure percent modern carbon (pMC) with one relative standard deviation. Agreement between expected and measured values is taken as being within 2 sigma agreement (error x 2) to account for total laboratory error.

Report Date: Submitter:

June 09, 2022 Mr. Jay Heiser

#### **QA MEASUREMENTS**

Reference 1

Expected Value: 129.41 +/- 0.06 pMC

Measured Value: 129.44 +/- 0.35 pMC

Agreement: Accepted

Reference 2

Expected Value: 0.42 +/- 0.04 pMC

Measured Value: 0.42 +/- 0.04 pMC

Agreement: Accepted

Reference 3

Expected Value: 96.69 +/- 0.50 pMC

Measured Value: 97.40 +/- 0.29 pMC

Agreement: Accepted


COMMENT: All measurements passed acceptance tests.


Validation: Date: June 09, 2022


# **APPENDIX D**


Slope Stability Analysis



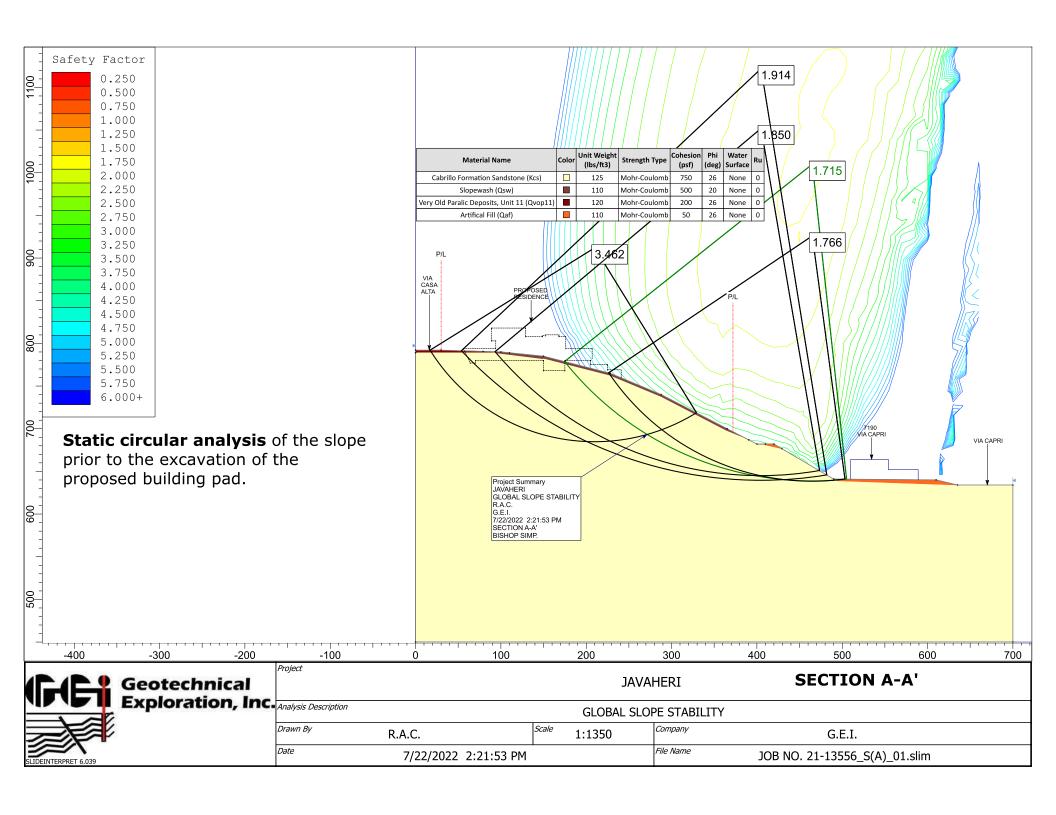

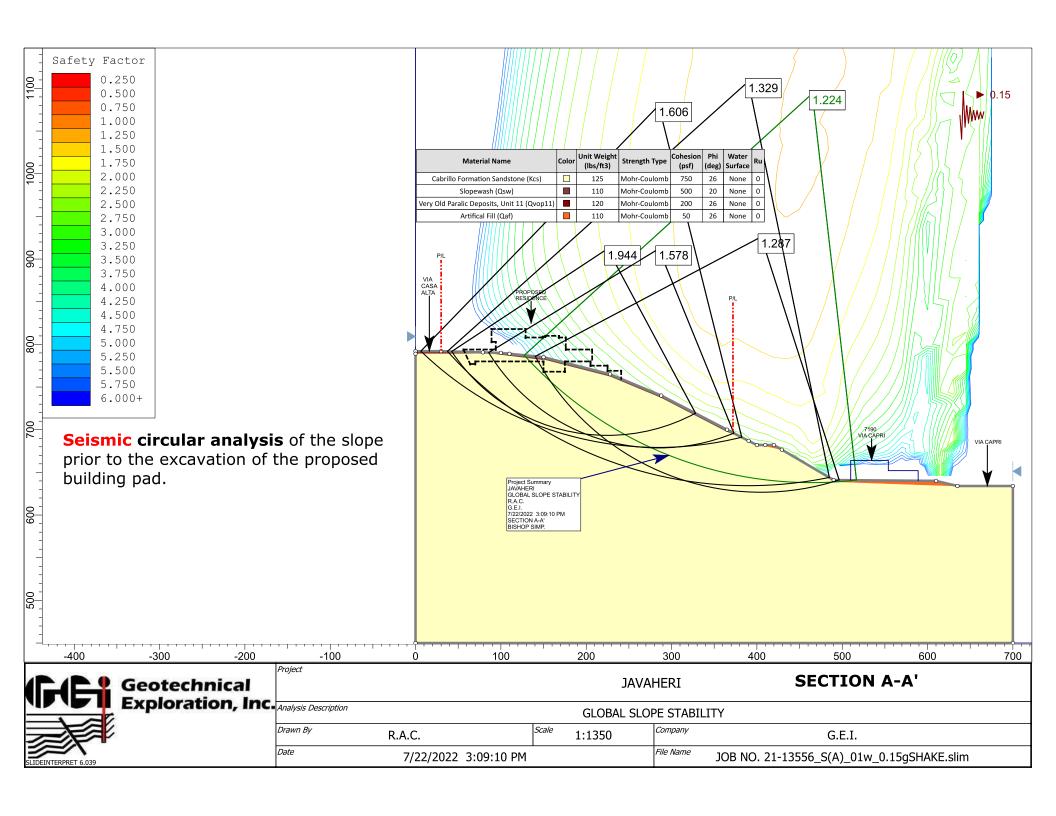

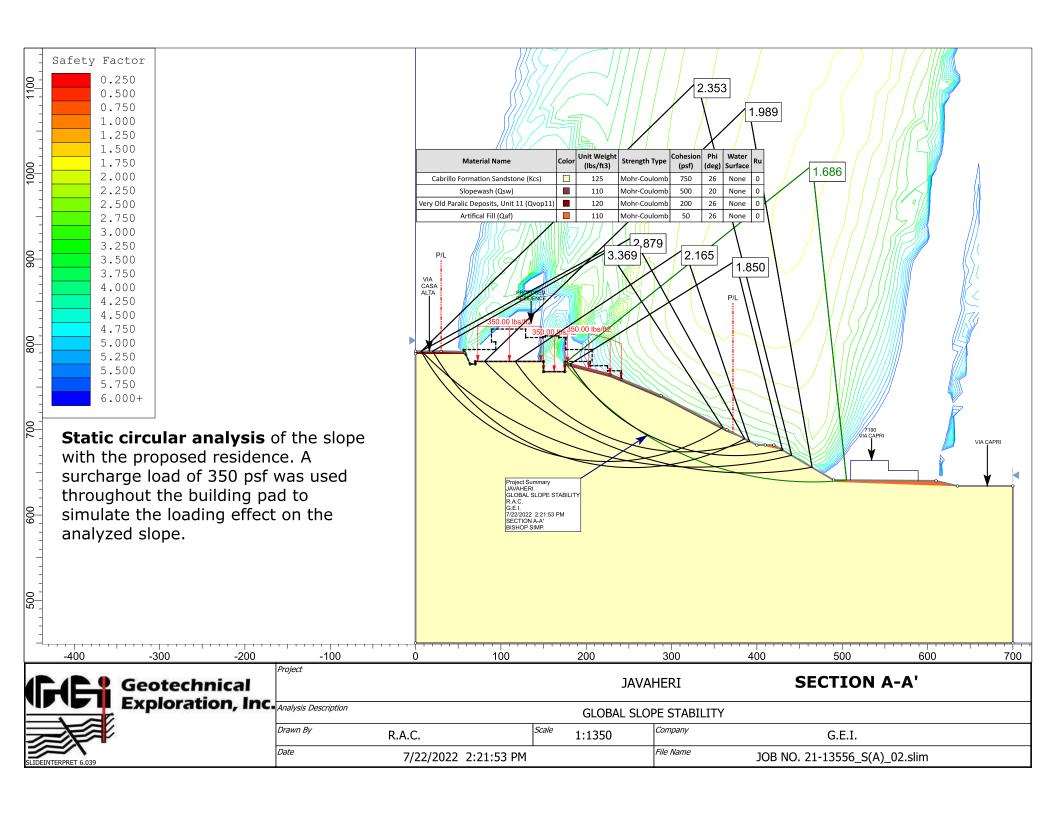

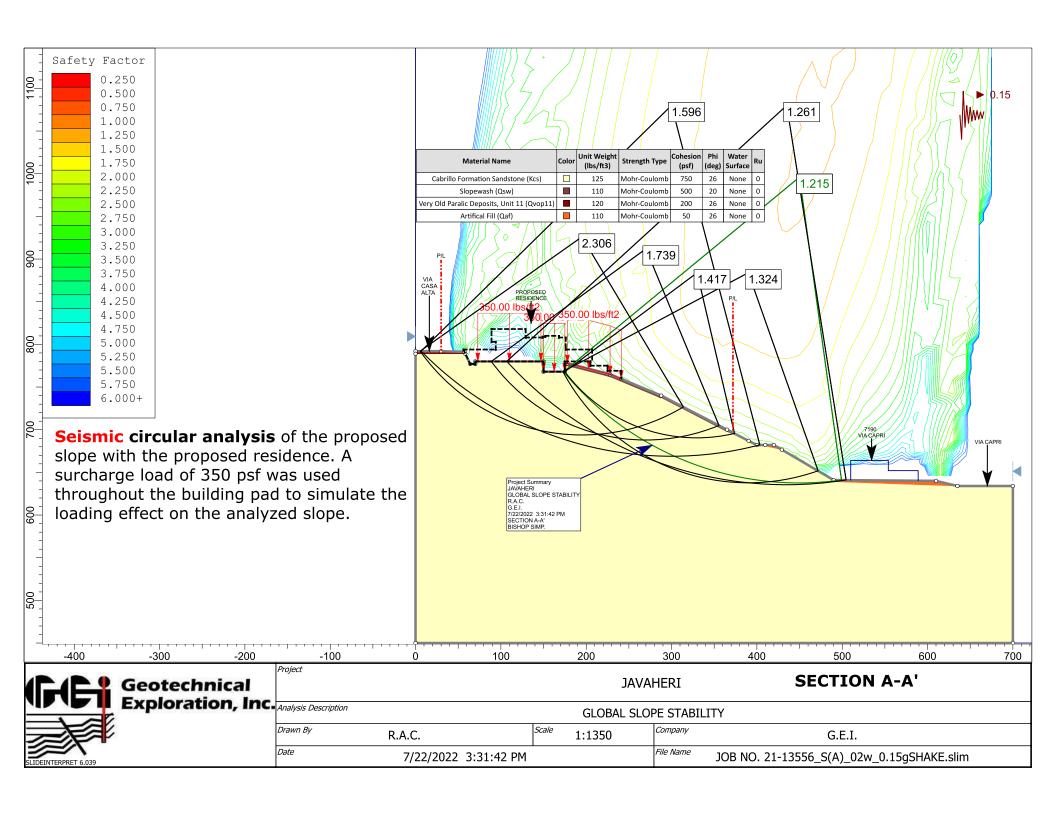

#### **SURFICIAL FAILURE**

EQUATION 1
$$FOS = \frac{c' + (\gamma_T - \gamma_W)z_W \cos(\alpha)^2 \tan \varphi'}{\gamma_T z_W \sin \alpha \cos \alpha}$$

| $\Upsilon_{t}$ | $\Upsilon_{ m w}$ | Υ'   | z <sub>w</sub> |
|----------------|-------------------|------|----------------|
| pcf            | pcf               | pcf  | ft             |
| 110            | 62.4              | 47.6 | 3.28           |

SURFICIAL SLOPE STABILITY ANALYSIS IS BASED ON EQUATION (1) FOR THE CALCULATED VALUES. Reference: Abramson L.W., Lee T.S., Sharma S., Boyce G.M., 2002, Slope Stability and Stabilziation Methods, 2nd Edition, John Wiley and Sons, Inc.,

| SECTION A-A'    |         |       |      |        |
|-----------------|---------|-------|------|--------|
| SOIL TYPE       | c (psf) | φ'(°) | α(°) | F.O.S. |
| Slopewash (Qsw) | 500     | 20    | 27   | 3.735  |

1 meter = 3.28 feet

Special Publication 117A (2008, page 27): for infinite slope analysis, the minimum assumed depth of soil saturation is the smaller of either a depth of one meter or depth to firm bedrock.

| α              | The slope angle; (inclination angle) with respect to the horizontal plane        |  |  |
|----------------|--|--|--|
| ф'             | The effective friction angle of the soil   |  |  |
| c'             | The effective cohesion of the soil   |  |  |
| Υ <sub>t</sub> | The total unit weight (Soil with moisture)                                       |  |  |
| Υ <sub>w</sub> | The unit weight of the water   |  |  |
| Υ'             | Submerged unit weight of the soil (Saturated unit weight - unit weight of water) |  |  |
| z <sub>w</sub> | Vertical depth of the saturated soil   |  |  |
| F.O.S.         | Factor of Safety   |  |  |

Slopes with Factor of Safety values **ABOVE** 1.50 are stable.

